

WEAR CONTAMINATION **FLUID CONDITION**

NORMAL NORMAL NORMAL


{UNASSIGNED}


PIERCE Truck 1 (39449)


Component Hydraulic System


RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		WC0947599		
	Sample Date		Client Info		02 Jul 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
VEAR	Iron	ppm	ASTM D5185m	>20	<1		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		0		
	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>10	0		
	Lead	ppm	ASTM D5185m	>10	0		
	Copper	ppm	ASTM D5185m	>75	2		
	Tin	ppm	ASTM D5185m	>10	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>20	1		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	0		
	Water		WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		2		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		0		
The condition of the on is acceptable for the time in service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		2		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		6		
	Calcium	ppm	ASTM D5185m		119		
	Phosphorus	ppm	ASTM D5185m		610		
	Zinc	ppm	ASTM D5185m		788		
	Sulfur	ppm	ASTM D5185m		1683		

Report Id: PARPARAR [WUSCAR] 06233709 (Generated: 07/13/2024 13:09:28) Rev: 1

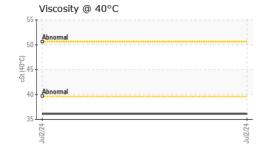

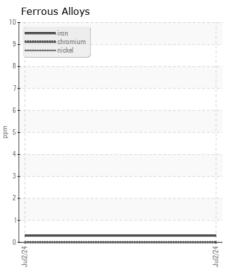

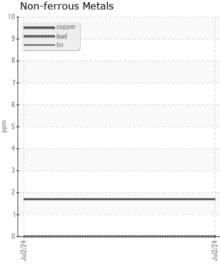

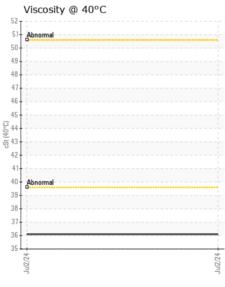



Certificate L2367

Laboratory Sample No.

: WC0947599 Lab Number : 06233709 Unique Number : 11117202 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 11 Jul 2024 **Tested** : 12 Jul 2024

Diagnosed : 13 Jul 2024 - Don Baldridge

PARAGOULD FIRE DEPARTMENT

1405 WEST KINGS HWY PARAGOULD, AR US 72450

Contact: KYLE JACKSON KYLE.JACKSON@PARAGOULDCITY.ORG

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: PARPARAR [WUSCAR] 06233709 (Generated: 07/13/2024 13:09:30) Rev: 1

Submitted By: RANDY PRICE

F: (870)239-7528

T: