



PacLease

# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**8464529**  
 Component  
**Diesel Engine**  
 Fluid  
**MOBIL DELVAC 1300 SUPER 15W40 (48 GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>RPL0021901</b>	RPL0019309	RPL0011975
Sample Date		Client Info		<b>28 Jun 2024</b>	01 Apr 2024	22 Mar 2023
Machine Age	mls	Client Info		<b>236939</b>	212616	201083
Oil Age	mls	Client Info		<b>24323</b>	0	21705
Filter Age	mls	Client Info		<b>24323</b>	0	21705
Oil Changed		Client Info		<b>Changed</b>	Not Changd	Not Changd
Filter Changed		Client Info		<b>Changed</b>	Not Changd	Not Changd
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>80</b>	56	39
Chromium	ppm	ASTM D5185m	>20	<b>2</b>	2	1
Nickel	ppm	ASTM D5185m	>4	<b>&lt;1</b>	1	0
Titanium	ppm	ASTM D5185m		<b>5</b>	<1	0
Silver	ppm	ASTM D5185m	>3	<b>&lt;1</b>	<1	<1
Aluminum	ppm	ASTM D5185m	>20	<b>8</b>	5	6
Lead	ppm	ASTM D5185m	>40	<b>5</b>	2	<1
Copper	ppm	ASTM D5185m	>330	<b>4</b>	3	1
Tin	ppm	ASTM D5185m	>15	<b>1</b>	2	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	<1	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION

There is no indication of any contamination in the oil.


Silicon	ppm	ASTM D5185m	>25	<b>8</b>	6	5
Potassium	ppm	ASTM D5185m	>20	<b>7</b>	6	6
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844	>3	<b>0.5</b>	0.2	0.5
Nitration	Abs/cm	*ASTM D7624	>20	<b>11.8</b>	7.1	10.5
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>24.6</b>	19.4	24.7
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>3</b>	2	2
Boron	ppm	ASTM D5185m	0	<b>9</b>	5	42
Barium	ppm	ASTM D5185m	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	0	<b>60</b>	62	46
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	2	<1
Magnesium	ppm	ASTM D5185m	0	<b>959</b>	888	545
Calcium	ppm	ASTM D5185m		<b>1260</b>	1114	1720
Phosphorus	ppm	ASTM D5185m		<b>1113</b>	1091	698
Zinc	ppm	ASTM D5185m		<b>1392</b>	1192	891
Sulfur	ppm	ASTM D5185m		<b>3512</b>	3470	2713
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>23.3</b>	15.6	23.7
Base Number (BN)	mg KOH/g	ASTM D2896	9.4	<b>5.7</b>	9.2	8.2
Visc @ 100°C	cSt	ASTM D445	14	<b>13.6</b>	12.9	13.3


**FT-IR (Direct Trend)**

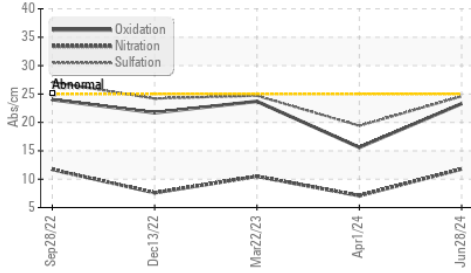


**Ferrous Alloys**

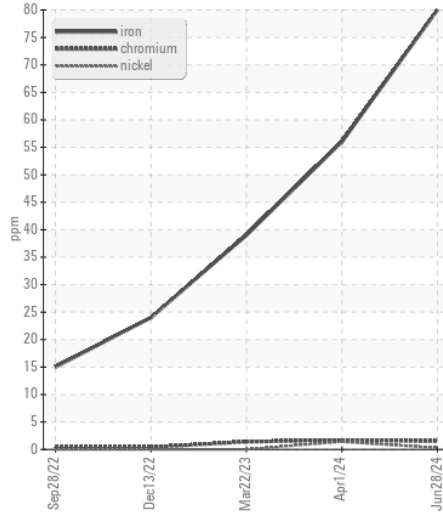


**Base Number**

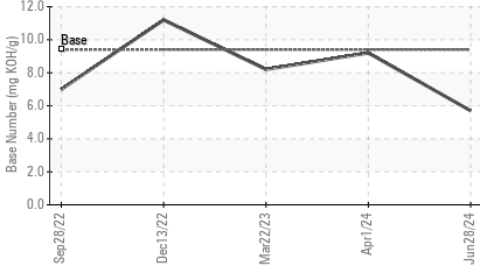


**Non-ferrous Metals**

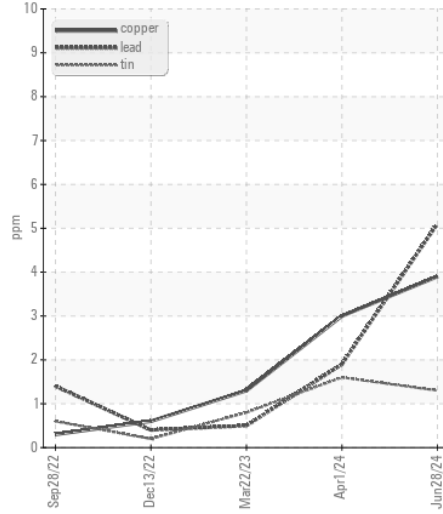


**Viscosity @ 100°C**

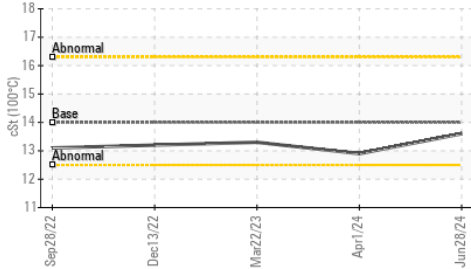

**Viscosity @ 100°C**

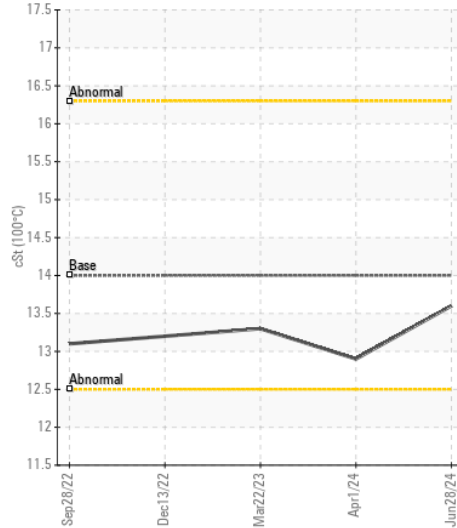

**Base Number**

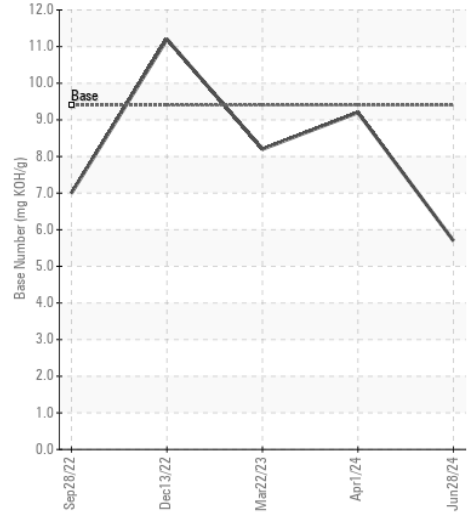

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : RPL0021901  
**Lab Number** : 06234485  
**Unique Number** : 11123319  
**Test Package** : FLEET

**RTL PACLEASE - 7006 - Pico Rivera**  
 7837 Telegraph Rd  
 Pico Rivera, CA  
 US 90660  
 Contact: GERARDO CARROLA  
 carrolag@rushenterprises.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: