WEAR CONTAMINATION FLUID CONDITION

NORMAL

ABNORMAL

NORMAL


Machine Id

## 5400034

Hydraulic System

CHEVRON CLARITY HYDRAULIC AW 68 (--- GAL)

	mit/Abn Curren	,	History2
Client Info	WC0808	656	
Client Info	28 Mar 2	024	
Client Info	9139		
Client Info	0		
Client Info	0		
Client Info	Chang	ed	
Client Info	N/A		
	ABNORI	1AL	
ASTM D5185m >2	20 8		
ASTM D5185m >1	·10 <b>&lt;1</b>		
ASTM D5185m >1	10 <b>0</b>		
ASTM D5185m	0		
ASTM D5185m	0		
ASTM D5185m >1			
ASTM D5185m >1			
ASTM D5185m >7			
ASTM D5185m >1			
ASTM D5185m	0		
	IONE NON	IE	
	IONE NON		
ASTM D5185m >2	·20 <b>6</b>		
ASTM D5185m >2	·20 <b>0</b>		
NC Method >0	0.1 <b>NE</b> G	i	
ASTM D7647 >5	5000 🔺 <b>307</b>	6	
ASTM D7647 >1	1300 🔺 <b>544</b> 0	·	
ASTM D7647 >1	160 <b>A 209</b>		
ASTM D7647 >4	40 38		
ASTM D7647 >1	10 2		
ASTM D7647 >3	·3 <b>0</b>		
SO 4406 (c) >19	19/17/14 <u> </u>	/15	
Visual NO	IONE NO	IE	
Visual NO	IONE NO		
Visual NO	IONE NO	IE	
'Visual NC	ORML NOF	ML	
Visual NC	ORML NOF	ML	
'Visual >0	0.1 <b>NE</b> G		
ASTM D5185m	2		
ASTM D5185m	0		
ASTM D5185m	<1		
ASTM D5185m	0		
ASTM D5185m	0		
ASTM D5185m	0		
ASTM D5185m	12		
ASTM D5185m	225		
ASTM D5185m	<1		
AST	M D5185m TM D8045 TM D445 6		M D8045 <b>0.14</b>

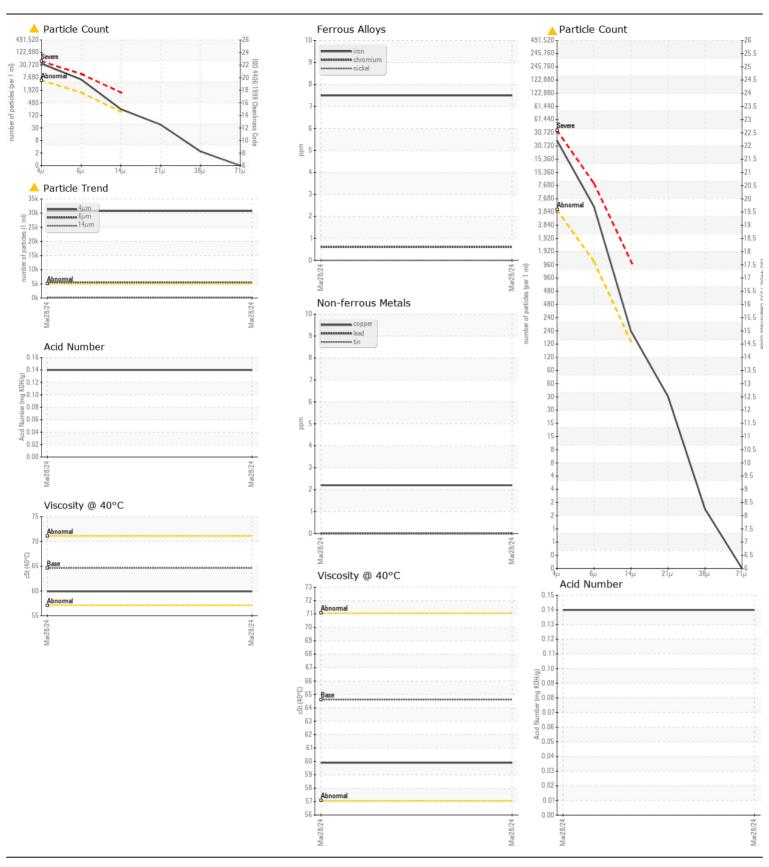



Certificate L2367

Laboratory Sample No.

: WC0808656 Lab Number : 06234805 Unique Number : 11123639

Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 12 Jul 2024 **Tested** : 15 Jul 2024

: 15 Jul 2024 - Don Baldridge Diagnosed

**KELLER NORTH AMERICA - TAMPA** 6850 BENJAMIN RD

TAMPA, FL US 33634

Contact: MARK CONRAD maconrad@haywardbaker.com

T: (813)884-3441 F: (813)886-6261

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)