WEAR CONTAMINATION FLUID CONDITION


NORMAL ABNORMAL NORMAL

Machine Id

1YN544GAAPLA00153

Hydraulic System

{not provided} (GAL)					.,		
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
We recommend you service the filters on this component. Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		JR0220495		
	Sample Date		Client Info		09 Jul 2024		
	Machine Age	hrs	Client Info		999		
	Oil Age	hrs	Client Info		999		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				ABNORMAL		
WEAR	PQ		ASTM D8184		14		
	Iron	ppm	ASTM D5185m	>20	0		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m	7.0	<1		
	Silver	ppm	ASTM D5185m		<1		
	Aluminum	ppm	ASTM D5185m	>10	3		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		<1		
	Tin	ppm	ASTM D5185m		0		
	Vanadium	ppm	ASTM D5185m	>10	<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
OONIT A MINIA TION	0.00		AOTA DEADE				
CONTAMINATION	Silicon	ppm	ASTM D5185m		<1		
There is a high amount of silt (particulates < 14 microns in size) present in the oil.	Potassium	ppm	ASTM D5185m		1		
	Water		WC Method	>0.1	NEG		
	Particles >4µm		ASTM D7647		<u>^</u> 23743		
	Particles >6µm		ASTM D7647		<u>4634</u>		
	Particles >14µm		ASTM D7647		92		
	Particles >21µm		ASTM D7647		11		
	Particles >38μm		ASTM D7647		1		
	Particles >71μm		ASTM D7647		0		
	Oil Cleanliness		ISO 4406 (c)		<u>^</u> 22/19/14		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		0		
	Boron	ppm	ASTM D5185m		0		
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.	Barium	ppm	ASTM D5185m		<1		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m		0		
	Magnesium	ppm	ASTM D5185m		2		
	Calcium	ppm	ASTM D5185m		87		
	Phosphorus	ppm	ASTM D5185m		574		
	Zinc	ppm	ASTM D5185m		877		
	Sulfur	ppm	ASTM D5185m		1522		
	Acid Number (AN)	mg KOH/g	ASTM D3103111		0.79		
	Visc @ 40°C	cSt	ASTM D6045		61.2		
	VISC @ 40°C	COL	A3 1 W D445		01.2		

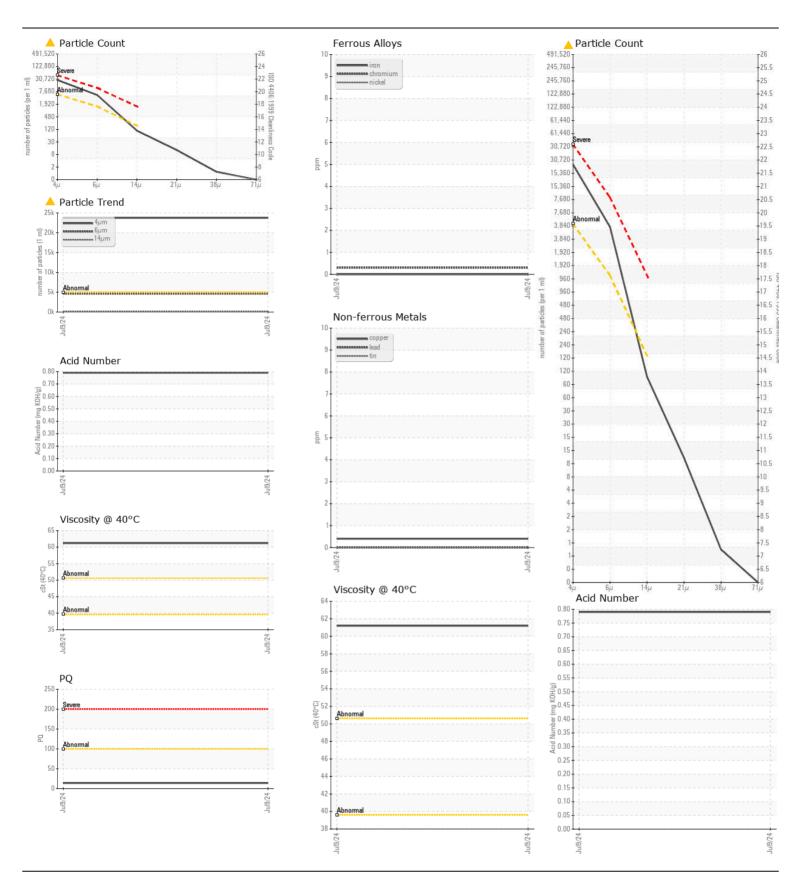



Certificate L2367

Report Id: JAMCHA [WUSCAR] 06235805 (Generated: 07/16/2024 14:15:15) Rev: 1

Laboratory Sample No. Lab Number

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : JR0220495 : 06235805

Unique Number : 11124639

Received **Tested** Diagnosed : 15 Jul 2024

: 16 Jul 2024

Test Package : CONST (Additional Tests: PQ)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

: 16 Jul 2024 - Don Baldridge US 28269 Contact: CHARLOTTE SHOP myoung@jamesriverequipment.com

T: (704)597-0211 F: (704)596-6198

JRE - CHARLOTTE

CHARLOTTE, NC

9550 STATESVILLE ROAD

Submitted By: Mike Young - CHARLOTTE SHOP