
WEAR CONTAMINATION FLUID CONDITION **NORMAL NORMAL NORMAL**

PETER HANSEN [6762]

VOLVO PENTA IPS-F 3940016962

Starboard IPS

{not provided} (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VPA055948		
	Sample Date		Client Info		10 Jul 2024		
	Machine Age	hrs	Client Info		511		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR	PQ		ASTM D8184		16		
	Iron	ppm	ASTM D5185m	>275	35		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m	>4	<1		
	Titanium	ppm	ASTM D5185m	>3	0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>10	3		
	Lead	ppm	ASTM D5185m	>4	0		
	Copper	ppm	ASTM D5185m	>30	2		
	Tin	ppm	ASTM D5185m	>3	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m	>35	7		
	Potassium	ppm	ASTM D5185m	>20	<1		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		6		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		401		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		4		
	Calcium	ppm	ASTM D5185m		0		
	Phosphorus	ppm	ASTM D5185m		1627		
	Zinc	ppm	ASTM D5185m		12		
	Sulfur	ppm	ASTM D5185m		26824		
	Visc @ 40°C	cSt	ASTM D445		106		

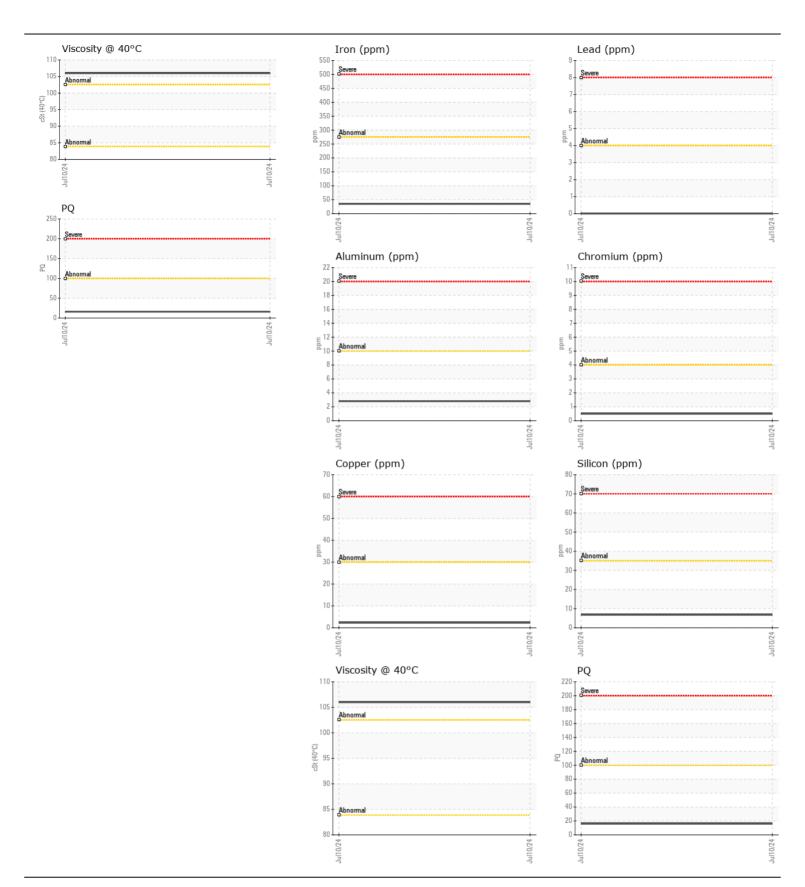



Report Id: VP759009 [WUSCAR] 06237096 (Generated: 07/17/2024 15:42:58) Rev: 1

Laboratory Sample No.

: VPA055948 Lab Number : 06237096 Unique Number : 11125930

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Received **Tested**

: 17 Jul 2024 Diagnosed Test Package: MOB 1 (Additional Tests: PQ)

: 17 Jul 2024 - Don Baldridge

: 15 Jul 2024

US 98225 Contact: TRAVIS THOMAS ttdiesel@yahoo.com T: (360)739-9525

1325 ROEDER AVE SUITE 103

Northwest Diesel Power

BELLINGHAM, WA

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: