



# VOLVO

## OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area

[578360 T&K CONSTRUCT]

Machine Id

VOLVO A45G 352823

Component

Hydraulic System

Fluid

VOLVO SUPER HYDRAULIC OIL 46 (--- GAL)

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP451226	---	---
Sample Date		Client Info		10 Jun 2024	---	---
Machine Age	hrs	Client Info		4183	---	---
Oil Age	hrs	Client Info		4183	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Not Chngd	---	---
Filter Changed		Client Info		Changed	---	---
Sample Status				NORMAL	---	---

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>50	7	---	---
Chromium	ppm	ASTM D5185m	>20	0	---	---
Nickel	ppm	ASTM D5185m	>10	0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m		0	---	---
Aluminum	ppm	ASTM D5185m	>20	<1	---	---
Lead	ppm	ASTM D5185m	>20	<1	---	---
Copper	ppm	ASTM D5185m	>150	<1	---	---
Tin	ppm	ASTM D5185m	>20	0	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

### CONTAMINATION










The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185m	>20	6	---	---
Potassium	ppm	ASTM D5185m	>20	0	---	---
Water		WC Method	>0.1	NEG	---	---
Particles >4µm		ASTM D7647		8943	---	---
Particles >6µm		ASTM D7647	>5000	1080	---	---
Particles >14µm		ASTM D7647	>160	27	---	---
Particles >21µm		ASTM D7647	>40	3	---	---
Particles >38µm		ASTM D7647	>10	0	---	---
Particles >71µm		ASTM D7647	>3	0	---	---
Oil Cleanliness		ISO 4406 (c)	>-/19/14	20/17/12	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.1	NEG	---	---

### FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		1	---	---
Boron	ppm	ASTM D5185m	14	0	---	---
Barium	ppm	ASTM D5185m	0.0	0	---	---
Molybdenum	ppm	ASTM D5185m	0.0	<1	---	---
Manganese	ppm	ASTM D5185m	0.0	0	---	---
Magnesium	ppm	ASTM D5185m	2.6	14	---	---
Calcium	ppm	ASTM D5185m	49	98	---	---
Phosphorus	ppm	ASTM D5185m	354	370	---	---
Zinc	ppm	ASTM D5185m	419	453	---	---
Sulfur	ppm	ASTM D5185m	3719	2188	---	---
Acid Number (AN)	mg KOH/g	ASTM D8045		0.35	---	---
Visc @ 40°C	cSt	ASTM D445	46	43.3	---	---

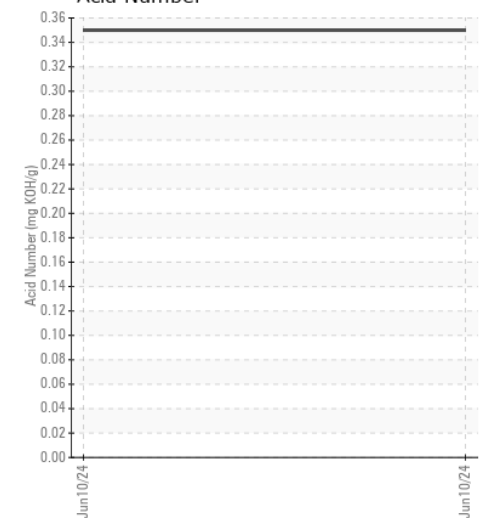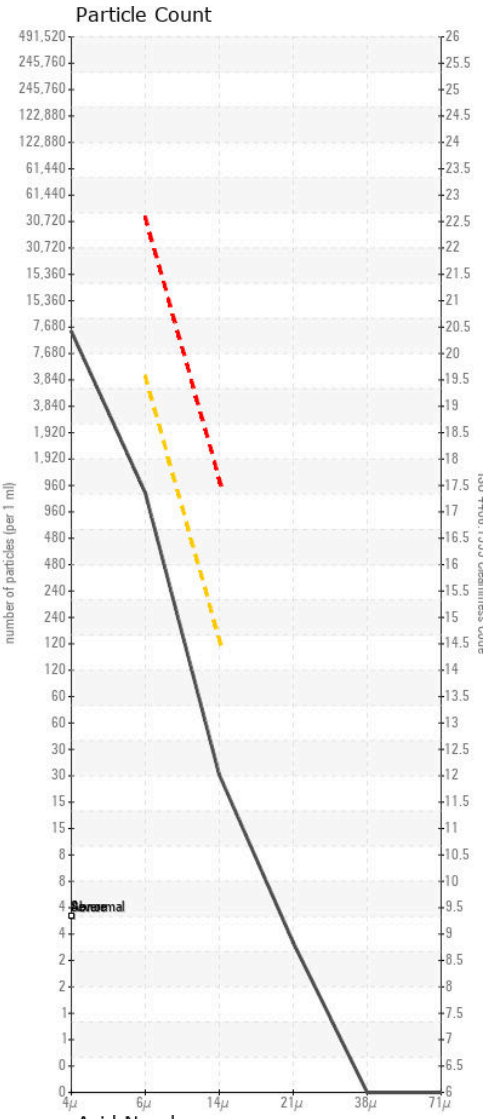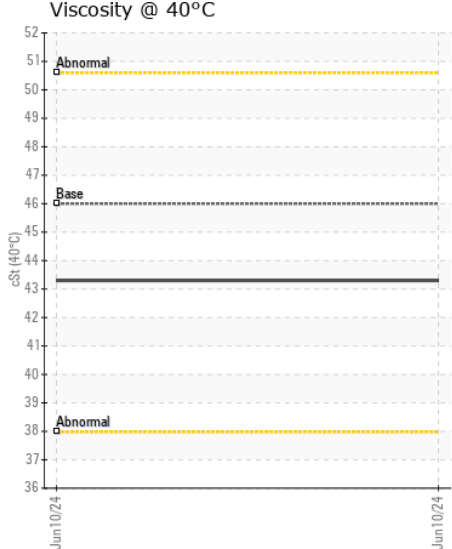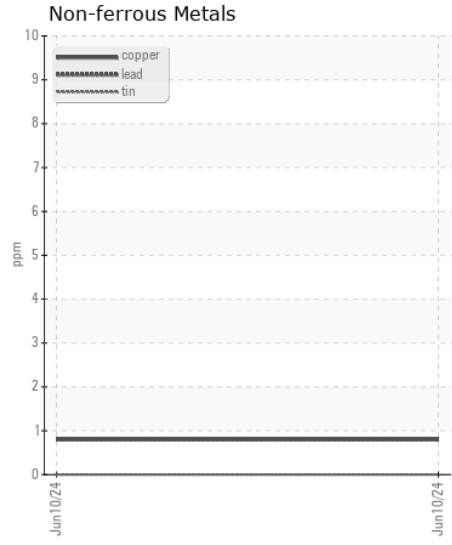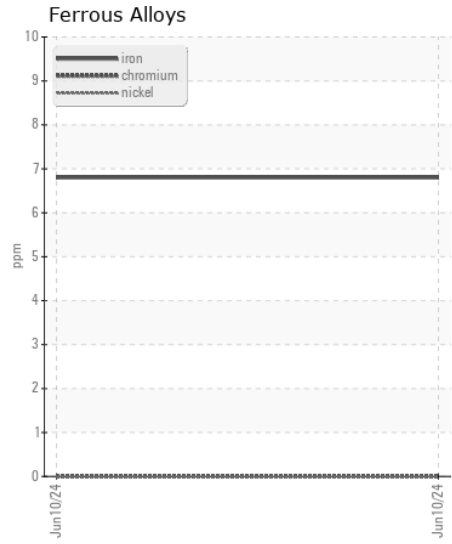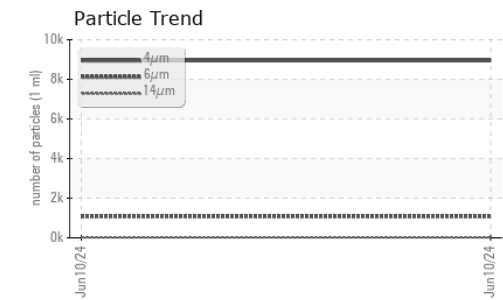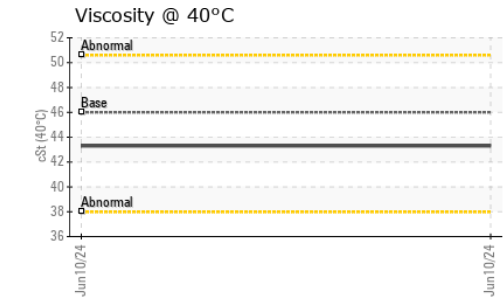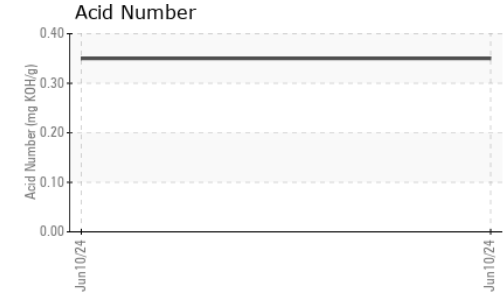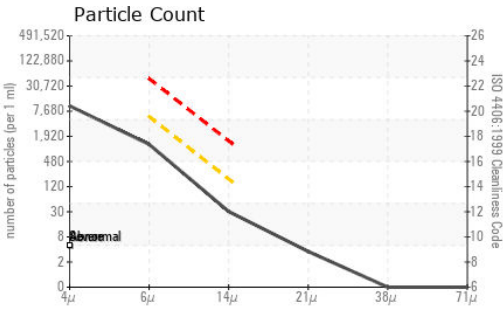

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP451226  
**Lab Number** : 06237702  
**Unique Number** : 11126536  
**Test Package** : MOB 2

**Received** : 16 Jul 2024  
**Tested** : 17 Jul 2024  
**Diagnosed** : 17 Jul 2024 - Wes Davis

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC  
 8418 PALM RIVER ROAD  
 TAMPA, FL  
 US 33619  
 Contact: JOHN FARDELLA  
 john.fardella@altg.com  
 T: (813)630-0077  
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)