
WEAR CONTAMINATION FLUID CONDITION **NORMAL NORMAL NORMAL**

[717830 HERC RENTALS]

VOLVO EC140EL 315218

Rear Left Final Drive

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP439656		
	Sample Date		Client Info		03 Jun 2024		
	Machine Age	hrs	Client Info		748		
	Oil Age	hrs	Client Info		748		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR	Iron	nnm	ASTM D5185m	>500	109		
	Chromium	ppm	ASTM D5185m		2		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m	>10	<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>25	2		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		<1		
	Tin	ppm	ASTM D5185m		7		
	Vanadium	ppm	ASTM D5185m	,	0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>75	11		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	2		
	Water			>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		<1		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	379	5		
	Barium	ppm	ASTM D5185m	0.0	0		
	Molybdenum	ppm	ASTM D5185m	0.8	<1		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m	31	<1		
	Calcium	ppm	ASTM D5185m	38	0		
	Phosphorus	ppm	ASTM D5185m	1077	167		
	Zinc	ppm	ASTM D5185m	46	8		
	Sulfur	ppm	ASTM D5185m	23526	12972		
	Visc @ 40°C	cSt	ASTM D445	139	134		

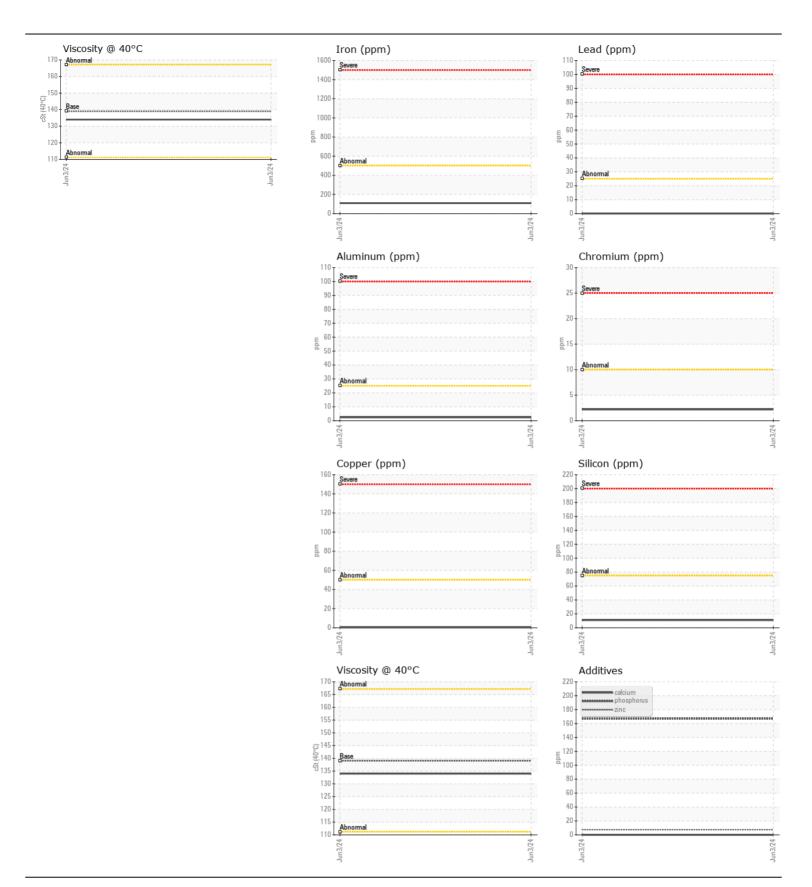



Certificate L2367

Laboratory Sample No. Lab Number : 06238184

Test Package : MOB 1

: VCP439656 Unique Number : 11127018

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 16 Jul 2024

Tested : 17 Jul 2024 : 18 Jul 2024 - Sean Felton Diagnosed

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD

TAMPA, FL US 33619

Contact: JOHN FARDELLA

john.fardella@altg.com T: (813)630-0077

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (813)630-2233