
**WEAR CONTAMINATION FLUID CONDITION**  **NORMAL NORMAL NORMAL** 

## [578360 T AND K] **VOLVO A45G 352823**

**Bogie/Center Axle** 

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP443029		
	Sample Date		Client Info		10 Jun 2024		
	Machine Age	hrs	Client Info		4183		
	Oil Age	hrs	Client Info		3000		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>900	346		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	4		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>30	2		
	Lead	ppm	ASTM D5185m	>50	0		
	Copper	ppm	ASTM D5185m	>150	3		
	Tin	ppm	ASTM D5185m	>20	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Ciliana		ACTM DE105	Ε0	<u>-</u>		
There is no indication of any contamination in the oil.	Silicon	ppm	ASTM D5185m	>50	5		
	Potassium Water	ppm	ASTM D5185m WC Method	>0.2	6 NEG		
	Silt	scalar	*Visual	NONE	MODER		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium		ASTM D5185m		<1		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	270	224		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		7		
	Manganese	ppm	ASTM D5185m		9		
	Magnesium	ppm	ASTM D5185m		2		
	Calcium	ppm	ASTM D5185m		60		
	Phosphorus	ppm	ASTM D5185m		2132		
	Zinc	ppm		46	39		
	Sulfur	ppm	ASTM D5185m		24230		
	Visc @ 40°C	cSt	ASTM D445		51.8		



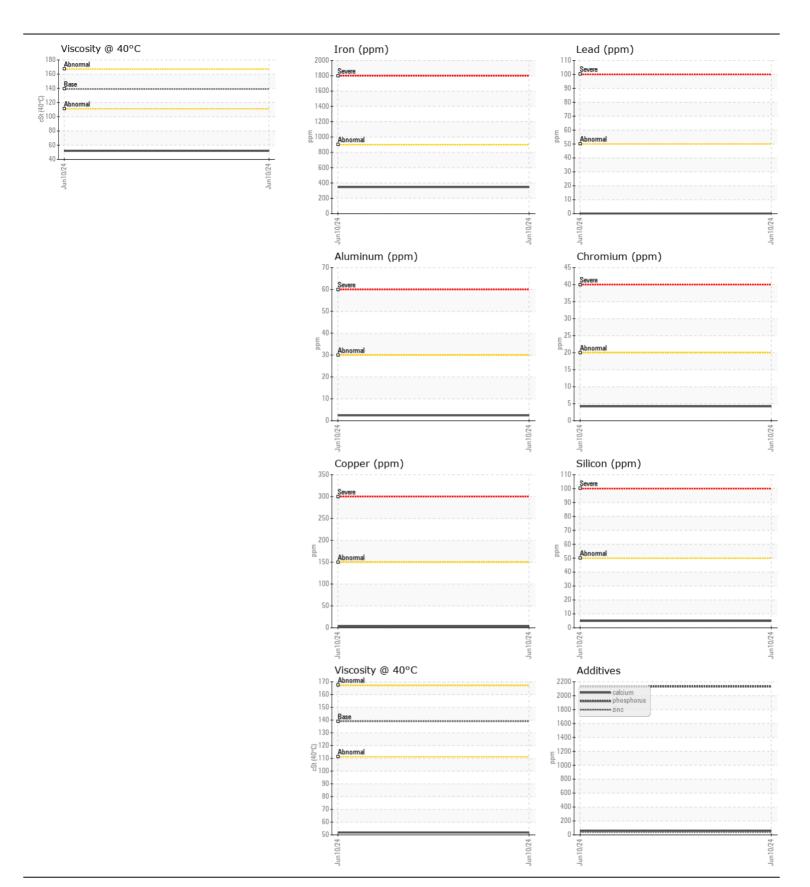

Certificate L2367

Laboratory Sample No.

: VCP443029 Lab Number : 06238193 Unique Number : 11127027

Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 16 Jul 2024 **Tested** 

: 17 Jul 2024 : 18 Jul 2024 - Sean Felton Diagnosed

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD

TAMPA, FL US 33619

Contact: KENNY HANEY khaney@flaglerce.com T: (813)630-0077

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (813)630-2233

Contact/Location: KENNY HANEY - VOLVO0093