
**WEAR** CONTAMINATION **FLUID CONDITION**  **NORMAL NORMAL NORMAL** 

## [578360 T AND K] **VOLVO A45G 352823**

Rear Axle

VOLVO PREMIUM GEAR OIL	80W-90 GL-5	( G	AL)				
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP442130		
	Sample Date		Client Info		10 Jun 2024		
	Machine Age	hrs	Client Info		4183		
	Oil Age	hrs	Client Info		3000		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>900	274		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	3		
	Nickel	ppm	ASTM D5185m	>10	1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>30	2		
	Lead	ppm	ASTM D5185m	>50	0		
	Copper	ppm	ASTM D5185m	>150	5		
	Tin	ppm	ASTM D5185m	>20	0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	4		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		3		
	Water	PP	WC Method		NEG		
	Silt	scalar	*Visual	NONE	MODER		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		0		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m	379	207		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		4		
	Manganese	ppm	ASTM D5185m		7		
	Magnesium	ppm	ASTM D5185m		2		
	Calcium	ppm	ASTM D5185m		74		
	Phosphorus	ppm	ASTM D5185m		2227		
	Zinc	ppm	ASTM D5185m	46	44		
	Sulfur	ppm	ASTM D5185m	23526	26211		
	Visc @ 40°C	cSt	ASTM D445	139	47.8		



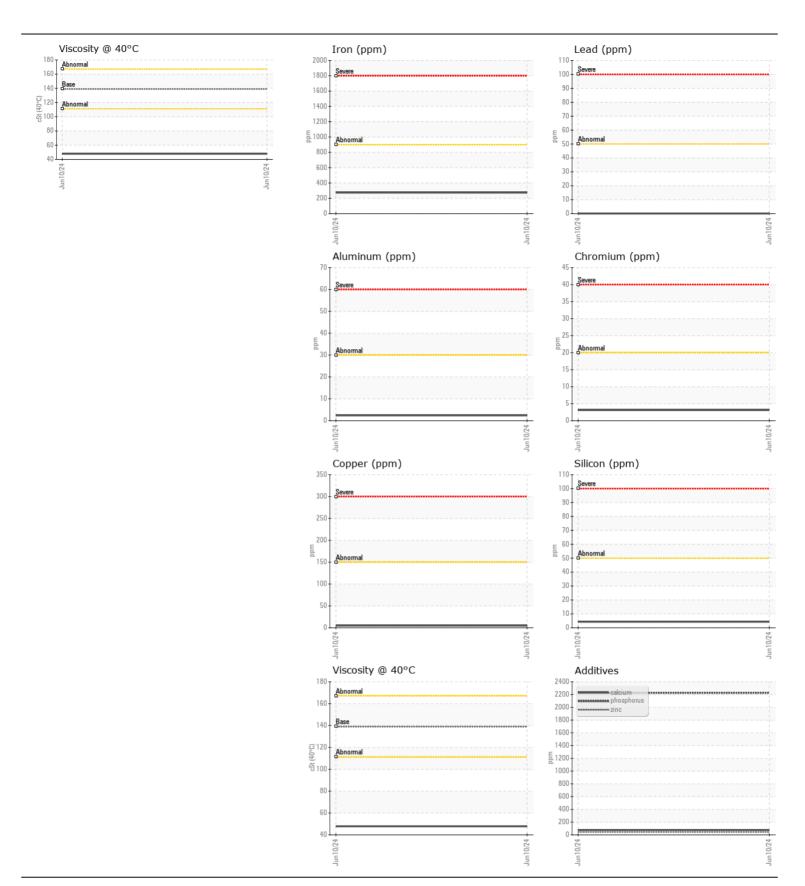

Certificate L2367

Laboratory Sample No.

Lab Number : 06238203 Unique Number : 11127037 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : VCP442130

: 16 Jul 2024 **Tested** : 17 Jul 2024 : 18 Jul 2024 - Sean Felton Diagnosed

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD

TAMPA, FL US 33619 Contact: KENNY HANEY

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. khaney@flaglerce.com T: (813)630-0077

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (813)630-2233