



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**VOLVO A40G 342010**  
Component  
**Bogie/Center Axle**  
Fluid  
**MOBIL MOBILUBE HD PLUS 80W90 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP447429</b>	VCP406134	VCP362756
Sample Date		Client Info		<b>09 Jul 2024</b>	01 Aug 2023	10 May 2023
Machine Age	hrs	Client Info		<b>10091</b>	8039	7457
Oil Age	hrs	Client Info		<b>451</b>	582	1226
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changed</b>	Not Changed	Changed
Filter Changed		Client Info		<b>Not Changed</b>	Not Changed	Not Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>900	<b>69</b>	19	147
Chromium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	2
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	1
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Silver	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Aluminum	ppm	ASTM D5185m	>30	<b>4</b>	<1	0
Lead	ppm	ASTM D5185m	>50	<b>0</b>	0	0
Copper	ppm	ASTM D5185m	>150	<b>&lt;1</b>	0	<1
Tin	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	0
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>2</b>	2	5
Potassium	ppm	ASTM D5185m	>20	<b>2</b>	0	<1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>LIGHT</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>0</b>	0	0
Boron	ppm	ASTM D5185m		<b>212</b>	224	207
Barium	ppm	ASTM D5185m		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m		<b>2</b>	<1	3
Manganese	ppm	ASTM D5185m		<b>1</b>	<1	4
Magnesium	ppm	ASTM D5185m		<b>17</b>	16	10
Calcium	ppm	ASTM D5185m		<b>195</b>	203	128
Phosphorus	ppm	ASTM D5185m		<b>1064</b>	1041	1112
Zinc	ppm	ASTM D5185m		<b>86</b>	78	61
Sulfur	ppm	ASTM D5185m		<b>25757</b>	30027	26939
Visc @ 40°C	cSt	ASTM D445	139	<b>135</b>	141	128

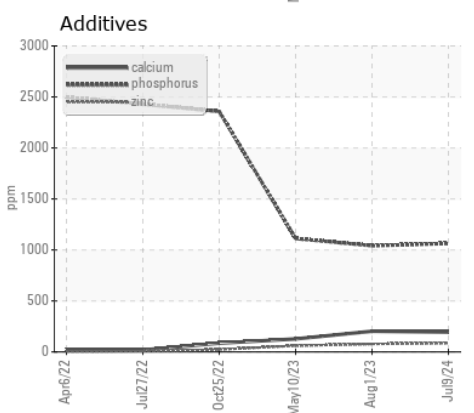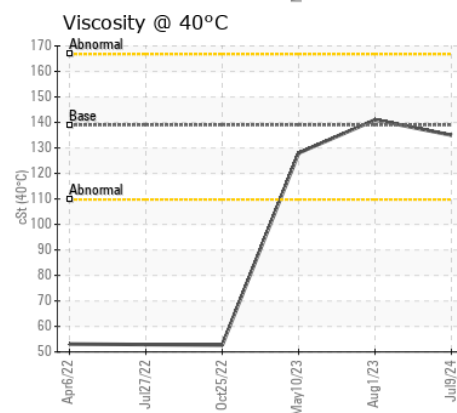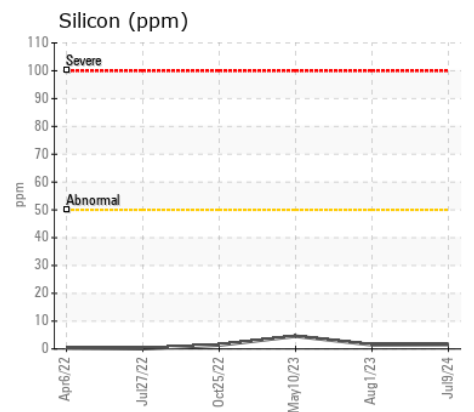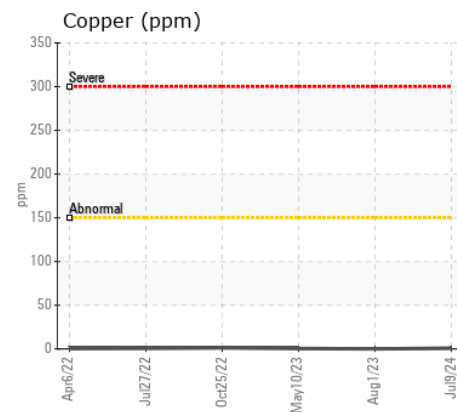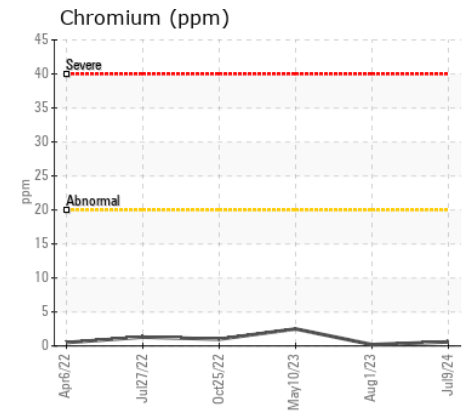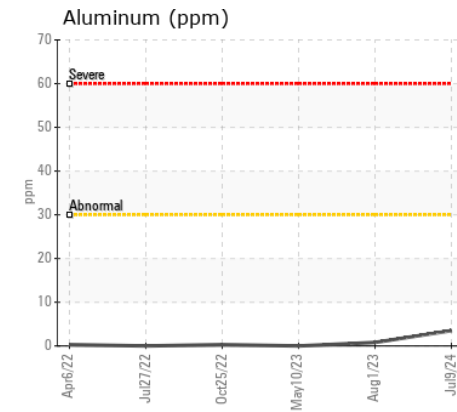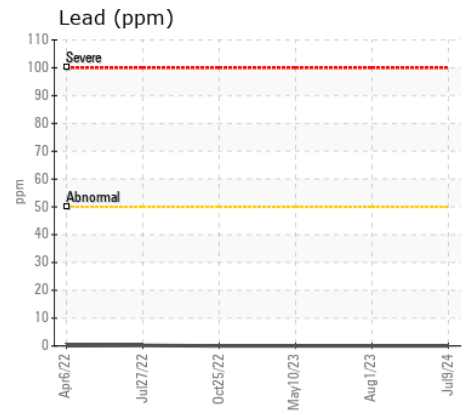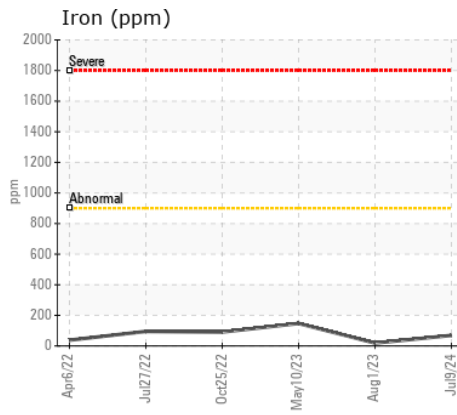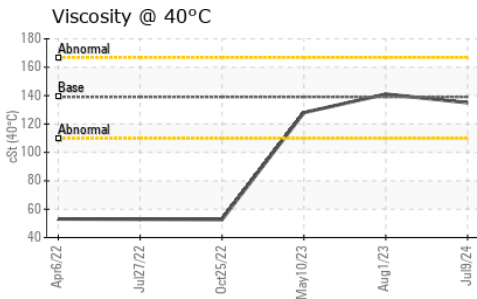

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP447429  
**Lab Number** : 06240653  
**Unique Number** : 11129487  
**Test Package** : MOB 1

**Received** : 18 Jul 2024  
**Tested** : 19 Jul 2024  
**Diagnosed** : 19 Jul 2024 - Wes Davis

**SCHILBERG CONSTRUCTION COMPANY**  
 PO BOX 358  
 GREENFIELD, IA  
 US 50849  
 Contact: SCOTT ARMSTRONG  
 sarmstrong@schildberg.com  
 T: (641)743-8237  
 F: (641)743-2486

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)