



PacLease

# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**8591714**  
 Component  
**Diesel Engine**  
 Fluid  
**MOBIL DELVAC 1300 SUPER 15W40 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>RPL0021295</b>	RPL0017690	RPL0016286
Sample Date		Client Info		<b>10 Jul 2024</b>	19 Mar 2024	07 Dec 2023
Machine Age	mls	Client Info		<b>59059</b>	56840	54913
Oil Age	mls	Client Info		<b>0</b>	0	0
Filter Age	mls	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Chngd</b>	Not Chngd	Changed
Filter Changed		Client Info		<b>Changed</b>	Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185m	>100	<b>10</b>	4	17
Chromium	ppm	ASTM D5185m	>20	<b>0</b>	0	<1
Nickel	ppm	ASTM D5185m	>4	<b>0</b>	1	<1
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m	>3	<b>0</b>	<1	<1
Aluminum	ppm	ASTM D5185m	>20	<b>3</b>	4	4
Lead	ppm	ASTM D5185m	>40	<b>0</b>	<1	0
Copper	ppm	ASTM D5185m	>330	<b>1</b>	<1	4
Tin	ppm	ASTM D5185m	>15	<b>0</b>	<1	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	<1	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION

There is no indication of any contamination in the oil.


Silicon	ppm	ASTM D5185m	>25	<b>4</b>	2	7
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	2	5
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844	>3	<b>0.4</b>	0.2	0.5
Nitration	Abs/cm	*ASTM D7624	>20	<b>9.5</b>	8.4	9.6
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>20.2</b>	19.3	22.4
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>2</b>	1	2
Boron	ppm	ASTM D5185m	0	<b>69</b>	86	34
Barium	ppm	ASTM D5185m	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	0	<b>89</b>	90	34
Manganese	ppm	ASTM D5185m		<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185m	0	<b>599</b>	590	521
Calcium	ppm	ASTM D5185m		<b>1391</b>	1322	1535
Phosphorus	ppm	ASTM D5185m		<b>714</b>	737	706
Zinc	ppm	ASTM D5185m		<b>827</b>	842	870
Sulfur	ppm	ASTM D5185m		<b>3141</b>	3358	2276
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>18.1</b>	17.3	21.9
Base Number (BN)	mg KOH/g	ASTM D2896	9.4	<b>6.6</b>	8.1	6.6
Visc @ 100°C	cSt	ASTM D445	14	<b>13.2</b>	13.0	13.3


**FT-IR (Direct Trend)**

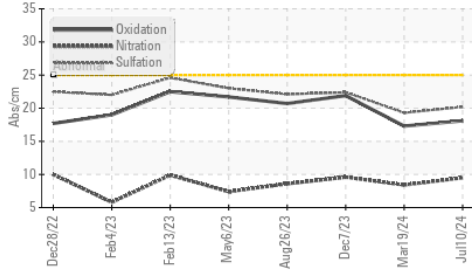


**Base Number**

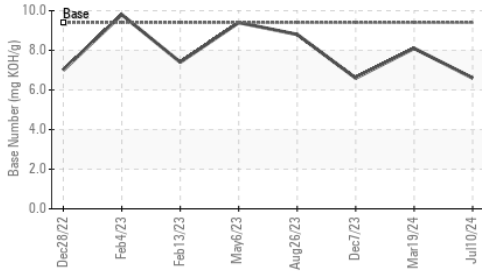


**Viscosity @ 100°C**

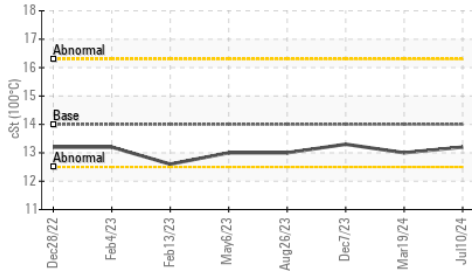


**Ferrous Alloys**

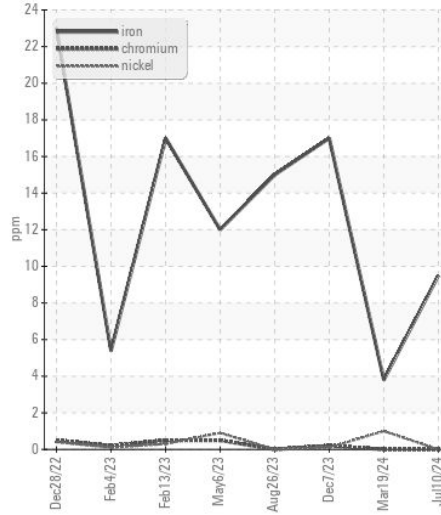


**Non-ferrous Metals**

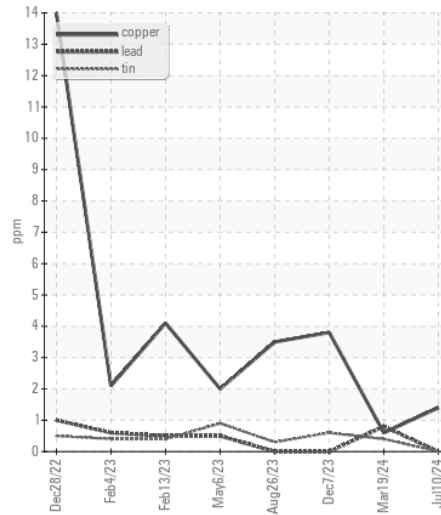

**Viscosity @ 100°C**

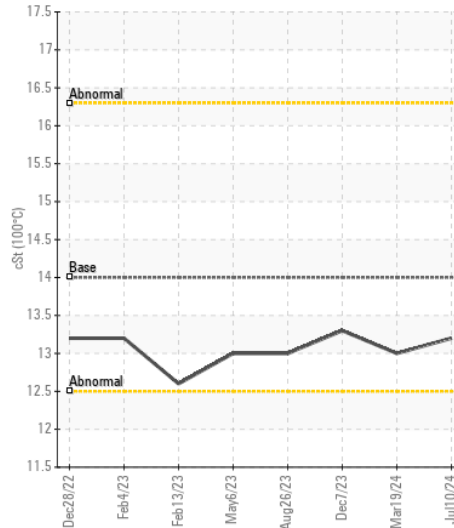

**Base Number**

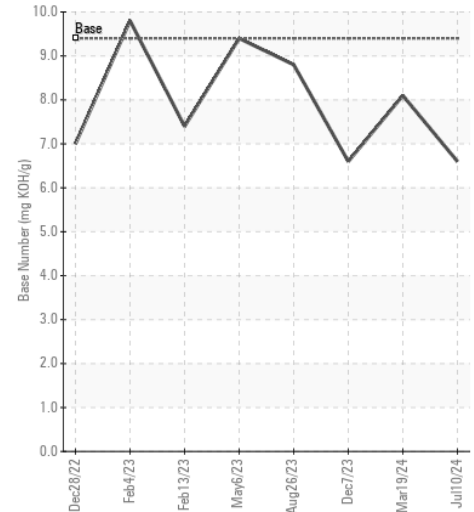

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513

**Sample No.** : RPL0021295

**Lab Number** : 06241515

**Unique Number** : 11130349

**Test Package** : FLEET

**Received** : 19 Jul 2024

**Tested** : 22 Jul 2024

**Diagnosed** : 22 Jul 2024 - Wes Davis

**RTL PACLEASE - 7051 - Las Vegas**

4150 Arctic Spring Ave

North Las Vegas, NV

US 89115

Contact: MIKE GARCIA

garciam12@rushenterprises.com

T: (702)790-7914

F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)