



USURE	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
ÉTAT DU FLUIDE	<b>NORMAL</b>

Secteur  
**MICHAUDVILLE**

Identité de la machine

**1160**

Composant

**Transmission (Auto)**

Fluide

**DEXRON III (--- GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DEXRON III. Please confirm.  
Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Numéro d'échant.		Client Info		<b>PC0073315</b>	PC0071926	PC0065987
Date d'échant.		Client Info		<b>16 Jul 2023</b>	29 Jan 2023	02 Nov 2022
Âge d la Machine	hrs	Client Info		<b>44463</b>	41713	182300
Âge de l'huile	hrs	Client Info		<b>0</b>	0	0
Âge du filtre	hrs	Client Info		<b>0</b>	0	0
Huile changée		Client Info		<b>N/A</b>	N/A	N/A
Filtre changé		Client Info		<b>N/A</b>	N/A	N/A
Statut de l'échant.				<b>NORMAL</b>	NORMAL	NORMAL

**USURE**

All component wear rates are normal.

Fer	ppm	ASTM D5185(m)	>160	<b>111</b>	106	89
Chrome	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	1	<1
Titane	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	0
Argent	ppm	ASTM D5185(m)	>5	<b>0</b>	0	0
Aluminium	ppm	ASTM D5185(m)	>50	<b>25</b>	20	19
Plomb	ppm	ASTM D5185(m)	>50	<b>16</b>	16	15
Cuivre	ppm	ASTM D5185(m)	>225	<b>9</b>	9	8
Étain	ppm	ASTM D5185(m)	>10	<b>2</b>	2	2
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Métal blanc	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Bronze	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

**CONTAMINATION**












There is no indication of any contamination in the fluid.

Silicium	ppm	ASTM D5185(m)	>20	<b>17</b>	8	8
Potassium	ppm	ASTM D5185(m)	>20	<b>10</b>	4	6
Glycol	%	ASTM D7922*		<b>0.0</b>	---	---
Limon	scalar	Visual*	NONE	<b>VLITE</b>	NONE	NONE
Débris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Saleté	scalar	Visual*	NONE	<b>VLITE</b>	NONE	NONE
Apparence	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odeur	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Eau émulsifiée	scalar	Visual*	>0.1	<b>NEG</b>	NEG	.2%

**ÉTAT DU FLUIDE**

The condition of the fluid is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>12</b>	7	11
Bore	ppm	ASTM D5185(m)		<b>95</b>	98	91
Baryum	ppm	ASTM D5185(m)		<b>2</b>	1	1
Molybdène	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1
Manganèse	ppm	ASTM D5185(m)		<b>3</b>	3	3
Magnésium	ppm	ASTM D5185(m)		<b>2</b>	<1	<1
Calcium	ppm	ASTM D5185(m)		<b>52</b>	57	52
Phosphore	ppm	ASTM D5185(m)		<b>282</b>	293	285
Zinc	ppm	ASTM D5185(m)		<b>29</b>	13	11
Soufre	ppm	ASTM D5185(m)		<b>741</b>	684	655
Visc 40°C	cSt	ASTM D7279(m)	26.0	<b>35.7</b>	35.8	35.6
Visc 100°C	cSt	ASTM D7279(m)	5.5	<b>7</b>	7.1	7
Indice de viscosité (VI)	Scale	ASTM D2270*	155	<b>161</b>	161	161

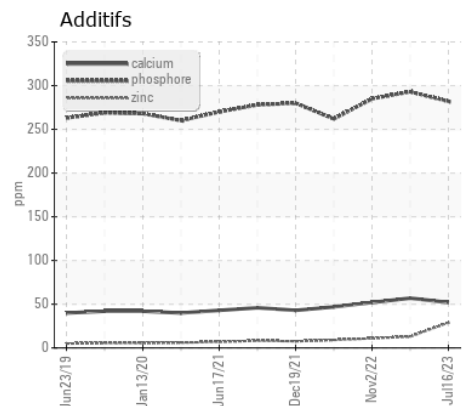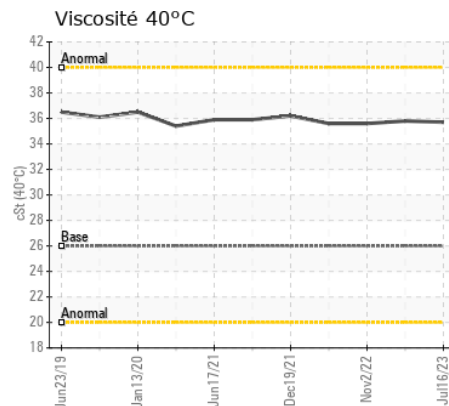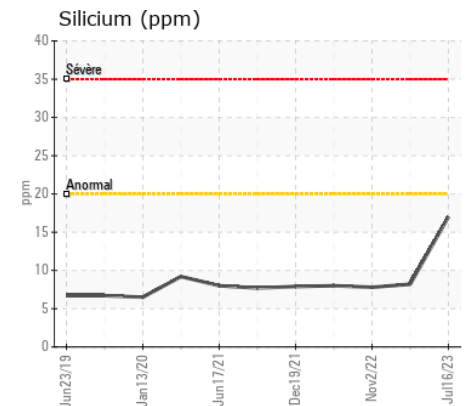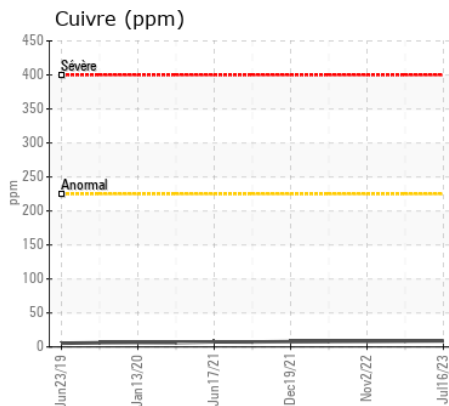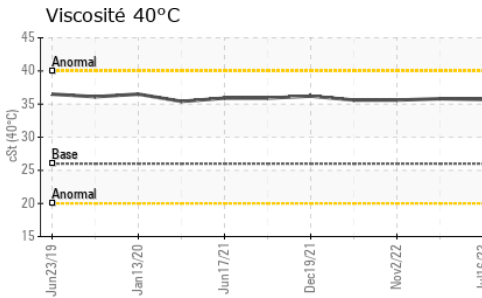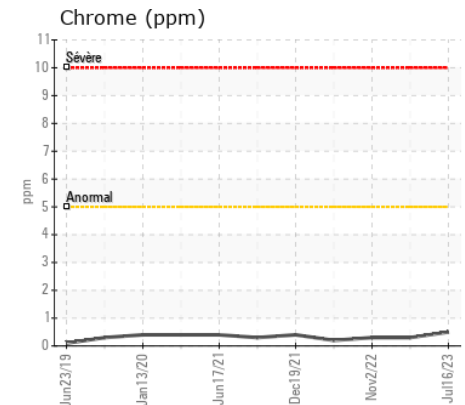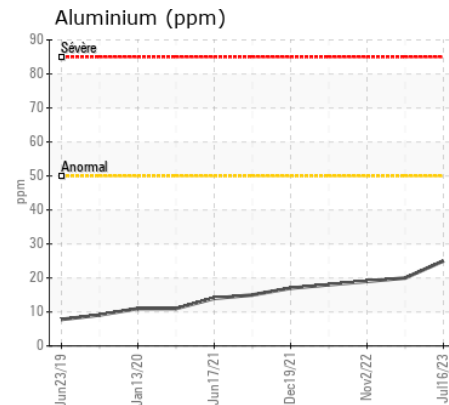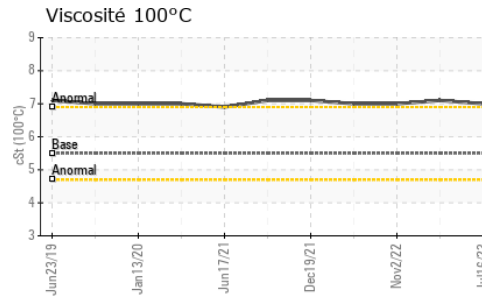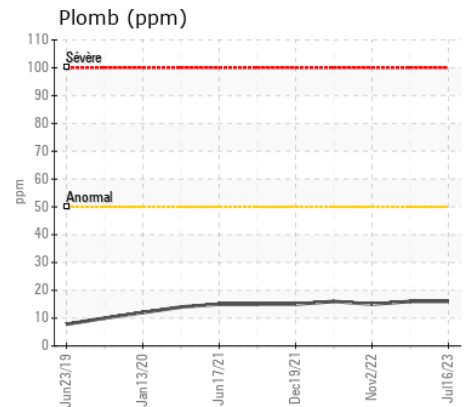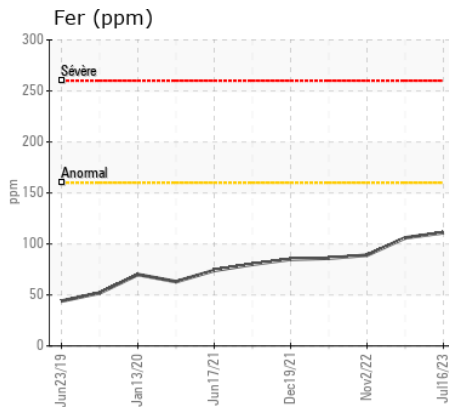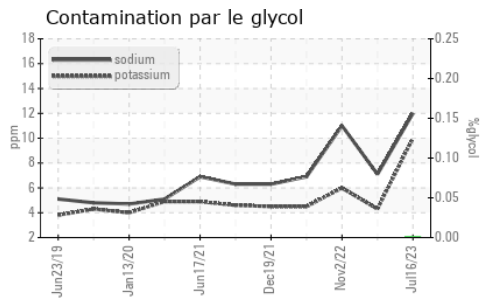

ISO 17025:2017  
Accredited  
Laboratory

**Laboratoire** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **LES ENTREPRISES MICHAUVILLE INC.**  
**N° d'échantillon** : PC0073315 **Reçu** : 17 Jul 2023  
**N° de laboratoire** : 02570417 **Diagnostiqué** : 17 Jul 2023  
**Numéro unique** : 5607463 **Diagnostiqueur** : Wes Davis  
**Analyse** : MOB 1 ( Additional Tests: Glycol, KV100, VI )

Pour discuter ce rapport, contacter le service à la clientèle au 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

270 RUE BRUNET  
 MONT ST-HILAIRE, QC  
 CA J3H 0M6  
 Contact: Martin Trudel  
 mtrudel@michaudville.com

T:  
F: