



USURE	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
ÉTAT DU FLUIDE	<b>NORMAL</b>

Secteur  
**MICHAUDVILLE**

Identité de la machine  
**5031**  
Composant  
**Transmission Manuelle**  
Fluide  
**NOT GIVEN (--- GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is SAE 15W40 Transmission/Drive Train Oil. Please confirm the fluid type and grade, and specify the brand of the fluid on your next sample. Please specify the component make and model with your next sample.

**USURE**

All component wear rates are normal.











**CONTAMINATION**

There is no indication of any contamination in the fluid.

**ÉTAT DU FLUIDE**

The condition of the fluid is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Numéro d'échant.		Client Info		<b>PC0078406</b>	PC0067653	PC0053423
Date d'échant.		Client Info		<b>13 Sep 2023</b>	11 Jan 2023	01 Dec 2021
Âge d la Machine	hrs	Client Info		<b>4005</b>	3671	0
Âge de l'huile	hrs	Client Info		<b>0</b>	0	0
Âge du filtre	hrs	Client Info		<b>0</b>	0	0
Huile changée		Client Info		<b>N/A</b>	N/A	N/A
Filtre changé		Client Info		<b>N/A</b>	N/A	N/A
Statut de l'échant.				<b>NORMAL</b>	NORMAL	NORMAL
Fer	ppm	ASTM D5185(m)	>200	<b>6</b>	11	10
Chrome	ppm	ASTM D5185(m)	>5	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	0	0
Titane	ppm	ASTM D5185(m)		<b>0</b>	<1	0
Argent	ppm	ASTM D5185(m)	>7	<b>0</b>	0	0
Aluminium	ppm	ASTM D5185(m)	>25	<b>1</b>	1	1
Plomb	ppm	ASTM D5185(m)	>45	<b>0</b>	<1	0
Cuivre	ppm	ASTM D5185(m)	>225	<b>&lt;1</b>	<1	<1
Étain	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Métal blanc	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Bronze	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Silicium	ppm	ASTM D5185(m)	>125	<b>4</b>	4	4
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	<1
Limon	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Débris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Saleté	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Apparence	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odeur	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Eau émulsifiée	scalar	Visual*	>0.1	<b>NEG</b>	NEG	NEG
Sodium	ppm	ASTM D5185(m)		<b>1</b>	3	3
Bore	ppm	ASTM D5185(m)		<b>32</b>	28	29
Baryum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Molybdène	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Manganèse	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Magnésium	ppm	ASTM D5185(m)		<b>10</b>	15	17
Calcium	ppm	ASTM D5185(m)		<b>3006</b>	2963	2884
Phosphore	ppm	ASTM D5185(m)		<b>1049</b>	1013	1020
Zinc	ppm	ASTM D5185(m)		<b>1169</b>	1145	1181
Soufre	ppm	ASTM D5185(m)		<b>4033</b>	4302	4202
Visc 40°C	cSt	ASTM D7279(m)		<b>102</b>	97.5	99.9
Visc 100°C	cSt	ASTM D7279(m)		<b>13.7</b>	12.9	13.2
Indice de viscosité (VI)	Scale	ASTM D2270*		<b>134</b>	128	130

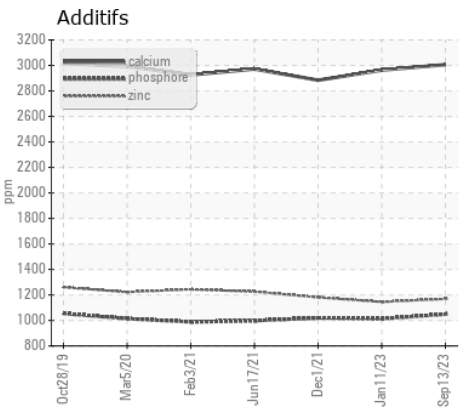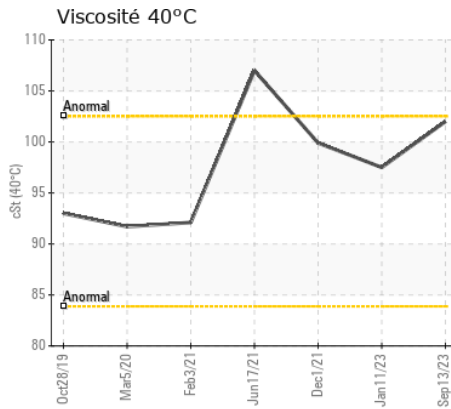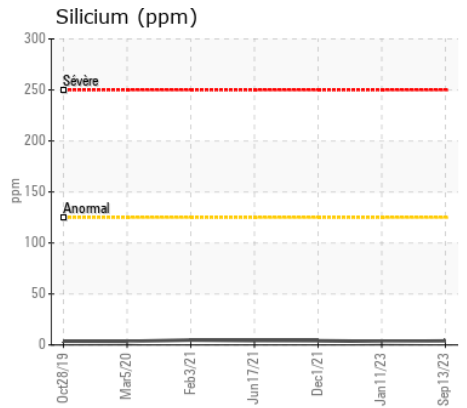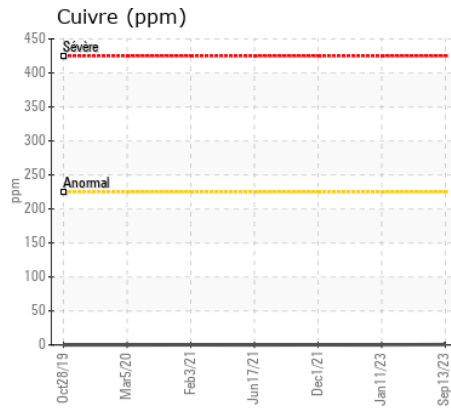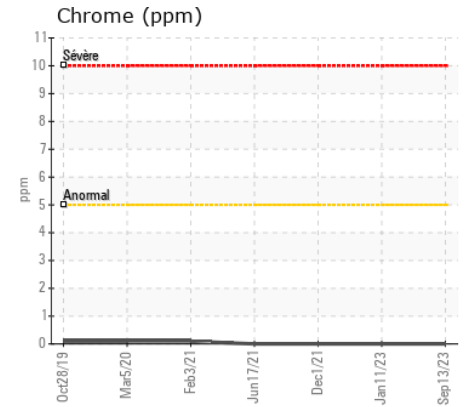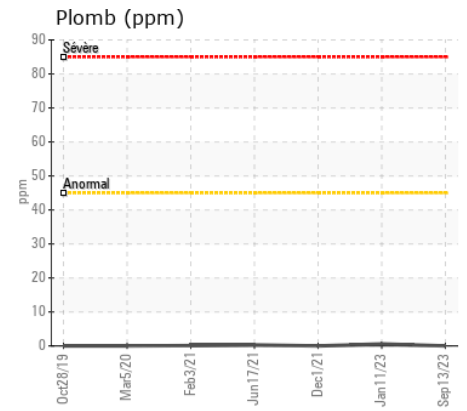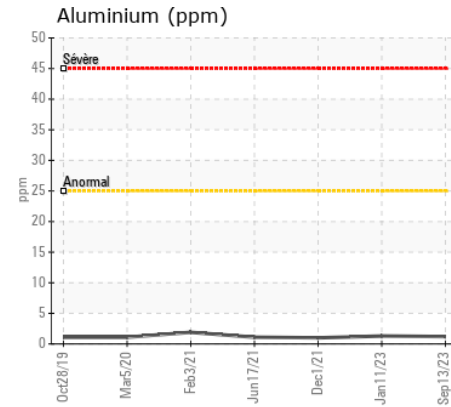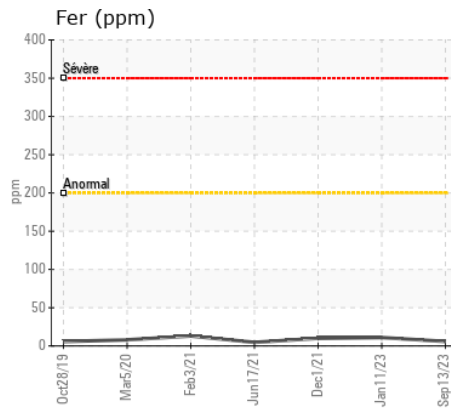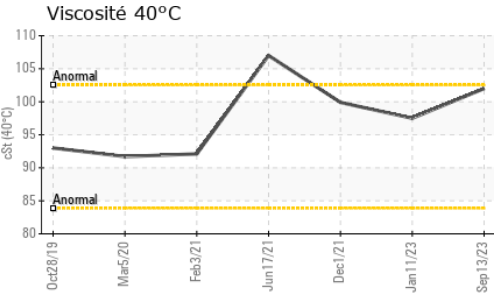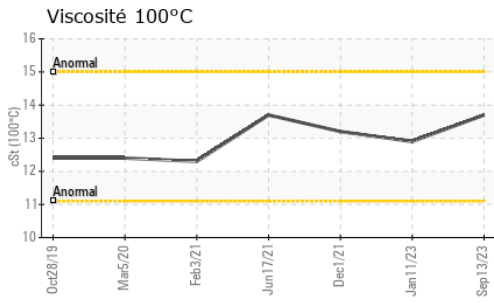

ISO 17025:2017  
Accredited  
Laboratory

**Laboratoire** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **LES ENTREPRISES MICHAUVILLE INC.**  
**N° d'échantillon** : PC0078406 **Reçu** : 14 Sep 2023 270 RUE BRUNET  
**N° de laboratoire** : 02582550 **Diagnostiqué** : 14 Sep 2023 MONT ST-HILAIRE, QC  
**Numéro unique** : 5643615 **Diagnostiqueur** : Wes Davis CA J3H 0M6  
**Analyse** : MOB 1 ( Additional Tests: KV100, VI ) Contact: Martin Trudel  
 mtrudel@michauville.com

Pour discuter ce rapport, contacter le service à la clientèle au 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

La validez de los resultados y la interpretación se basan en la muestra y la información proporcionada.

T:  
F: