



Identité de la machine

**F55058**

Composant

**Moteur diesel**

Fluide

**DIESEL ENGINE OIL SAE 10W30 (--- GAL)**

**RECOMMENDATION**

No corrective action is recommended at this time. Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DIESEL ENGINE OIL SAE 10W30. Please confirm.

Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Numéro d'échant.		Client Info		<b>PC0078112</b>	PC0065119	---
Date d'échant.		Client Info		<b>02 Oct 2023</b>	28 Jul 2022	---
Âge d la Machine	hrs	Client Info		<b>1596</b>	459	---
Âge de l'huile	hrs	Client Info		<b>0</b>	0	---
Âge du filtre	hrs	Client Info		<b>0</b>	0	---
Huile changée		Client Info		<b>N/A</b>	N/A	---
Filtre changé		Client Info		<b>N/A</b>	N/A	---
Statut de l'échant.				<b>NORMAL</b>	NORMAL	---

**USURE**

All component wear rates are normal.

Fer	ppm	ASTM D5185(m)	>100	<b>30</b>	15	---
Chrome	ppm	ASTM D5185(m)	>20	<b>2</b>	1	---
Nickel	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	---
Titane	ppm	ASTM D5185(m)		<b>0</b>	<1	---
Argent	ppm	ASTM D5185(m)	>3	<b>0</b>	0	---
Aluminium	ppm	ASTM D5185(m)	>20	<b>2</b>	2	---
Plomb	ppm	ASTM D5185(m)	>40	<b>&lt;1</b>	2	---
Cuivre	ppm	ASTM D5185(m)	>330	<b>4</b>	13	---
Étain	ppm	ASTM D5185(m)	>15	<b>0</b>	<1	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	---

**CONTAMINATION**












Fuel content negligible. There is no indication of any contamination in the oil.

Silicium	ppm	ASTM D5185(m)	>25	<b>5</b>	14	---
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	6	---
Essence	%	ASTM D7593*	>5	<b>0.5</b>	0.4	---
Glycol		WC Method		<b>NEG</b>	0.0	---
% de suie	%	ASTM D7844*	>3	<b>0</b>	0	---
Nitration	Abs/cm	ASTM D7624*	>20	<b>7.4</b>	8.0	---
Sulfatation	Abs/.1mm	ASTM D7415*	>30	<b>18.7</b>	17.8	---
Eau émulsifiée	scalar	Visual*	>0.2	<b>NEG</b>	NEG	---

**ÉTAT DU FLUIDE**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>4</b>	16	---
Bore	ppm	ASTM D5185(m)	250	<b>5</b>	57	---
Baryum	ppm	ASTM D5185(m)	10	<b>&lt;1</b>	6	---
Molybdène	ppm	ASTM D5185(m)	100	<b>54</b>	2	---
Manganèse	ppm	ASTM D5185(m)		<b>&lt;1</b>	3	---
Magnésium	ppm	ASTM D5185(m)	450	<b>965</b>	761	---
Calcium	ppm	ASTM D5185(m)	3000	<b>1229</b>	1182	---
Phosphore	ppm	ASTM D5185(m)	1150	<b>989</b>	727	---
Zinc	ppm	ASTM D5185(m)	1350	<b>1210</b>	796	---
Soufre	ppm	ASTM D5185(m)	4250	<b>2498</b>	2766	---
Oxydation	Abs/.1mm	ASTM D7414*	>25	<b>14.2</b>	12.9	---
Visc 40°C	cSt	ASTM D7279(m)	73	<b>80.3</b>	68.8	---
Visc 100°C	cSt	ASTM D7279(m)	10.9	<b>12.1</b>	11.1	---
Indice de viscosité (VI)	Scale	ASTM D2270*	138	<b>146</b>	153	---

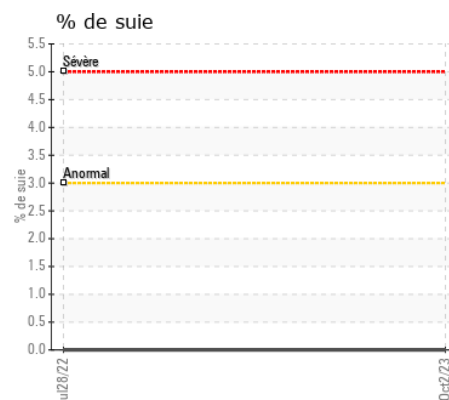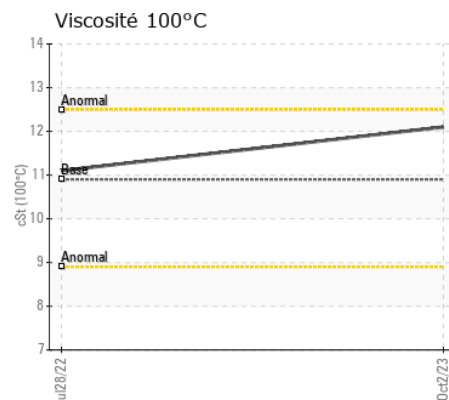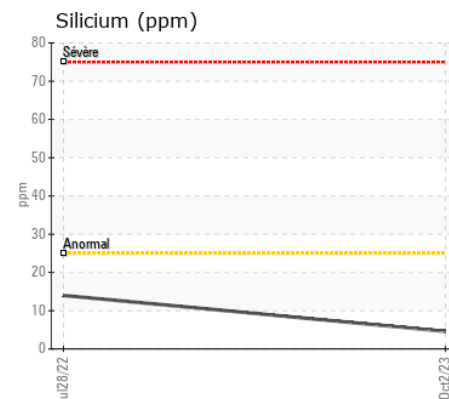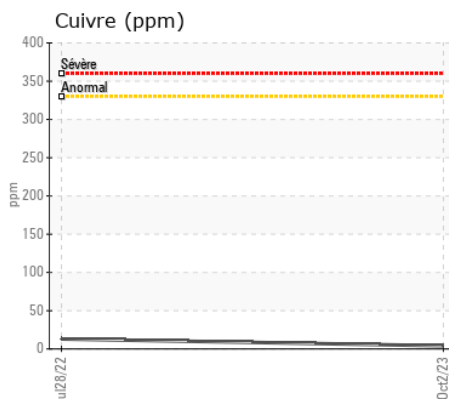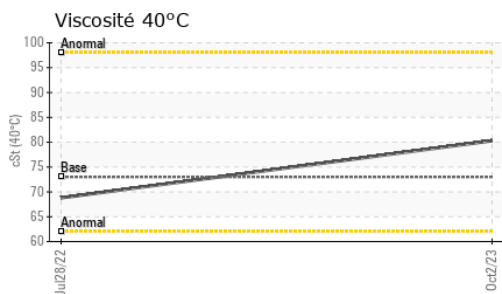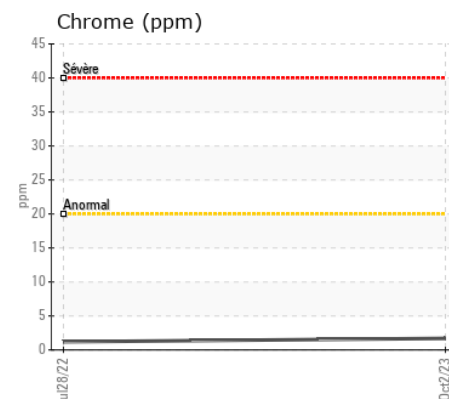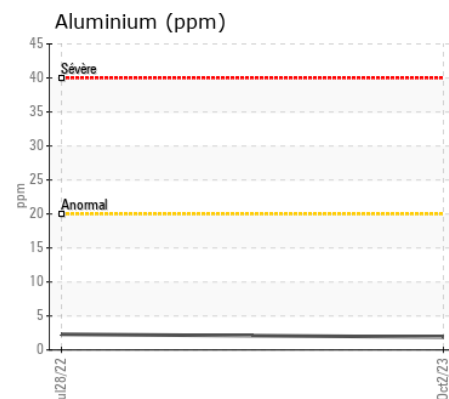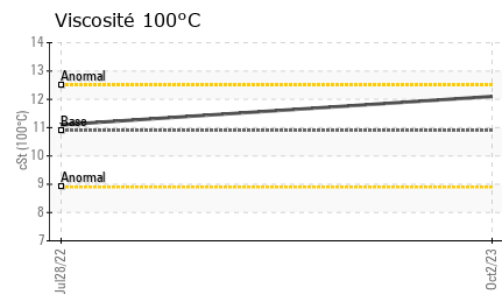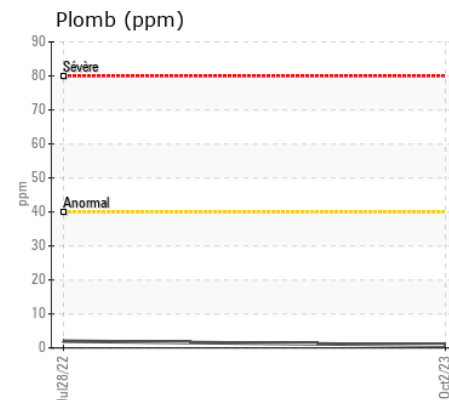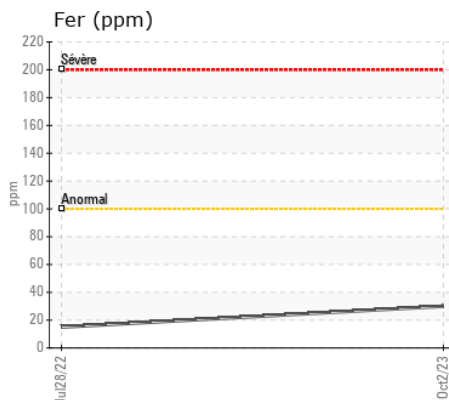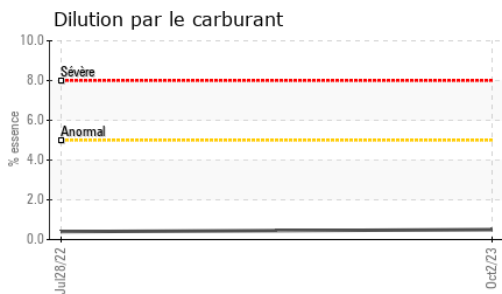

ISO 17025:2017  
Accredited  
Laboratory

**Laboratoire** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 LES ENTREPRISES MICHAUVILLE INC.  
**N° d'échantillon** : PC0078112 **Reçu** : 03 Oct 2023  
**N° de laboratoire** : 02586374 **Diagnostiqué** : 04 Oct 2023  
**Numéro unique** : 5655440 **Diagnostiqueur** : Wes Davis  
**Analyse** : MOB 1 ( Additional Tests: FuelDilution, KV40, PercentFuel, VI )

270 RUE BRUNET  
MONT ST-HILAIRE, QC  
CA J3H 0M6  
Contact: Martin Trudel  
mtrudel@michaudville.com

Pour discuter ce rapport, contacter le service à la clientèle au 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

La validez de los resultados y la interpretación se basan en la muestra y la información proporcionada.

T:  
F: