

# LIEBHERR A934 060317 - Splitter Box

Sample No: LH0224837

Oil Type:

## **SAMPLE INFORMATION**

Sample Number	LH0224837	 	
Sample Date	01 Feb 2023	 	
Machine Hours	12127	 	
Oil Hours	0	 	
Oil Changed	Changed	 	
Sample Status	NORMAL	 	

PETRO CANADA TRAXON 75W90 SYNTHETIC

۲

. .

#### **OIL CONDITION**

Visc @ 40°C

## cSt 0 101

Silicon	ppm	<b>0</b> 19				
Sodium	ppm	04				
Potassium	ppm	6				
-						

Ô				
WEA	AR META	LS		
Iron	ppm	23	 	
Copper	ppm	01	 	
Lead	ppm	0 2	 	
Tin	ppm	0 🔘	 	
Aluminum	ppm	◯ <1	 	
Chromium	ppm	0 🔘	 	
Molybdenum	ppm	◯ <1	 	
Nickel	ppm	0 🔘	 	
Titanium	ppm	◯ <1	 	
Silver	ppm	0 🔘	 	
Manganese	ppm	◯ <1	 	
Vanadium	ppm	0	 	



### ADDITIVES

Calcium	ppm	<b>20</b>	 	
Magnesium	ppm	07	 	
Zinc	ppm	<b>60</b>	 	
Phosphorus	ppm	0 1277	 	
Barium	ppm	01	 	
Boron	ppm	0 211	 	





RICHMOND STEEL

12707 170 STREET EDMONTON, AB CA T5V 1L9 Contact: Sandor Arguello

T: (780)447-3391 F:

#### Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot:	RICEDM
Unique No:	5552056
Signed:	Wes Davis
Report Date:	22 Mar 2023


Contact/Location: Sandor Arguello - RICEDM

# CONSTRUCTION EQUIPMENT



GRAPHS

 $\odot$ 

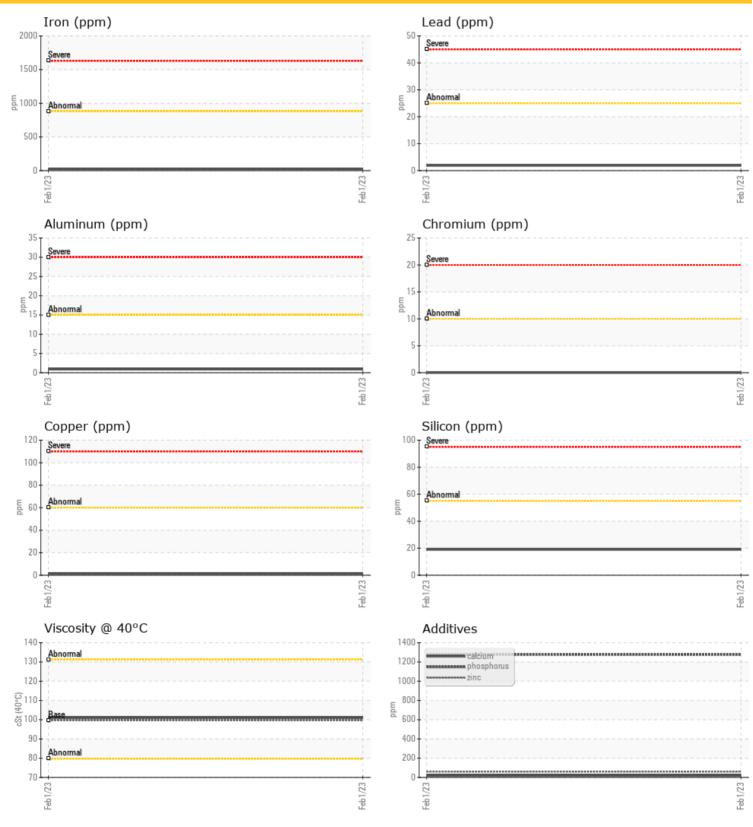

Report Id: RICEDM [WCAMIS] 02547046 (Generated: 10/20/2023 16:26:01) Rev: 1

Contact/Location: Sandor Arguello - RICEDM