

145586-1218 - Front Right Wheel Hub

LH0269266 30 Jan 2024

1000

0

N/A NORMAL

Sample No: LH0269266

Oil Type: GEAR OIL SAE 80W90

SAMPLE INFORMATION

Sample Number	
Sample Date	
Machine Hours	
Oil Hours	
Oil Changed	
Sample Status	

OIL CONDITION

Visc @ 40°C

cSt 🔘 140

	TAMINA 1	ION		
Water	%	NEG	 	
Silicon	ppm	06	 	
Sodium	ppm	04	 	
Potassium	ppm	○ <1	 	

Ä				
WEA WEA	R METAL	.S		
Iron	ppm	0 19	 	
Copper	ppm	0 11	 	
Lead	ppm	○ <1	 	
Tin	ppm	0 ()	 	
Aluminum	ppm	○ <1	 	
Chromium	ppm	0 ()	 	
Molybdenum	ppm	○ <1	 	
Nickel	ppm	<mark></mark> <1	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	○ <1	 	
Vanadium	ppm	0	 	

0

ADD ADD	ITIVES			
Calcium	ppm	0 89	 	
Magnesium	ppm	0 2	 	
Zinc	ppm	24	 	
Phosphorus	ppm	0 1665	 	
Barium	ppm	01	 	
Boron	ppm	0 84	 	





American Iron and Metal

10305 Metropolitaine Est, Garage porte 13 Montreal, QC CA H1B 1A1 Contact: Sebastien Liautaud sliautaud@aimrecyclinggroup.com T: F:

Diagnosis

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL SAE 80W90. Please confirm.

All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot:LUnique No:5Signed:VReport Date:3


LACMON 5721670 Wes Davis 31 Jan 2024





GRAPHS

 \odot

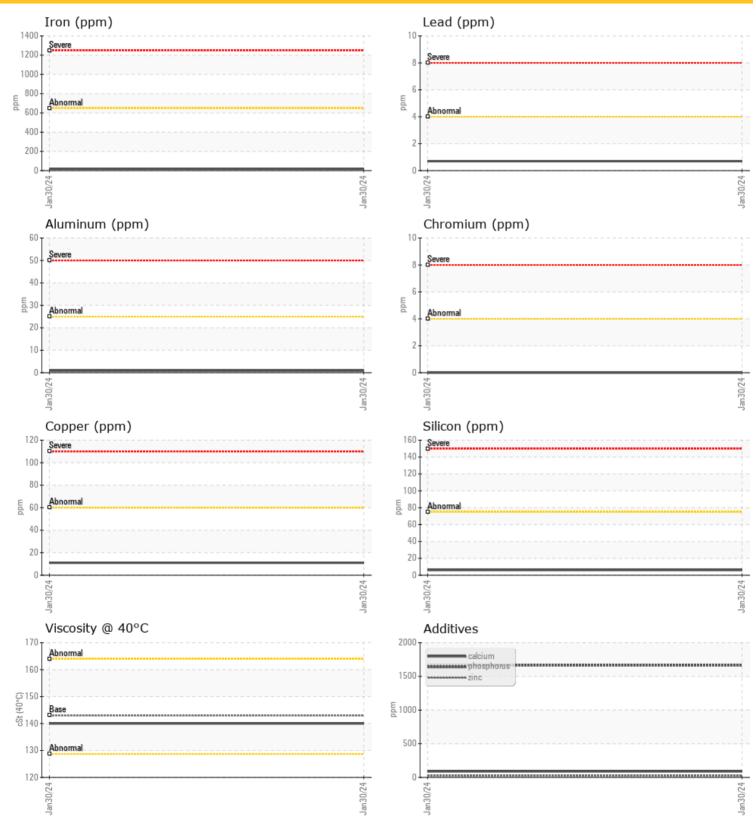

Report Id: LACMON [WCAMIS] 02612575 (Generated: 01/31/2024 18:54:26) Rev: 1