

LIEBHERR LH40M 1215-106088 - Diesel Engine

Sample No: LH0258318

Oil Type: CHEVRON DELO 400 XSP 5W30

SAMPLE INFORMATION

Sample Number	LH0258318	 	
Sample Date	11 Aug 2023	 	
Machine Hours	10203	 	
Oil Hours	6	 	
Oil Changed	Not Changd	 	
Sample Status	NORMAL	 	

OIL CO	NDITION			
Visc @ 100°C	cSt	0 12.18	 	
Base Number (BN)	mg KOH/g	08.6	 	
Oxidation (PA)	%	49	 	

CON	TAMIN	ATION		
Soot %	%	0	 	
Nitration (PA)	%	53	 	
Sulfation (PA)	%	48	 	
Glycol	%	NEG	 	
Fuel	%	<1.0	 	
Silicon	ppm	06	 	
Sodium	ppm	01	 	
Potassium	ppm	0 4	 	

WEAR METALS

Iron	ppm	04	 	
Copper	ppm	○ <1	 	
Lead	ppm	○ <1	 	
Tin	ppm	0 🔘	 	
Aluminum	ppm	3	 	
Chromium	ppm	0 🔘	 	
Molybdenum	ppm	02	 	
Nickel	ppm	0 🔘	 	
Titanium	ppm	<1	 	
Silver	ppm	0 🔘	 	
Manganese	ppm	○ <1	 	
Vanadium	ppm	0	 	

ø

 \bigcirc

Calcium	ppm	0 1256					
Magnesium	ppm	657					
Zinc	ppm	0 774					
Phosphorus	ppm	694					
Barium	ppm	0					
Boron	ppm	0 104					









6169 LEXINGTON ROAD WINCHESTER, KY US 40391 Contact: Service Manager

T: F:

Diagnosis

No corrective action is recommended at this time. Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.







Ferrous Alloys

GRAPHS

0

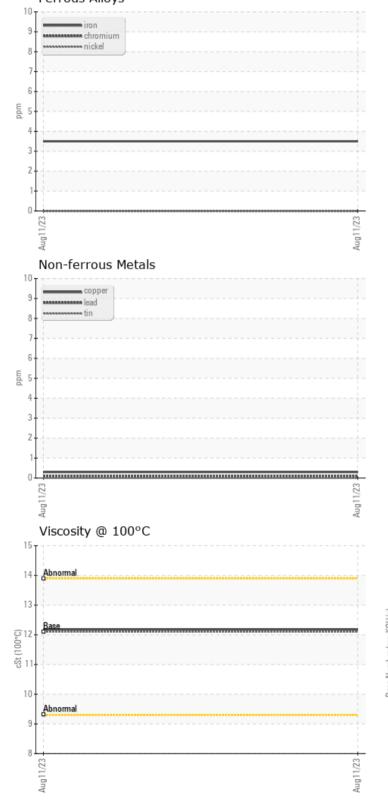

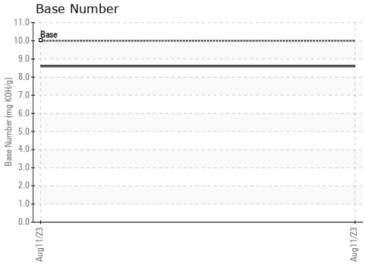

Report Id: STUWIN [WUSCAR] 05925229 (Generated: 08/15/2023 15:10:33) Rev: 1

Contact/Location: Service Manager - STUWIN