

LIEBHERR LH30M 1253-123497 - Rear Left Wheel Hub

Sample No: LH0272907

Oil Type: GEAR OIL SAE 80W90

SAMPLE INFORMATION

Sample Number	LH0272907	LH0212313	
Sample Date	11 Jan 2024	30 Dec 2021	
Machine Hours	4554	981	
Oil Hours	0	0	
Oil Changed	Changed	Changed	
Sample Status	NORMAL	NORMAL	

OIL CONDITION Visc @ 40°C cSt 0 119 0 112

Water	%	NEG	NEG			
Silicon	ppm	<mark></mark> <1	0 4			
Sodium	ppm	0	0 2			
Potassium	ppm	○ <1	0			

Ä				
WEA	R META	LS		
			0.40	
Iron	ppm	0 9	0 10	
Copper	ppm	○ <1	0 2	
Lead	ppm	0	◯ <1	
Tin	ppm	0	<1	
Aluminum	ppm	0 2	0	
Chromium	ppm	○ <1	○ <1	
Molybdenum	ppm	0	◯ <1	
Nickel	ppm	0	0	
Titanium	ppm	0	0	
Silver	ppm	0	<1	
Manganese	ppm	0	◯ <1	
Vanadium	ppm	0	0	

٥ **ADDITIVES** Calcium ppm 0 56 285 01 Magnesium ppm ○ <1 0 152 Zinc 0 ppm Phosphorus 0 468 ppm 0 346 Barium 03 $\bigcirc 0$ ppm Boron 077



SPARTAN RECYCLING 3071 HOWARD ST SPARTANBURG, SC

US 29303 Contact: SERVICE MANAGER

т: F:

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot: Unique No: Signed: **Report Date:**

SPASPALH 10834559 Don Baldridge 19 Jan 2024

03

ppm






Ferrous Alloys

GRAPHS

Ö

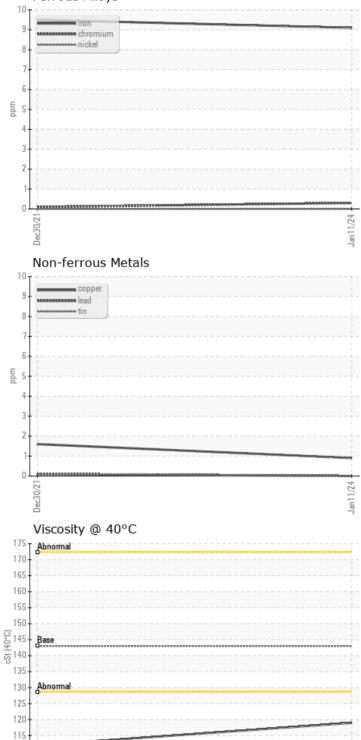

Jan 11/24 -

110

Dec30/2