

LIEBHERR

CONSTRUCTION EQUIPMENT



LIEBHERR LTM1130-5.1066718 - 2 - Right Wheel Hub

Sample No: LH0259048

Oil Type: EP 90



SAMPLE INFORMATION

Sample Number	LH0259048	---	---	---
Sample Date	14 Feb 2024	---	---	---
Machine Hours	0	---	---	---
Oil Hours	0	---	---	---
Oil Changed	N/A	---	---	---
Sample Status	NORMAL	---	---	---

LIEBHERR USA CO - MOBILE AND CRAWLER CRANES
 4100 CHESTNUT AVENUE
 NEWPORT NEWS, VA
 US 23607
 Contact: TERENCE VANDERLENDE
 TERENCE.VANDERLENDE@LIEBHERR.COM
 T:
 F:



OIL CONDITION

Visc @ 40°C	cSt	92.2	---	---	---
-------------	-----	------	-----	-----	-----



CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	8	---	---	---
Sodium	ppm	1	---	---	---
Potassium	ppm	2	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.



WEAR METALS

Iron	ppm	147	---	---	---
Copper	ppm	24	---	---	---
Lead	ppm	0	---	---	---
Tin	ppm	0	---	---	---
Aluminum	ppm	1	---	---	---
Chromium	ppm	1	---	---	---
Molybdenum	ppm	0	---	---	---
Nickel	ppm	<1	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	1	---	---	---
Vanadium	ppm	0	---	---	---



ADDITIVES


Calcium	ppm	53	---	---	---
Magnesium	ppm	19	---	---	---
Zinc	ppm	28	---	---	---
Phosphorus	ppm	1046	---	---	---
Barium	ppm	0	---	---	---
Boron	ppm	143	---	---	---

Depot: LIENEW
 Unique No: 10886603
 Signed: Sean Felton
 Report Date: 21 Feb 2024




GRAPHS

Ferrous Alloys

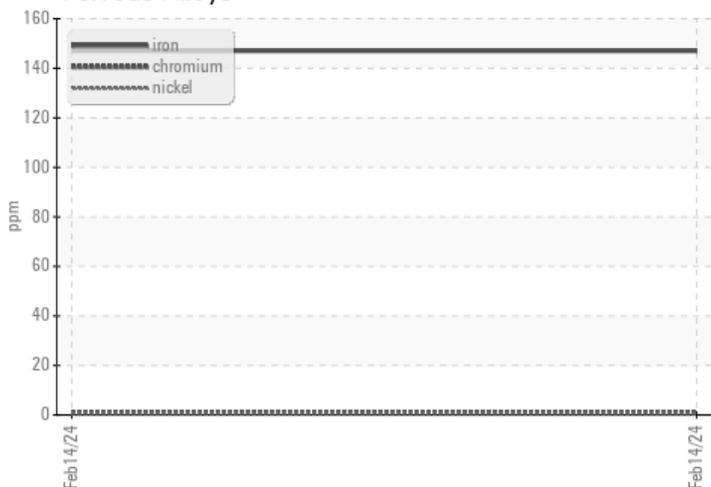

Non-ferrous Metals

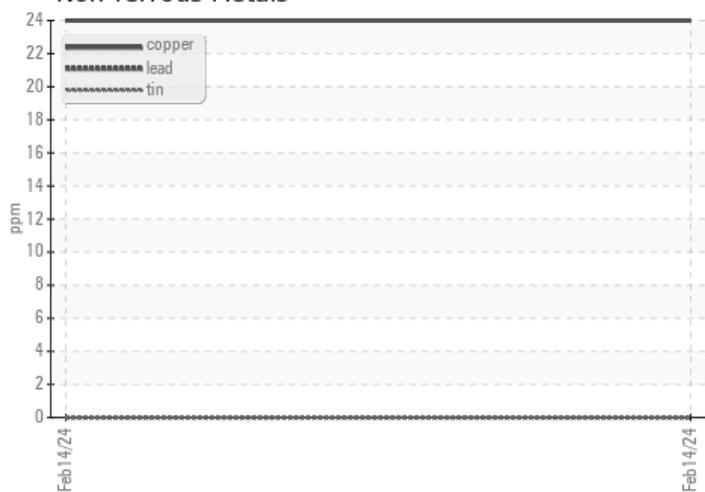

Viscosity @ 40°C

