

LIEBHERR

CONSTRUCTION EQUIPMENT



LIEBHERR LH60M 121879-1217 - Front Right Wheel Hub

Sample No: LH0268867

Oil Type: LIEBHERR GEAR BASIC 90 LS



LIEBHERR EQUIPMENT SOURCE

4100 CHESTNUT AVENUE
NEWPORT NEWS, VA
US 23607

Contact: LUKE APPLEBY
Lucas.Appleby@liebherr.com
T:
F: (757)298-8700



SAMPLE INFORMATION

Sample Number	LH0268867	LH0173639	---	---
Sample Date	27 Feb 2024	29 Mar 2022	---	---
Machine Hours	7442	3095	---	---
Oil Hours	0	2000	---	---
Oil Changed	Changed	Changed	---	---
Sample Status	NORMAL	NORMAL	---	---



OIL CONDITION

Visc @ 40°C	cSt	178	180	---	---
-------------	-----	-----	-----	-----	-----



CONTAMINATION

Water	%	NEG	NEG	---	---
Silicon	ppm	3	2	---	---
Sodium	ppm	5	5	---	---
Potassium	ppm	2	0	---	---



WEAR METALS

Iron	ppm	181	127	---	---
Copper	ppm	37	21	---	---
Lead	ppm	0	<1	---	---
Tin	ppm	<1	<1	---	---
Aluminum	ppm	2	2	---	---
Chromium	ppm	1	1	---	---
Molybdenum	ppm	0	0	---	---
Nickel	ppm	<1	<1	---	---
Titanium	ppm	<1	0	---	---
Silver	ppm	0	0	---	---
Manganese	ppm	4	3	---	---
Vanadium	ppm	0	0	---	---



ADDITIVES

Calcium	ppm	27	98	---	---
Magnesium	ppm	2	<1	---	---
Zinc	ppm	45	44	---	---
Phosphorus	ppm	2060	2037	---	---
Barium	ppm	73	82	---	---
Boron	ppm	<1	5	---	---

Diagnosis


Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot: LIEBHERRUS
Unique No: 10915853
Signed: Don Baldrige
Report Date: 11 Mar 2024




GRAPHS

Ferrous Alloys

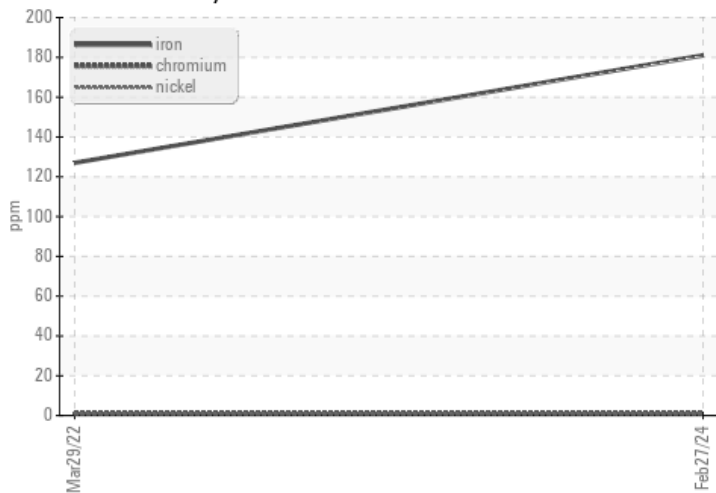

Non-ferrous Metals

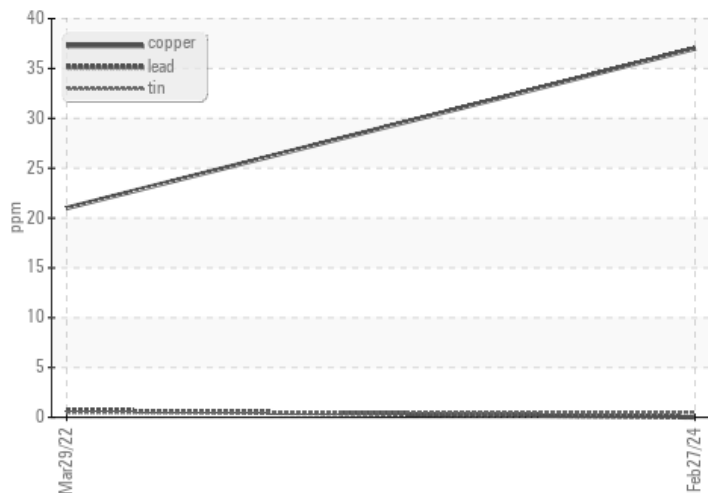

Viscosity @ 40°C

