# CONSTRUCTION EQUIPMENT

### LIEBHERR A934C 061188-1419 - Front Right Wheel Hub

Sample No: LH0272102

\_

Oil Type: GEAR OIL SAE 80W90

<b>J</b> Samp	<b>le Inform</b>	ation			
Sample Number		LH0272102	LH0253885	LH0253908	LH0236047
Sample Date		30 Jan 2024	21 Sep 2023	13 Jul 2023	23 Nov 2022
Machine Hours		28174	27222	26744	25468
Oil Hours		1000	0	500	500
Oil Changed		Changed	Changed	Changed	Changed
Sample Status		NORMAL	NORMAL	NORMAL	NORMAL
Oil Condition					
Visc @ 40°C	cSt	0 128	0 142	0 151	0 150
<b>11</b>					

<b>Cor</b>	ntaminati	on				
Water	%	NEG	NEG	NEG	NEG	
Silicon	ppm	0 2	○ <1	◯ <1	2	
Sodium	ppm	0 🔘	2	2	02	
Potassium	ppm	03	0 4	03	0 1	

Ä					
Wea	r Metals	i			
Iron	ppm	28	0 16	21	25
Copper	ppm	04	0	◯ <1	○ <1
Lead	ppm	01	0	0	0
Tin	ppm	01	0	0	0
Aluminum	ppm	0 2	◯ <1	◯ <1	0
Chromium	ppm	<b>○</b> <1	0	0	0
Molybdenum	ppm	0 2	<1	02	2
Nickel	ppm	01	○ <1	0	0
Titanium	ppm	<1	<1	0	0
Silver	ppm	<1	0	0	0
Manganese	ppm	01	0	◯ <1	◯ <1
Vanadium	ppm	<1	0	0	0

ø **Additives** Calcium 0 29 ppm 40 37 26 Magnesium ppm 06 13 9 09 Zinc 0 13 19 0 21 8 🔘 ppm 0 1398 Phosphorus ppm 0 909 1133 0 925 Barium 0 ppm 0  $\bigcirc 0$  $\bigcirc 0$ Boron 08 ppm 0 14  $\bigcirc 14$ 14





#### NORTHERN METAL RECYCLING

2800 PACIFIC ST N MINNEAPOLIS, MN US 55411 Contact: CHRIS GILMER chris.gilmer@emrgroup.com T: (612)305-7338 F:

#### Diagnosis

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL SAE 80W90. Please confirm.

All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot:NORMINLHUnique No:10995350Signed:Wes DavisReport Date:25 Apr 2024Contact/Location: CHRIS GILMER - NORMINLH






## Ø

#### Ferrous Alloys

Graphs

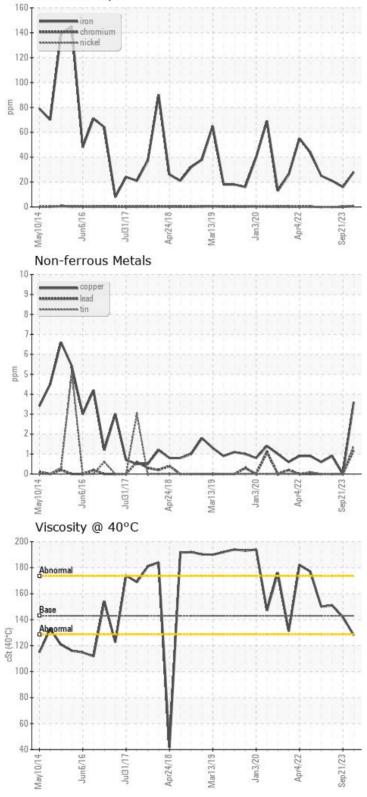

Report Id: NORMINLH [WUSCAR] 06159927 (Generated: 04/25/2024 21:12:41) Rev: 1