

[ELG] LIEBHERR A924C 036737-1049 - Front Right Wheel Hut

Sample No: LH

Oil Type: GEAR OIL SAE 80

INFORMATION SUR L'ÉCHANTILLON

Numéro d'échant.	LH	
Date d'échant.	14 Mar 2024	
Heures de la Machine	17745	
Heures de l'huile	0	
Huile changée	N/A	
Statut de l'echant.	NORMAL	

0 84.5

ÉTAT D'HUILE

Visc 40°C

cSt

4	
	CONTAMINATION

Eau	%	NEG	 	
Silicium	ppm	04	 	
Sodium	ppm	06	 	
Potassium	ppm	02	 	

Mé1	AUX D'U	ISURE		
Fer	ppm	301	 	
Cuivre	ppm	0 9	 	
Plomb	ppm	() <1	 	
Étain	ppm	0 (
Aluminium	ppm	3	 	
Chrome	ppm	<mark></mark> <1	 	
Molybdène	ppm	0 🔘	 	
Nickel	ppm	○ <1	 	
Titane	ppm	0 🔘	 	
Argent	ppm	<1	 	
Manganèse	ppm	0 2	 	
Vanadium	maa	0	 	

ø **ADDITIFS** Calcium 0 59 ppm Magnésium ppm 03 Zinc 0 30 ppm Phosphore ppm 0 1249 Baryum 0 ppm Bore ppm 0 250





ELG Canada

4375 CORPORATE DRIVE BURLINGTON, ON CA L7L 5P7 Contact: Service Manager

T: F: (905)335-9687

Diagnostic

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL SAE 80. Please confirm. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot:	STR437BUR
Unique No:	5747569
Signed:	Wes Davis
Report Date:	15 Mar 2024


Submitted By: Eric Leblond





GRAPHS

 \odot

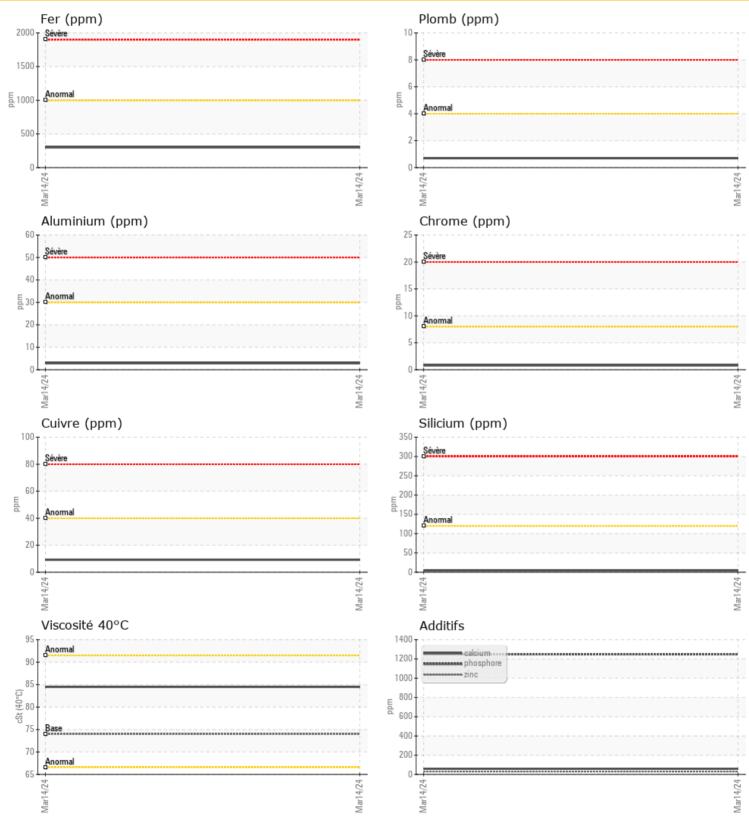

ID du rapport: STR437BUR [WCAMIS] 02622450 (Generated: 03/28/2024 16:17:24) Rev: 1