


OIL ANALYSIS REPORT



{UNASSIGNED} **OR779**

Component **Rear Right Final Drive**

PETRO CANADA TRAXON XL

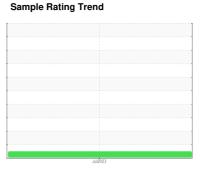



DIAGNOSIS

Recommendation

Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

Additive levels indicate the addition of a different brand, or type of oil. The condition of the oil is acceptable for the time in service.

SYN BLEND 80W14	0 (8 LTR)			Jul2023		
	. ,	l manthand	15 15-//		la faction and a	history O
SAMPLE INFOR	AMA HON		limit/base	current	history 1	history 2
Sample Number		Client Info		GFL0087397		
Sample Date		Client Info		05 Jul 2023		
Machine Age	hrs	Client Info		16325		
Oil Age	hrs	Client Info		500		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METAL	_S	method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185(m)	>800	231		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>5	<1		
Titanium	ppm	ASTM D5185(m)	>15	3		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>75	46		
Lead	ppm	ASTM D5185(m)	>10	0		
Copper	ppm	ASTM D5185(m)	>75	<1		
Tin	ppm	ASTM D5185(m)	>8	0		
Antimony	ppm	ASTM D5185(m)	>50	0		
Vanadium	ppm	ASTM D5185(m)	700	0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium		ASTM D5185(m)		0		
	ppm		12 24 7			
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185(m)	246	92		
Barium	ppm	ASTM D5185(m)	1	<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		2		
Magnesium	ppm	ASTM D5185(m)	1	17		
Calcium	ppm	ASTM D5185(m)	2	154		
Phosphorus	ppm	ASTM D5185(m)	976	866		
Zinc	ppm	ASTM D5185(m)	3	54		
Sulfur	ppm	ASTM D5185(m)	15600	12813		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINAN	NTS	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185(m)	>400	155		
Sodium	ppm	ASTM D5185(m)		16		
Potassium	ppm	ASTM D5185(m)	>20	16		
VISUAL		method	limit/base	current	history 1	history 2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
	Journal	710001				



OIL ANALYSIS REPORT

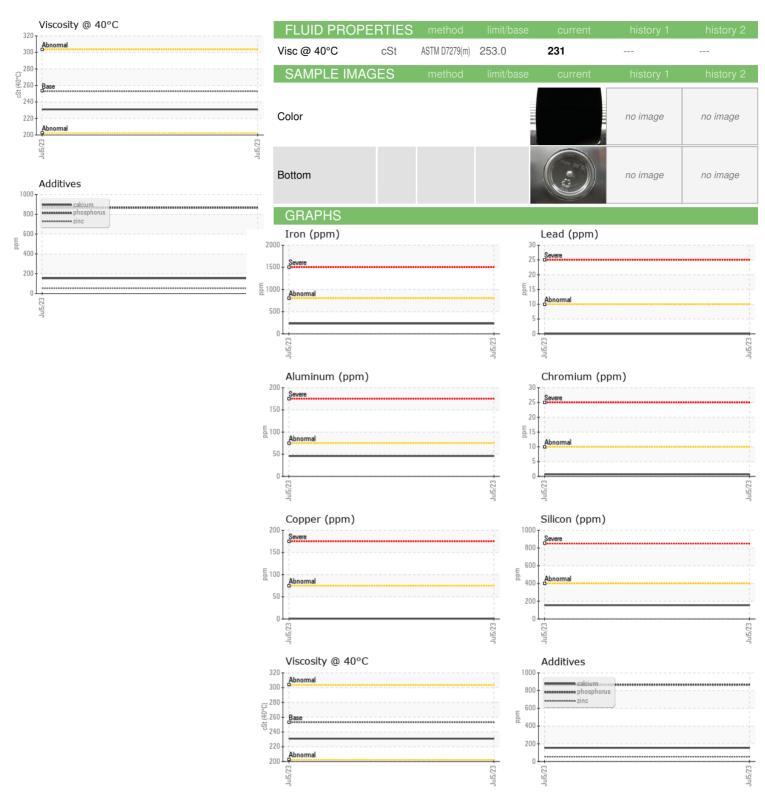



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number **Unique Number**

: GFL0087397

: 02568849 : 5605895 Test Package : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 720 - Lafleche - Landfill Received : 10 Jul 2023 : 10 Jul 2023 Diagnosed

Diagnostician

: Kevin Marson

17125 Lafleche Road, Moose Creek, ON CA K0C 1W0 Contact: Charles Bergeron cbergeron@gflenv.com

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: (613)538-4853