


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

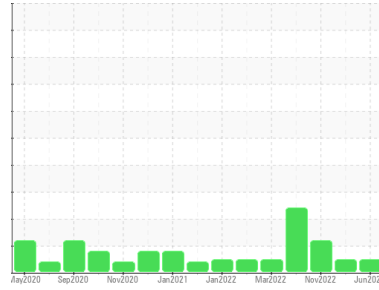

Machine Id
DR172

Component
Hydraulic System

Fluid
PETRO CANADA ENVIRON MV 46 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		PC0075250	PC0075678	PC0061567
Sample Date	Client Info		26 Jun 2023	05 May 2023	24 Nov 2022
Machine Age	hrs	Client Info	10117	9847	9332
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		Not Changed	Not Changed	Not Changed
Sample Status			NORMAL	NORMAL	ATTENTION

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >20	<1	<1	1
Chromium	ppm	ASTM D5185(m) >10	0	0	0
Nickel	ppm	ASTM D5185(m) >10	<1	0	<1
Titanium	ppm	ASTM D5185(m)	0	0	0
Silver	ppm	ASTM D5185(m)	0	0	0
Aluminum	ppm	ASTM D5185(m) >10	<1	<1	<1
Lead	ppm	ASTM D5185(m) >10	0	<1	<1
Copper	ppm	ASTM D5185(m) >75	<1	<1	<1
Tin	ppm	ASTM D5185(m) >10	0	0	0
Antimony	ppm	ASTM D5185(m)	0	0	<1
Vanadium	ppm	ASTM D5185(m)	0	0	0
Beryllium	ppm	ASTM D5185(m)	0	0	0
Cadmium	ppm	ASTM D5185(m)	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	<1	0	<1
Barium	ppm	ASTM D5185(m) 0	0	0	0
Molybdenum	ppm	ASTM D5185(m) 0	<1	<1	<1
Manganese	ppm	ASTM D5185(m) 0	0	0	0
Magnesium	ppm	ASTM D5185(m) 0	6	5	17
Calcium	ppm	ASTM D5185(m) 0	4	2	14
Phosphorus	ppm	ASTM D5185(m) 650	647	672	674
Zinc	ppm	ASTM D5185(m) 0	14	11	25
Sulfur	ppm	ASTM D5185(m) 1420	1375	1476	1452
Lithium	ppm	ASTM D5185(m)	<1	<1	<1



CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >20	0	<1	0
Sodium	ppm	ASTM D5185(m)	<1	<1	2
Potassium	ppm	ASTM D5185(m) >20	0	0	<1

VISUAL

	method	limit/base	current	history1	history2
White Metal	scalar	Visual* NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual* NONE	NONE	NONE	NONE
Precipitate	scalar	Visual* NONE	NONE	NONE	NONE
Silt	scalar	Visual* NONE	NONE	NONE	NONE
Debris	scalar	Visual* NONE	NONE	NONE	VLITE
Sand/Dirt	scalar	Visual* NONE	NONE	VLITE	NONE
Appearance	scalar	Visual* NORML	NORML	NORML	NORML
Odor	scalar	Visual* NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual* >0.1	NEG	NEG	NEG
Free Water	scalar	Visual*	NEG	NEG	NEG









OIL ANALYSIS REPORT

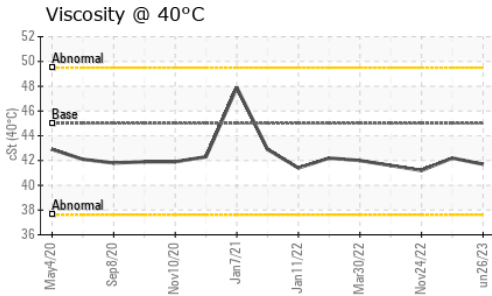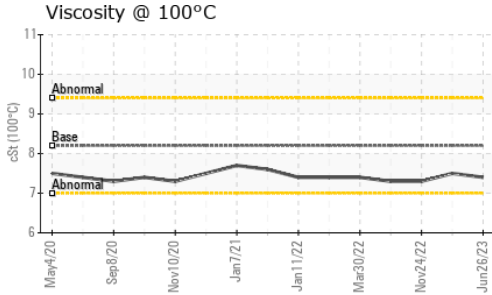

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	45.0	41.7	42.2
Visc @ 100°C	cSt	ASTM D7279(m)	8.2	7.4	7.5
Viscosity Index (VI)	Scale	ASTM D2270*	158	143	145

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					
PrtFilter			no image	no image	no image

GRAPHS

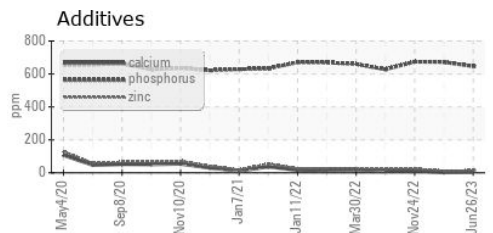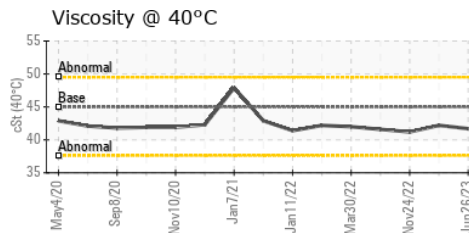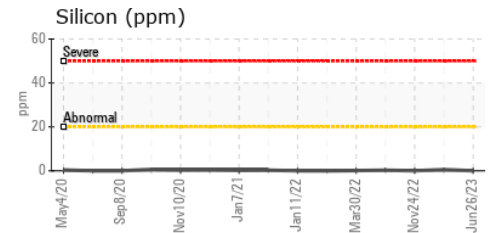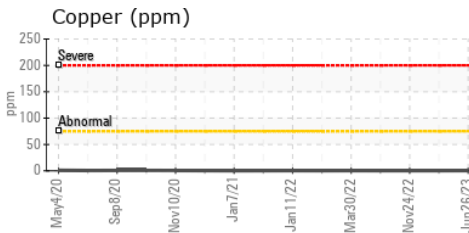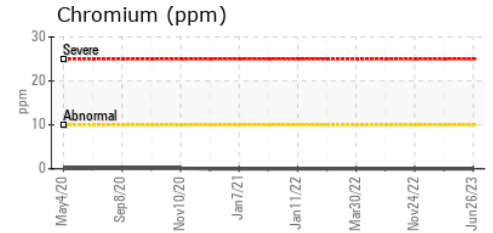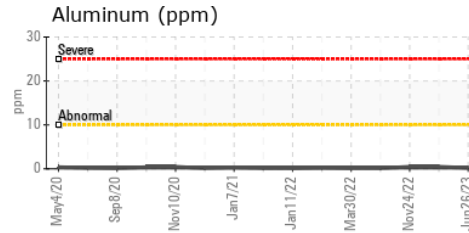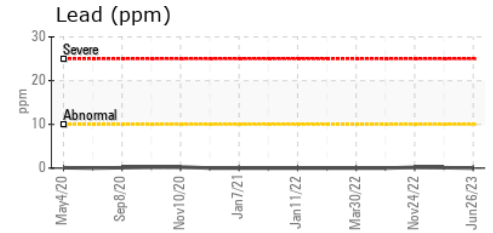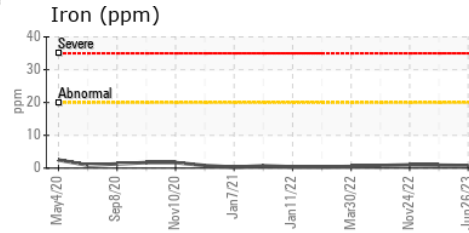

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Green Infrastructure and Partners Inc (GIPI) - 286 - Shoring & Foundations
Sample No. : PC0075250 **Received** : 25 Jul 2023
Lab Number : 02571964 **Diagnosed** : 25 Jul 2023
Unique Number : 5617015 **Diagnostician** : Wes Davis
Test Package : MOB 1 (Additional Tests: KV100, VI)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

151 Ram Forest Rd,
 Stouffville, ON
 CA L4A 2G8
 Contact: Shannon Abbott
 sabbott@gipi.com
 T: (905)750-5900
 F: