


OIL ANALYSIS REPORT





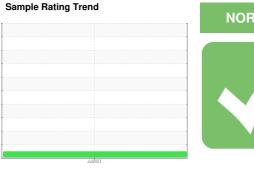

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. (Customer Sample Comment: Oil sampleed possibly Cat TDTO SAE 30)

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

Viscosity of sample indicates oil is within SAE 50 range, advise investigate. The condition of the oil is acceptable for the time in service.

IDO TO 4 0 4 F 00 /	40 L TD\					
IRO TO-4 SAE 30 (1	10 L I K)			Jul2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0087348		
Sample Date		Client Info		19 Jul 2023		
Machine Age	hrs	Client Info		6950		
Oil Age	hrs	Client Info		6950		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	56		
Chromium	ppm	ASTM D5185(m)	>10	4		
Nickel	ppm	ASTM D5185(m)		<1		
Titanium	ppm	ASTM D5185(m)		<1		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	12		
Lead	ppm	ASTM D5185(m)	>25	<1		
Copper	ppm	ASTM D5185(m)	>50	<1		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		<1		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
	рртт					
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	2	2		
Barium	ppm	ASTM D5185(m)	0	0		
Molybdenum	ppm	ASTM D5185(m)	0	3		
Manganese	ppm	ASTM D5185(m)	9	<1		
Magnesium	ppm	ASTM D5185(m)	1	13		
Calcium	ppm	ASTM D5185(m)	3131	3037		
Phosphorus	ppm	ASTM D5185(m)	1194	1068		
Zinc	ppm	ASTM D5185(m)	1281	1230		
Sulfur	ppm	ASTM D5185(m)	3811	12015		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	55		
Sodium	ppm	ASTM D5185(m)		5		
Potassium	ppm	ASTM D5185(m)	>20	5		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
0:56:53) Rev: 1	- 50,001				Submitted By: C	harles Bergeron



OIL ANALYSIS REPORT

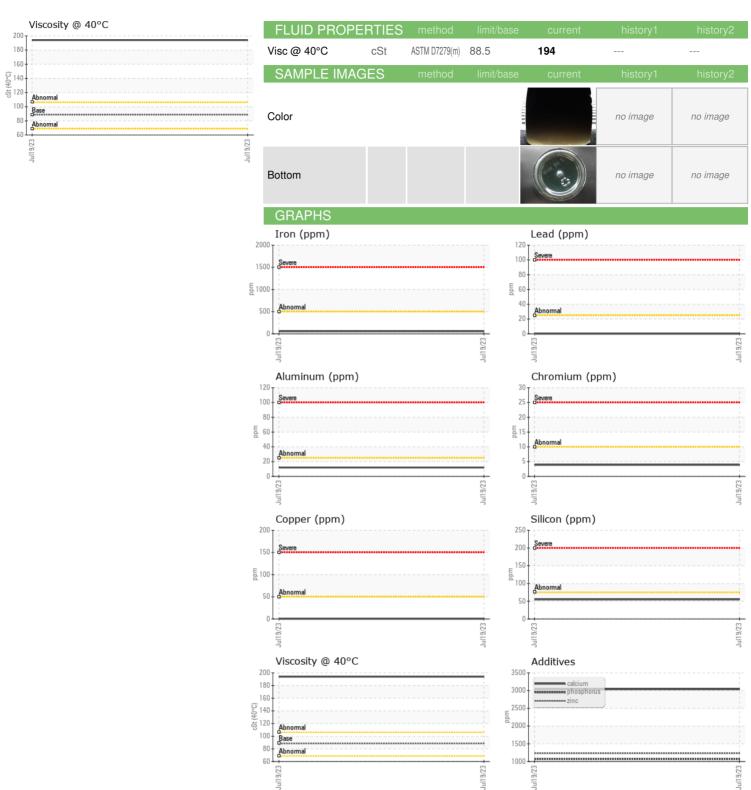



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number : 5617506

Test Package : MOB 1

: GFL0087348 : 02572455

Received Diagnosed

: 26 Jul 2023 : 28 Jul 2023

Diagnostician : Kevin Marson

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 720 - Lafleche - Landfill 17125 Lafleche Road, Moose Creek, ON CA K0C 1W0 Contact: Charles Bergeron

cbergeron@gflenv.com T: (613)538-4853

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.