


OIL ANALYSIS REPORT



Scoop 6 Yard LHD6102

Component **Rear Right Wheel Hub**

PETRO CANADA TRAXON 80W90 (4 LTR)

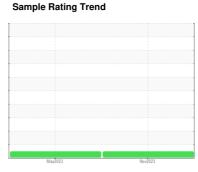



DIAGNOSIS

Recommendation

Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

Additive levels indicate the addition of a different brand, or type of oil. The condition of the oil is acceptable for the time in service.

XON 80W90 (4 I	LTR)		May2023	Nov2023		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PC0075099	PC0066827	
Sample Date		Client Info		02 Nov 2023	11 May 2023	
Machine Age	hrs	Client Info		3868	2662	
Oil Age	hrs	Client Info		0	0	
Oil Changed	1110	Client Info		N/A	N/A	
Sample Status		Olioni illio		NORMAL	NORMAL	
WEAR METAL	_S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	138	39	
Chromium	ppm	ASTM D5185(m)	>8	<1	<1	
Nickel	ppm	ASTM D5185(m)	>5	<1	<1	
Titanium	ppm	ASTM D5185(m)		0	0	
Silver	ppm	ASTM D5185(m)		<1	0	
Aluminum	ppm	ASTM D5185(m)	>5	<1	<1	
Lead	ppm	ASTM D5185(m)	>5	<1	<1	
Copper	ppm	ASTM D5185(m)		8	6	
Tin	ppm	ASTM D5185(m)	>50	0	0	
Antimony		ASTM D5185(m)	<u> </u>	0	0	
•	ppm		>0	0	0	
Vanadium	ppm	ASTM D5185(m)				
Beryllium	ppm	ASTM D5185(m)		0	0	
Cadmium	ppm	ASTM D5185(m)		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	243	6	34	
Barium	ppm	ASTM D5185(m)	1	4	18	
Molybdenum	ppm	ASTM D5185(m)		0	<1	
Manganese	ppm	ASTM D5185(m)		1	<1	
Magnesium	ppm	ASTM D5185(m)	2	1	3	
Calcium	ppm	ASTM D5185(m)	6	23	14	
Phosphorus	ppm	ASTM D5185(m)	987	633	883	
Zinc	ppm	ASTM D5185(m)	1	21	16	
Sulfur	ppm	ASTM D5185(m)	21530	22577	22113	
Lithium	ppm	ASTM D5185(m)		<1	<1	
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	3	2	
Sodium	ppm	ASTM D5185(m)		<1	<1	
Potassium	ppm	ASTM D5185(m)	>20	0	<1	
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	
Precipitate	scalar	Visual*	NONE	NONE	NONE	
Silt	scalar	Visual*	NONE	NONE	NONE	
Debris	scalar	Visual*	NONE	NONE	NONE	
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	
Appearance	scalar	Visual*	NORML	NORML	NORML	
Odor	scalar	Visual*	NORML	NORML	NORML	
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	
Free Water	scalar	Visual*		NEG	NEG	
:26:26) Pay: 1					Cubmitted B	V. Luo Polones



OIL ANALYSIS REPORT

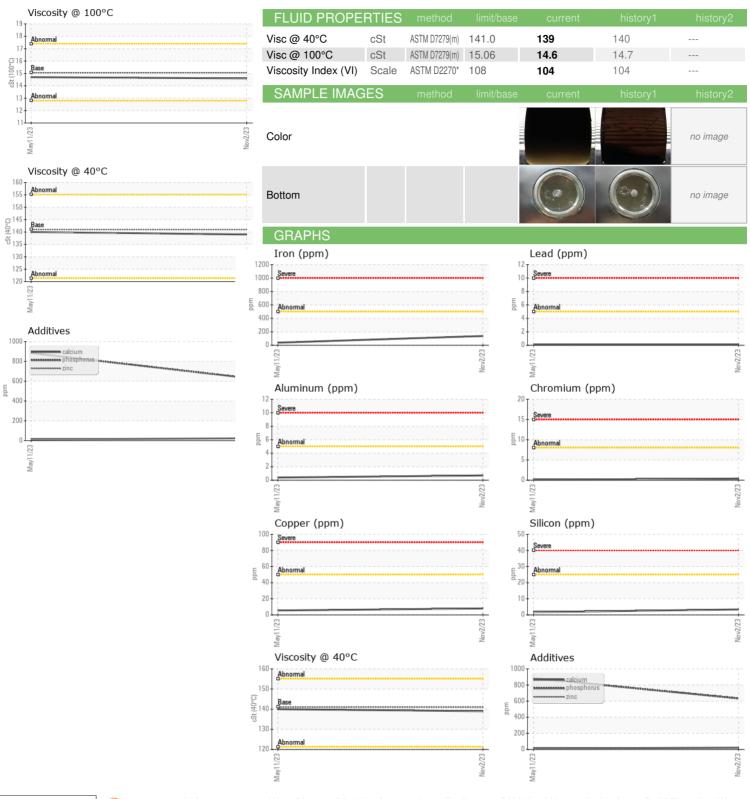



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

: PC0075099

: 02596312

Received Diagnosed Diagnostician : Wes Davis : 5681392

: 14 Nov 2023

: 14 Nov 2023

Test Package : MOB 1 (Additional Tests: KV100, VI) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Lakeshore Gold Timmins West

Timmins, ON CA

Contact: Adam Koscielak adam.koscielak@HFSinclair.com

> T: F: