



OIL ANALYSIS REPORT

Sample Rating Trend

ISO



Machine Id
OR706

Component
Hydraulic System

Fluid
AW HYDRAULIC OIL ISO 32 (--- GAL)



DIAGNOSIS

Recommendation

Nous recommandons le remplacement des filtres de ce composant. Nous vous recommandons d'échantillonner de nouveau dès que possible afin de contrôler la situation.

Wear

Les taux d'usure de tous les composants sont normaux.

Contamination

Il y a une quantité modérée de particules (de 4 à 14 microns) dans l'huile.

Fluid Condition

l'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0097026	---	---
Sample Date	Client Info		15 Nov 2023	---	---
Machine Age	hrs	Client Info	12	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		Not Changed	---	---
Sample Status			ABNORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.1	NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>65	22	---	---
Chromium	ppm	ASTM D5185(m)	>6	6	---	---
Nickel	ppm	ASTM D5185(m)	>10	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		<1	---	---
Aluminum	ppm	ASTM D5185(m)	>5	1	---	---
Lead	ppm	ASTM D5185(m)	>45	<1	---	---
Copper	ppm	ASTM D5185(m)	>120	3	---	---
Tin	ppm	ASTM D5185(m)	>4	0	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)	5	2	---	---
Barium	ppm	ASTM D5185(m)	5	<1	---	---
Molybdenum	ppm	ASTM D5185(m)	5	<1	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)	25	17	---	---
Calcium	ppm	ASTM D5185(m)	200	428	---	---
Phosphorus	ppm	ASTM D5185(m)	300	383	---	---
Zinc	ppm	ASTM D5185(m)	370	422	---	---
Sulfur	ppm	ASTM D5185(m)	2500	1526	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---

CONTAMINANTS





	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>25	3	---	---
Sodium	ppm	ASTM D5185(m)		2	---	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---	---

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	▲ 12223	---	---
Particles >6µm	ASTM D7647	>1300	▲ 2005	---	---
Particles >14µm	ASTM D7647	>160	58	---	---
Particles >21µm	ASTM D7647	>40	11	---	---
Particles >38µm	ASTM D7647	>10	2	---	---
Particles >71µm	ASTM D7647	>3	1	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 21/18/13	---	---



OIL ANALYSIS REPORT

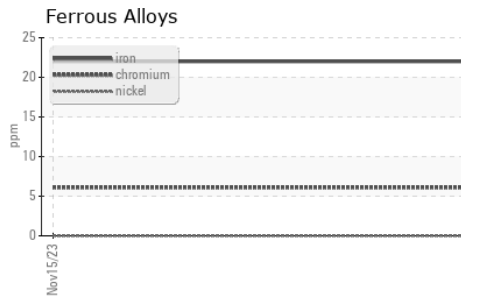
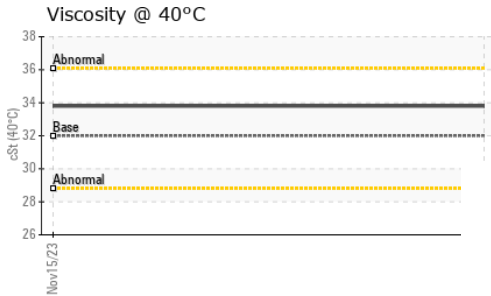
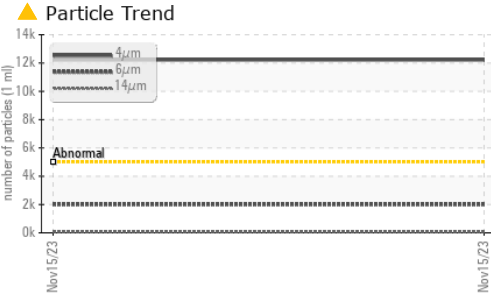
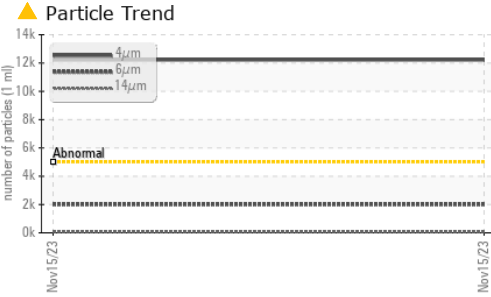


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	---
Yellow Metal	scalar	Visual*	NONE	NONE	---
Precipitate	scalar	Visual*	NONE	NONE	---
Silt	scalar	Visual*	NONE	NONE	---
Debris	scalar	Visual*	NONE	NONE	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---
Appearance	scalar	Visual*	NORML	NORML	---
Odor	scalar	Visual*	NORML	NORML	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---
Free Water	scalar	Visual*		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	32	33.8	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

GRAPHS

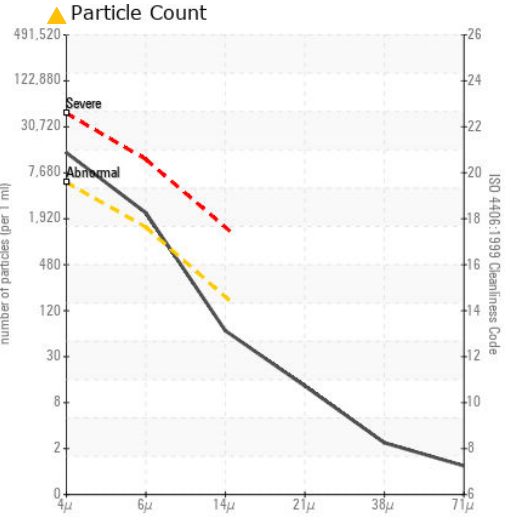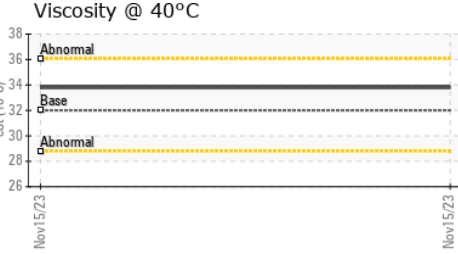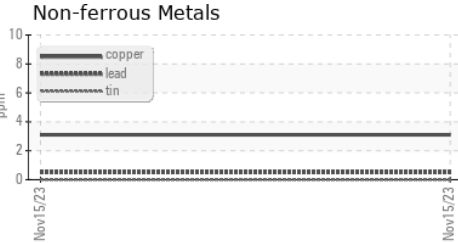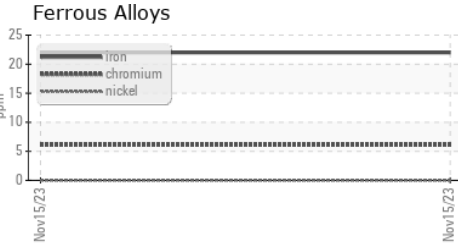

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 780 - GMA - ICI - Solid Waste
Sample No. : GFL0097026 **Received** : 20 Nov 2023
Lab Number : 02597566 **Diagnosed** : 22 Nov 2023
Unique Number : 5682646 **Diagnostician** : Kevin Marson
Test Package : MOB 1 (Additional Tests: PrtCount)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.