


OIL ANALYSIS REPORT

SHARP BUS LINES **INTERNATIONAL 1239**

Component

Diesel Engine

PETRO CANADA 15W40 (--- GAL)

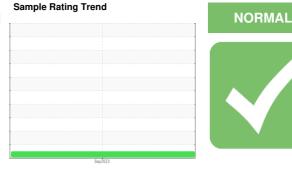

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
	WATION		IIIIIIIIIIIII		•	HISTOLYZ
Sample Number		Client Info		PC0081530		
Sample Date		Client Info		14 Sep 2023		
Machine Age	kms	Client Info		210611		
Oil Age	kms	Client Info		1073		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>2.0	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	26		
Chromium	ppm	ASTM D5185(m)	>20	<1		
Nickel	ppm	ASTM D5185(m)	>4	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>3	<1		
Aluminum	ppm	ASTM D5185(m)	>20	2		
Lead	ppm	ASTM D5185(m)	>40	<1		
Copper	ppm	ASTM D5185(m)	>330	<1		
Tin	ppm	ASTM D5185(m)	>15	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		2		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		55		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		840		
Calcium	ppm	ASTM D5185(m)		942		
Phosphorus	ppm	ASTM D5185(m)		896		
Zinc	ppm	ASTM D5185(m)		1040		
Sulfur	ppm	ASTM D5185(m)		2292		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	3		
Sodium	ppm	ASTM D5185(m)		3		
Potassium	ppm	ASTM D5185(m)	>20	<1		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	1.4		
Nitration	Abs/cm	ASTM D7624*	>20	8.4		
Sulfation	Abs/.1mm	ASTM D7415*	>30	22.6		



OIL ANALYSIS REPORT

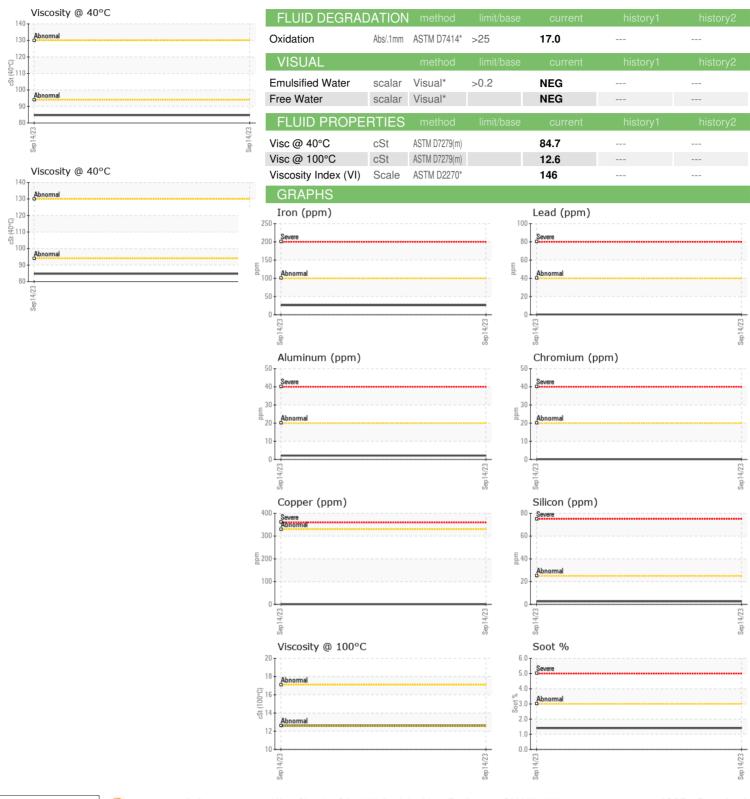



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : PC0081530 : 02598140

: 5683220

Received Diagnosed

: 22 Nov 2023 : 22 Nov 2023 Diagnostician : Wes Davis

Test Package : MOB 1 (Additional Tests: KV40, VI)

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

ICSB - Brantford 567 Oak Park Rd. Brantford, ON CA N3T 5L8 Contact: Doug Hall Djhall@sharpbus.com T: (519)751-3434