


OIL ANALYSIS REPORT

Machine Id Tractor

Component

Diesel Engine

PETRO CANADA DURON SHP 15W40 (15 LTR)

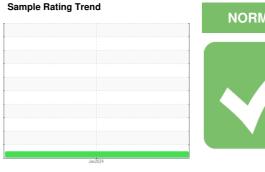

NORMAL

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The condition of the oil is acceptable for the time in service.

N SHP 15W40 (⁻	15 LTR)			Jan2024		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0092251		
Sample Date		Client Info		19 Jan 2024		
Machine Age	hrs	Client Info		10017		
Oil Age	hrs	Client Info		250		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	TION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METAL	_S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	16		
Chromium	ppm	ASTM D5185(m)	>20	<1		
Nickel	ppm	ASTM D5185(m)	>4	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>3	0		
Aluminum	ppm	ASTM D5185(m)	>20	2		
Lead	ppm	ASTM D5185(m)	>40	<1		
Copper	ppm	ASTM D5185(m)	>330	<1		
Tin	ppm	ASTM D5185(m)	>15	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	11		
Barium	ppm	ASTM D5185(m)	0	0		
Molybdenum	ppm	ASTM D5185(m)	60	54		
Manganese	ppm	ASTM D5185(m)	0	0		
Magnesium	ppm	ASTM D5185(m)	1010	859		
Calcium	ppm	ASTM D5185(m)	1070	1365		
Phosphorus	ppm	ASTM D5185(m)	1150	1035		
Zinc	ppm	ASTM D5185(m)	1270	1212		
Sulfur	ppm	ASTM D5185(m)	2060	2702		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINAN	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	8		
Sodium	ppm	ASTM D5185(m)		2		
Potassium	ppm	ASTM D5185(m)	>20	<1		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0		
Nitration	Abs/cm	ASTM D7624*	>20	6.5		
Sulfation	Abs/.1mm	ASTM D7415*	>30	19.0		



OIL ANALYSIS REPORT





CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: GFL0092251

: 02610845 : 5719940 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 720 - Lafleche - Landfill Recieved : 24 Jan 2024 Diagnosed

: 24 Jan 2024 Diagnostician : Wes Davis

17125 Lafleche Road, Moose Creek, ON CA K0C 1W0 Contact: Charles Bergeron cbergeron@gflenv.com

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

To discuss this sample report, contact Customer Service at 1-800-268-2131.

T: (613)538-4853