




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Machine Id
OR962
 Component
Center Transfer Gearbox
 Fluid
PETRO CANADA PRODURO TO-4 SAE 30 (9 LTR)

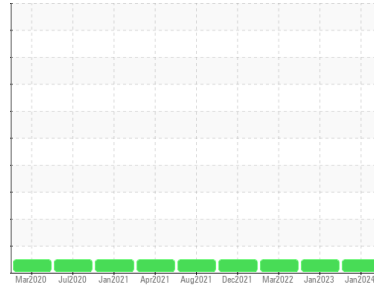

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0092253	GFL0064905	GFL0030414
Sample Date	Client Info		19 Jan 2024	10 Jan 2023	15 Mar 2022
Machine Age	hrs	Client Info	13733	10932	8982
Oil Age	hrs	Client Info	2144	2500	500
Oil Changed	Client Info		Not Changed	Changed	Not Changed
Sample Status			NORMAL	NORMAL	NORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >200	9	7	4
Chromium	ppm	ASTM D5185(m) >10	0	0	0
Nickel	ppm	ASTM D5185(m) >10	<1	<1	0
Titanium	ppm	ASTM D5185(m)	0	<1	0
Silver	ppm	ASTM D5185(m)	0	0	0
Aluminum	ppm	ASTM D5185(m)	1	<1	<1
Lead	ppm	ASTM D5185(m)	<1	<1	<1
Copper	ppm	ASTM D5185(m)	<1	0	<1
Tin	ppm	ASTM D5185(m)	0	0	0
Antimony	ppm	ASTM D5185(m) >5	0	0	0
Vanadium	ppm	ASTM D5185(m)	0	0	0
Beryllium	ppm	ASTM D5185(m)	0	0	0
Cadmium	ppm	ASTM D5185(m)	0	0	0

ADDITIVES


	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 2	21	38	38
Barium	ppm	ASTM D5185(m) 0	0	0	0
Molybdenum	ppm	ASTM D5185(m) 0	3	2	2
Manganese	ppm	ASTM D5185(m) 9	0	<1	0
Magnesium	ppm	ASTM D5185(m) 1	47	38	42
Calcium	ppm	ASTM D5185(m) 3131	2588	2384	2330
Phosphorus	ppm	ASTM D5185(m) 1194	839	927	915
Zinc	ppm	ASTM D5185(m) 1281	959	954	974
Sulfur	ppm	ASTM D5185(m) 3811	3275	3087	2982
Lithium	ppm	ASTM D5185(m)	<1	<1	<1

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	4	2	2
Sodium	ppm	ASTM D5185(m)	<1	1	1
Potassium	ppm	ASTM D5185(m) >20	<1	<1	<1




OIL ANALYSIS REPORT

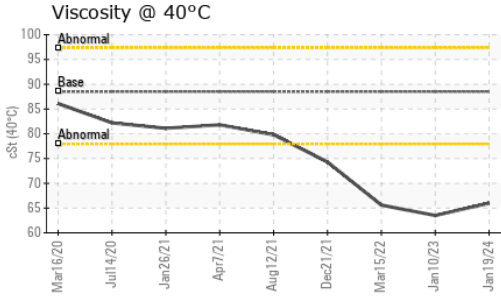


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	VLITE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	88.5	66.0	63.5	65.6

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

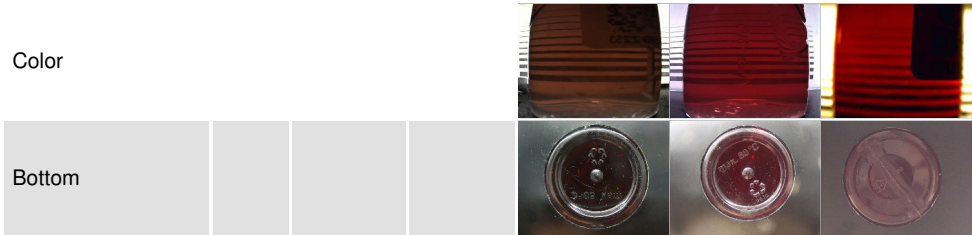

GRAPHS

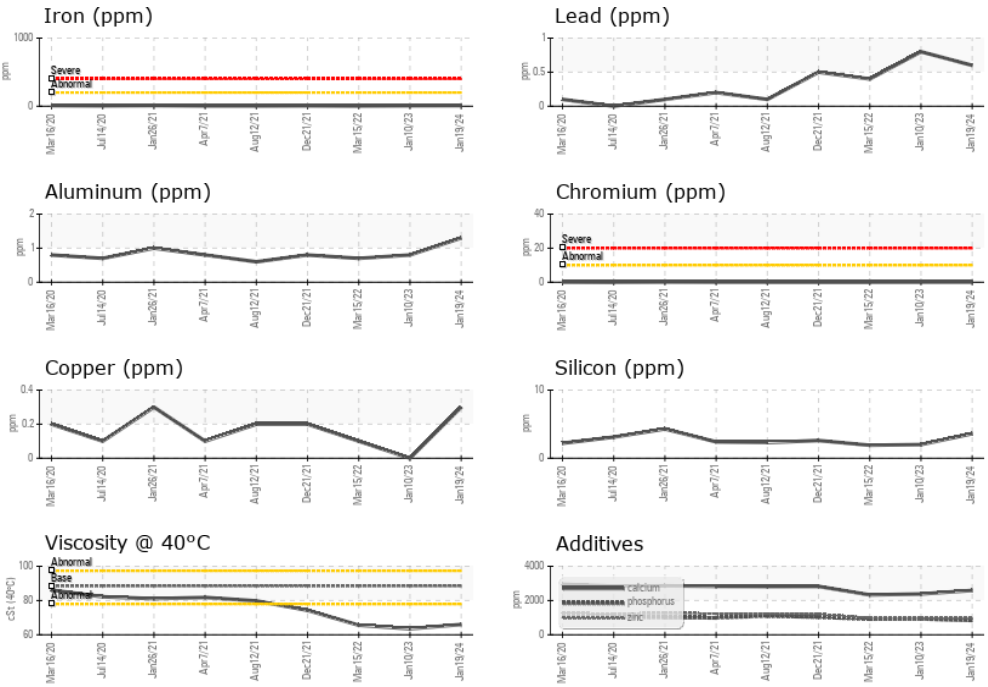

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 720 - Lafleche - Landfill
Sample No. : GFL0092253 **Recieved** : 24 Jan 2024
Lab Number : **02610937** **Diagnosed** : 24 Jan 2024
Unique Number : 5720032 **Diagnostician** : Wes Davis
Test Package : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

17125 Lafleche Road,
 Moose Creek, ON
 CA K0C 1W0
 Contact: Charles Bergeron
 cbergeron@gflenv.com
 T: (613)538-4853
 F: