


# **OIL ANALYSIS REPORT**

Or1982

Component

Front Left Planetary

PETRO CANADA TRAXON XL SYN BLEND 80W140 (2 LTR)

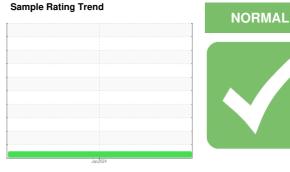

### DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the

### **Fluid Condition**


The condition of the oil is acceptable for the time in service.

SYN BLEND 80W1	40 (2 LTR)			Jan 2024		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0092285		
Sample Date		Client Info		19 Jan 2024		
Machine Age	hrs	Client Info		9642		
Oil Age	hrs	Client Info		500		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINA <sup>*</sup>	TION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR META	LS	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185(m)	>500	53		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	<1		
_ead	ppm	ASTM D5185(m)	>25	4		
Copper	ppm	ASTM D5185(m)	>75	36		
Tin	ppm	ASTM D5185(m)	>10	4		
Antimony	ppm	ASTM D5185(m)	>5	15		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	246	176		
Barium	ppm	ASTM D5185(m)	1	0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	1	0		
Calcium	ppm	ASTM D5185(m)	2	3		
Phosphorus	ppm	ASTM D5185(m)	976	975		
Zinc	ppm	ASTM D5185(m)	3	5		
Sulfur	ppm	ASTM D5185(m)	15600	16670		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	7		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		




## **OIL ANALYSIS REPORT**

CAMBLEIMACE

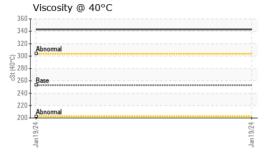

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
<b>Emulsified Water</b>	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	253.0	343		

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image
0 = 1 = 1 10					

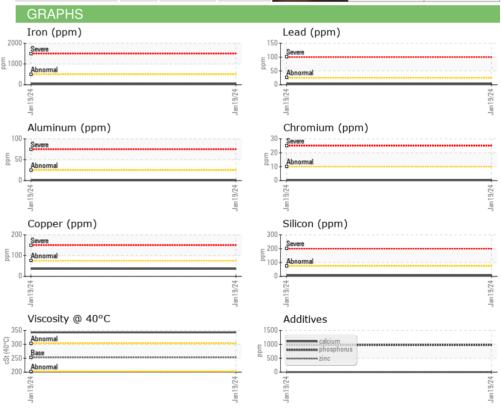



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number : 5720035

Test Package : MOB 1

: GFL0092285

: 02610940

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 720 - Lafleche - Landfill Recieved : 24 Jan 2024 Diagnosed

: 24 Jan 2024 Diagnostician : Wes Davis

17125 Lafleche Road, Moose Creek, ON CA K0C 1W0

Contact: Charles Bergeron cbergeron@gflenv.com T: (613)538-4853

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.