


OIL ANALYSIS REPORT

Or1981

Component

Front Right Planetary

PETRO CANADA TRAXON E

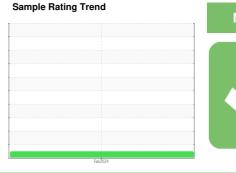



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The condition of the oil is acceptable for the time in service.

SYNTHETIC 80W-14	10 (6 LTR)		Feb 2024		
SAMPLE INFOR	RMATIO	V method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0092264		
Sample Date		Client Info		09 Feb 2024		
Machine Age	hrs	Client Info		10314		
Oil Age	hrs	Client Info		10314		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINA	TION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR META	LS	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	250		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	4		
Lead	ppm	ASTM D5185(m)	>25	2		
Copper	ppm	ASTM D5185(m)	>75	10		
Tin	ppm	ASTM D5185(m)	>10	1		
Antimony	ppm	ASTM D5185(m)	>5	27		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	202	168		
Barium	ppm	ASTM D5185(m)	<1	0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		1		
Magnesium	ppm	ASTM D5185(m)	<1	<1		
Calcium	ppm	ASTM D5185(m)		8		
Phosphorus	ppm	ASTM D5185(m)	1209	1000		
Zinc	ppm	ASTM D5185(m)		7		
Sulfur	ppm	ASTM D5185(m)	20439	16471		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINA	VTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	18		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	1		




OIL ANALYSIS REPORT

cSt

ASTM D7279(m) 230


Visc @ 40°C

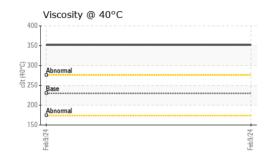

VISUAL		method				history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	VLITE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image
0.001.00					

352

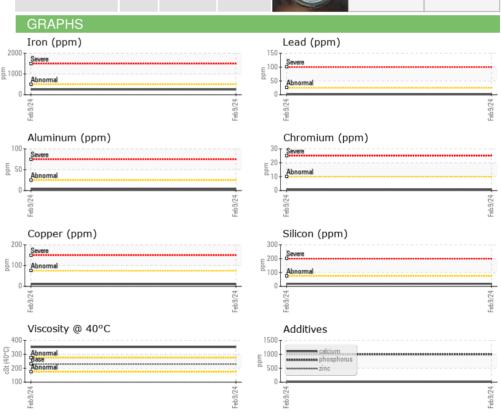



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: GFL0092264

Lab Number : 02615435 Unique Number : 5724530 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 720 - Lafleche - Landfill Received **Tested**

Diagnosed

: 13 Feb 2024 : 14 Feb 2024

: 14 Feb 2024 - Wes Davis

17125 Lafleche Road, Moose Creek, ON CA K0C 1W0 Contact: Charles Bergeron cbergeron@gflenv.com T: (613)538-4853

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.