

OIL ANALYSIS REPORT






CAPLAN 8322

Component

Rear Rear Differential

PETRO CANADA TRAXON SYNTHETIC 75W90 (14 LTR)

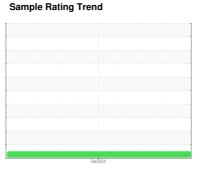



DIAGNOSIS

Recommendation

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition. (Customer Sample Comment: Top Up Amount: 1,5 LTR)

Les taux d'usure de tous les composants sont normaux.

Contamination

Il n'y a aucun indice de contamination dans l'huile.


Fluid Condition

L'état de l'huile est acceptable pour la durée de service.

SYNTHETIC 75W90 ((14 LIK)			Feb 2024		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0091116		
Sample Date		Client Info		09 Feb 2024		
Machine Age	hrs	Client Info		16560		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Oil Added		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>.2	NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	89		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	3		
Lead	ppm	ASTM D5185(m)	>25	<1		
Copper	ppm	ASTM D5185(m)	>100	5		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	328	221		
Barium	ppm	ASTM D5185(m)	1	0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		2		
Magnesium	ppm	ASTM D5185(m)	1	1		
Calcium	ppm	ASTM D5185(m)	7	17		
Phosphorus	ppm	ASTM D5185(m)	1145	1395		
Zinc	ppm	ASTM D5185(m)	3	10		
Sulfur	ppm	ASTM D5185(m)	17909	23431		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	17		
Sodium	ppm	ASTM D5185(m)		4		
Potassium	ppm	ASTM D5185(m)	>20	1		




OIL ANALYSIS REPORT

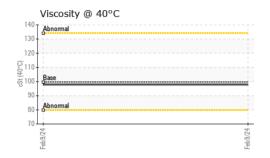

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>.2	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	97.8		

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

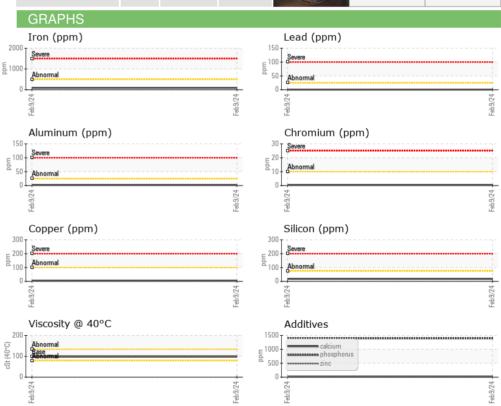

: 14 Feb 2024

: 14 Feb 2024

: 15 Feb 2024 - Kevin Marson



CALA ISO 17025:2017 Accredited

Laboratory Sample No.

: GFL0091116 Lab Number : 02615763 Unique Number : 5724858

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received **Tested** Diagnosed

Test Package : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Matrec - 791 - Rimouski

350 Avenue de L'Industrie Rimouski, QC CA G5M 1W4

Contact: Vincent Maltais info@foretsstar.com T: 4(18)388-2626 F: (418)388-2038