




OIL ANALYSIS REPORT

Sample Rating Trend

ISO



Machine Id
711032
Component
Hydraulic System
Fluid
PETRO CANADA HYDREX MV 32 (--- GAL)

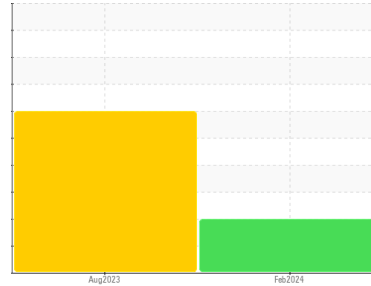

DIAGNOSIS

▲ Recommendation

Vérifier les scelles et/ou les filtres pour des points d'entrée des contaminants. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessicant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Nous recommandons le remplacement des filtres de ce composant. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation.

Wear

Les taux d'usure de tous les composants sont normaux.

▲ Contamination

Il y a une grande quantité de limon (particules de 4 à 14 microns) dans l'huile.

Fluid Condition

L'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0103719	GFL0088819	---
Sample Date	Client Info		24 Feb 2024	30 Aug 2023	---
Machine Age	hrs	Client Info	6977	97083	---
Oil Age	hrs	Client Info	0	0	---
Oil Changed	Client Info		N/A	Not Changd	---
Sample Status			SEVERE	SEVERE	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.1	NEG	NEG	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >50	4	8	---
Chromium	ppm	ASTM D5185(m) >10	0	<1	---
Nickel	ppm	ASTM D5185(m) >4	0	0	---
Titanium	ppm	ASTM D5185(m)	0	0	---
Silver	ppm	ASTM D5185(m)	0	<1	---
Aluminum	ppm	ASTM D5185(m) >5	<1	1	---
Lead	ppm	ASTM D5185(m) >4	0	0	---
Copper	ppm	ASTM D5185(m) >15	<1	1	---
Tin	ppm	ASTM D5185(m) >4	0	0	---
Antimony	ppm	ASTM D5185(m)	0	0	---
Vanadium	ppm	ASTM D5185(m)	0	0	---
Beryllium	ppm	ASTM D5185(m)	0	0	---
Cadmium	ppm	ASTM D5185(m)	0	0	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	0	<1	---
Barium	ppm	ASTM D5185(m) 0	0	0	---
Molybdenum	ppm	ASTM D5185(m) 0	<1	<1	---
Manganese	ppm	ASTM D5185(m) 1	0	0	---
Magnesium	ppm	ASTM D5185(m) 0	16	10	---
Calcium	ppm	ASTM D5185(m) 50	69	64	---
Phosphorus	ppm	ASTM D5185(m) 330	340	367	---
Zinc	ppm	ASTM D5185(m) 430	423	430	---
Sulfur	ppm	ASTM D5185(m) 760	807	772	---
Lithium	ppm	ASTM D5185(m)	<1	<1	---

CONTAMINANTS




	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	1	3	---
Sodium	ppm	ASTM D5185(m)	4	7	---
Potassium	ppm	ASTM D5185(m) >20	1	1	---

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	▲ 56873	▲ 123578	---
Particles >6µm	ASTM D7647	>1300	▲ 3025	▲ 41104	---
Particles >14µm	ASTM D7647	>160	153	▲ 1482	---
Particles >21µm	ASTM D7647	>40	39	▲ 298	---
Particles >38µm	ASTM D7647	>10	3	6	---
Particles >71µm	ASTM D7647	>3	0	0	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 23/19/14	▲ 24/23/18	---



OIL ANALYSIS REPORT

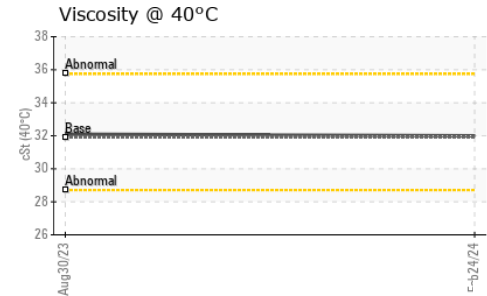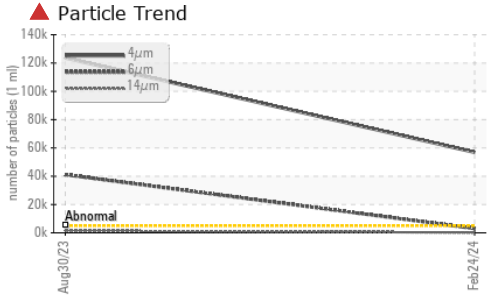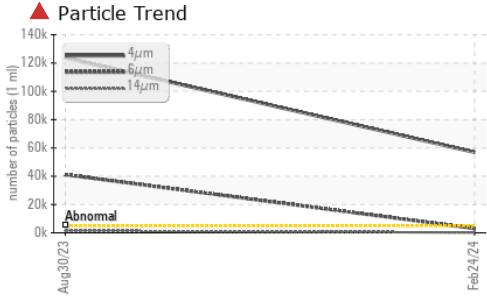





VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	VLITE	---
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	---
Precipitate	scalar	Visual*	NONE	NONE	NONE	---
Silt	scalar	Visual*	NONE	NONE	VLITE	---
Debris	scalar	Visual*	NONE	NONE	NONE	---
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	---
Appearance	scalar	Visual*	NORML	NORML	NORML	---
Odor	scalar	Visual*	NORML	NORML	NORML	---
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	---
Free Water	scalar	Visual*		NEG	NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	31.9	32.0	32.1	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color			no image
Bottom			no image
PrtFilter			no image

GRAPHS

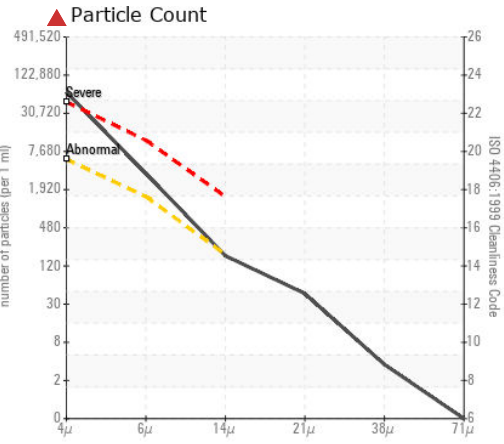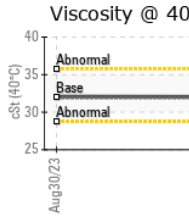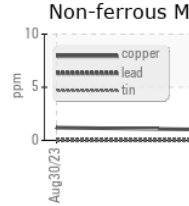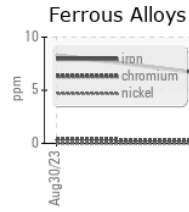

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **GFL Environmental - 780 - GMA - ICI - Solid Waste**
Sample No. : GFL0103719 **Received** : 28 Feb 2024 4365 boul. St-Elzear Ouest,
Lab Number : **02618674** **Tested** : 29 Feb 2024 Laval, QC
Unique Number : 5735784 **Diagnosed** : 29 Feb 2024 - Wes Davis CA H7P 4J3
Test Package : MOB 1 (Additional Tests: PrtCount) Contact: Pieces Laval
 pieces.laval@gflenv.com

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.