


OIL ANALYSIS REPORT





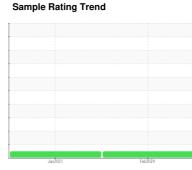

OE1021 Component

Diesel Engine

SAE 5W40 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Metal levels are typical for a new component breaking in.

Contamination

There is no indication of any contamination in the


Fluid Condition


The condition of the oil is acceptable for the time in service.

			Jan 2021	Feb 2024		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PC0078311	PC0042297	
Sample Date		Client Info		22 Feb 2024	13 Jan 2021	
Machine Age	hrs	Client Info		961	422	
Oil Age	hrs	Client Info		0	120	
Oil Changed		Client Info		Changed	Changed	
Sample Status				NORMAL	NORMAL	
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0	0.7	
Water		WC Method	>0.2	NEG	NEG	
Glycol		WC Method		NEG	NEG	
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	18	7	
Chromium	ppm	ASTM D5185(m)	>20	1	<1	
Nickel	ppm	ASTM D5185(m)	>4	<1	<1	
Titanium	ppm	ASTM D5185(m)		0	0	
Silver	ppm	ASTM D5185(m)	>3	0	0	
Aluminum	ppm	ASTM D5185(m)	>20	15	10	
Lead	ppm	ASTM D5185(m)	>40	0	0	
Copper	ppm	ASTM D5185(m)	>330	2	1	
Tin	ppm	ASTM D5185(m)	>15	0	0	
Antimony	ppm	ASTM D5185(m)		0	0	
Vanadium	ppm	ASTM D5185(m)		0	0	
Beryllium	ppm	ASTM D5185(m)		0	0	
Cadmium	ppm	ASTM D5185(m)		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		38	51	
Barium	ppm	ASTM D5185(m)		0	0	
Molybdenum	ppm	ASTM D5185(m)		58	70	
Manganese	ppm	ASTM D5185(m)		0	<1	
Magnesium	ppm	ASTM D5185(m)		892	22	
Calcium	ppm	ASTM D5185(m)		1050	2080	
Phosphorus	ppm	ASTM D5185(m)		1023	955	
Zinc	ppm	ASTM D5185(m)		1183	1141	
Sulfur	ppm	ASTM D5185(m)		3011	3227	
Lithium	ppm	ASTM D5185(m)		<1	<1	
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	6	7	
Sodium	ppm	ASTM D5185(m)	00	4	3	
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0	0	
Nitration	Abs/cm		>20	10.5	9.0	
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.6	18.2	



OIL ANALYSIS REPORT

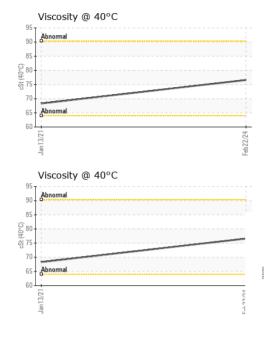

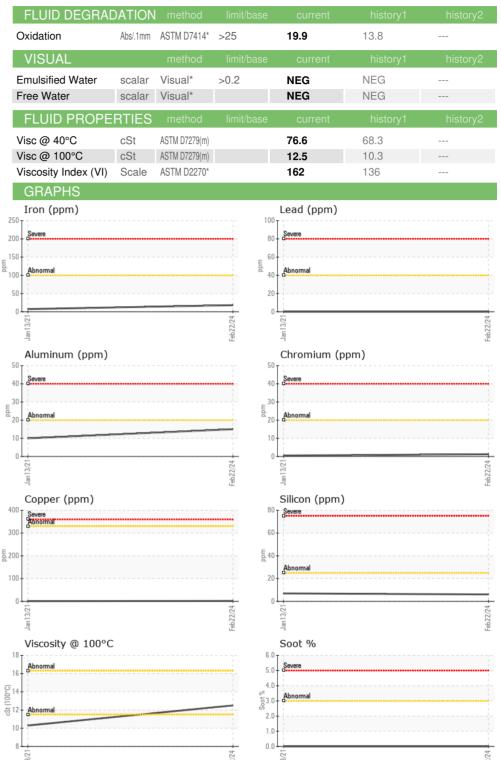



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number

: PC0078311 : 02619154

Received **Tested** Unique Number : 5736264 Test Package : MOB 1 (Additional Tests: KV40, VI)

Validity of results and interpretation are based on the sample and information as supplied.

:01 Mar 2024 : 01 Mar 2024 Diagnosed

: 01 Mar 2024 - Wes Davis

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Green Infrastructure and Partners Inc (GIPI) - 286 - Shoring & Foundations 151 Ram Forest Rd, Stouffville, ON CA L4A 2G8

Contact: Shannon Abbott sabbott@gipi.com T: (905)750-5900

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.