

OIL ANALYSIS REPORT

Sample Rating Trend


NORMAL



731090 Component

Transmission (Auto)

PETRO CANADA DuraDrive HD Synthetic 668 (--- GAL)

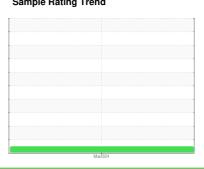



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the fluid.


Fluid Condition

The condition of the fluid is acceptable for the time in service.

HD Synthetic 668	(GAL)			Mar2024		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0110225		
Sample Date		Client Info		07 Mar 2024		
Machine Age	hrs	Client Info		5542		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINA	TION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METAI	LS	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185(m)	>160	40		
Chromium	ppm	ASTM D5185(m)	>5	0		
Nickel	ppm	ASTM D5185(m)	>5	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>5	0		
Aluminum	ppm	ASTM D5185(m)	>50	30		
Lead	ppm	ASTM D5185(m)	>50	3		
Copper	ppm	ASTM D5185(m)	>225	11		
Tin	ppm	ASTM D5185(m)	>10	2		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	78	63		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)	0	2		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)	0	39		
Calcium	ppm	ASTM D5185(m)	113	146		
Phosphorus	ppm	ASTM D5185(m)	222	254		
Zinc	ppm	ASTM D5185(m)		51		
Sulfur	ppm	ASTM D5185(m)	1326	1353		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	5		
Sodium	ppm	ASTM D5185(m)		5		
Potassium	ppm	ASTM D5185(m)	>20	3		




OIL ANALYSIS REPORT

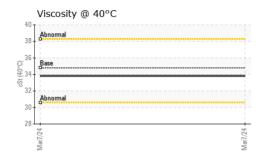

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.1	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	34.8	33.8		

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image
GRAPHS					

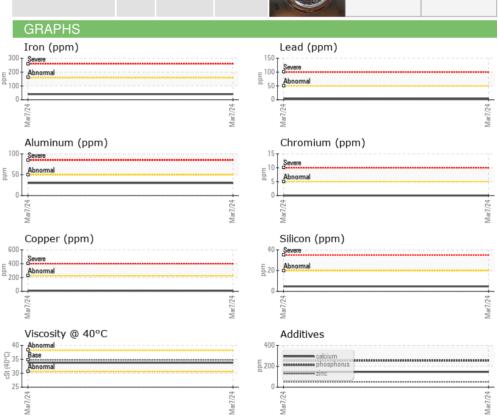



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

Lab Number : 02621143

Unique Number : 5746262 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 209 - Hamilton : GFL0110225 Received **Tested**

Diagnosed

: 11 Mar 2024 : 11 Mar 2024

: 11 Mar 2024 - Kevin Marson

560 Seaman Street Stoney Creek, ON **CA L8E 3X7** Contact: Fred Carleton fred.carleton@gflenv.com

T: (289)925-6693 F: (905)664-9008

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.