



OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Machine Id
OR1973
 Component
Transmission (Auto)
 Fluid
PETRO CANADA PRODURO TO-4 SAE 30 (60 LTR)



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the fluid.

Fluid Condition

The condition of the fluid is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0113305	---	---
Sample Date	Client Info		11 Mar 2024	---	---
Machine Age	hrs	Client Info	25792	---	---
Oil Age	hrs	Client Info	500	---	---
Oil Changed	Client Info		Changed	---	---
Sample Status			NORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.1	NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>160	43	---	---
Chromium	ppm	ASTM D5185(m)	>5	0	---	---
Nickel	ppm	ASTM D5185(m)	>5	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)	>5	0	---	---
Aluminum	ppm	ASTM D5185(m)	>50	1	---	---
Lead	ppm	ASTM D5185(m)	>50	0	---	---
Copper	ppm	ASTM D5185(m)	>225	5	---	---
Tin	ppm	ASTM D5185(m)	>10	0	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---

ADDITIVES


	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)	2	0	---	---
Barium	ppm	ASTM D5185(m)	0	<1	---	---
Molybdenum	ppm	ASTM D5185(m)	0	0	---	---
Manganese	ppm	ASTM D5185(m)	9	0	---	---
Magnesium	ppm	ASTM D5185(m)	1	12	---	---
Calcium	ppm	ASTM D5185(m)	3131	3211	---	---
Phosphorus	ppm	ASTM D5185(m)	1194	1047	---	---
Zinc	ppm	ASTM D5185(m)	1281	1238	---	---
Sulfur	ppm	ASTM D5185(m)	3811	8856	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>20	6	---	---
Sodium	ppm	ASTM D5185(m)		2	---	---
Potassium	ppm	ASTM D5185(m)	>20	1	---	---



OIL ANALYSIS REPORT

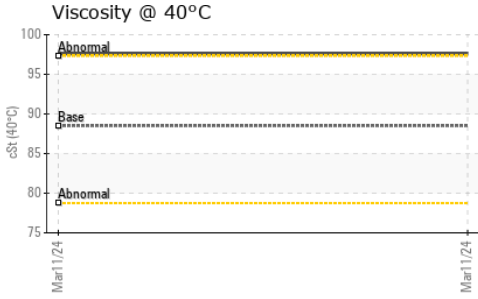









VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Precipitate	scalar	Visual*	NONE	NONE	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---
Free Water	scalar	Visual*		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	88.5	97.6	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image
Bottom				no image	no image

GRAPHS

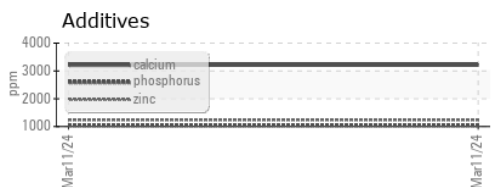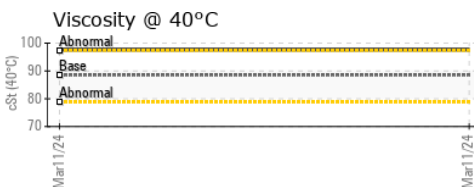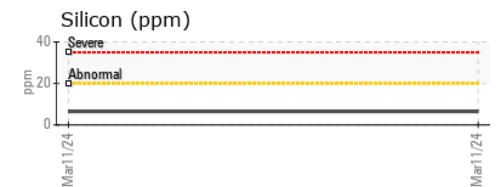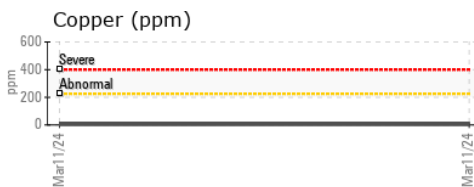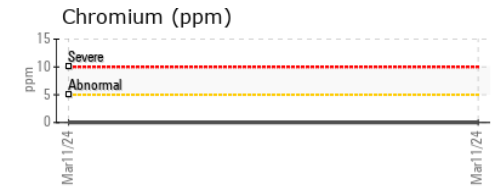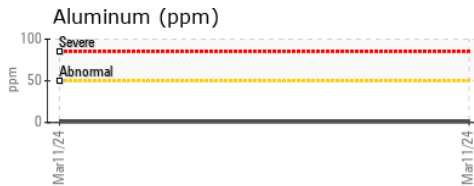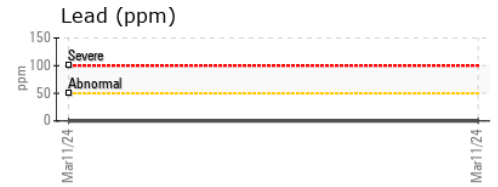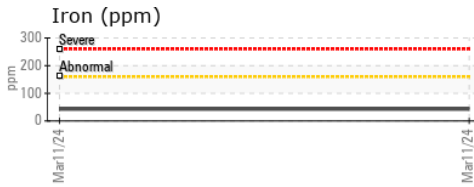

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GFL0113305 **Received** : 21 Mar 2024
Lab Number : 02623777 **Tested** : 21 Mar 2024
Unique Number : 5748896 **Diagnosed** : 21 Mar 2024 - Wes Davis
Test Package : MOB 1

GFL Environmental - 720 - Lafleche - Landfill
 17125 Lafleche Road,
 Moose Creek, ON
 CA K0C 1W0
 Contact: Charles Bergeron
 cbergeron@gflenv.com
 T: (613)538-4853
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.