


# **OIL ANALYSIS REPORT**



**NORMAL** 

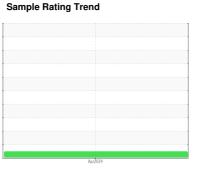

Machine Id Or1979

Front Right Final Drive

PETRO CANADA TRAXON E SYNTHETIC

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.

### **Fluid Condition**

The condition of the oil is acceptable for the time in service.

75W-90 (10 LTR)	)			Apr2024		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0113383		
Sample Date		Client Info		01 Apr 2024		
Machine Age	hrs	Client Info		16204		
Oil Age	hrs	Client Info		16204		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	ΓΙΟΝ	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METAL	_S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	86		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	0		
Titanium	ppm	ASTM D5185(m)		<1		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	3		
Lead	ppm	ASTM D5185(m)	>25	0		
Copper	ppm	ASTM D5185(m)	>50	<1		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	21		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	229	174		
Barium	ppm	ASTM D5185(m)	<1	<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	<1	2		
Calcium	ppm	ASTM D5185(m)		21		
Phosphorus	ppm	ASTM D5185(m)	1355	992		
Zinc	ppm	ASTM D5185(m)		8		
Sulfur	ppm	ASTM D5185(m)	22698	17390		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	28		
Sodium	ppm	ASTM D5185(m)		5		

ASTM D5185(m) >20

ppm

Potassium




## **OIL ANALYSIS REPORT**



VISUAL		method				history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
<b>Emulsified Water</b>	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	100.8	337		
SAMPLE IMAG	iES	method	limit/base	current	history1	history2
Color					no image	no image

SAMPLE IMAGE	:S method	limit/base		history1	nistory2
Color				no image	no image
Bottom				no image	no image
GRAPHS					
Iron (ppm)			Lead (ppm)		
2000 Severe		150	Severe		
Abnormal		E 100 -	Abnormal		
Apr1/24		Apr1/24	Apr1/24		Apr1/24

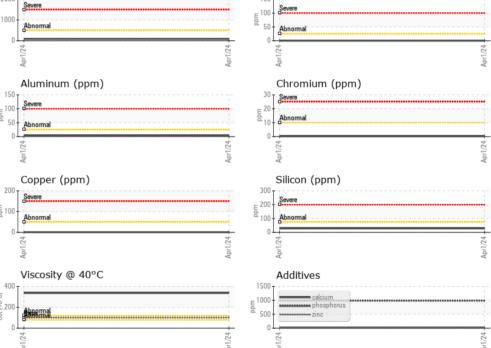



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 720 - Lafleche - Landfill Lab Number : 02626454

: GFL0113383 Unique Number : 5759586 Test Package : MOB 1

Received : 03 Apr 2024 **Tested** 

: 03 Apr 2024 Diagnosed

: 03 Apr 2024 - Wes Davis

17125 Lafleche Road, Moose Creek, ON CA K0C 1W0 Contact: Charles Bergeron cbergeron@gflenv.com T: (613)538-4853

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.