

OIL ANALYSIS REPORT

F S

Sample Rating Trend

NORMAL



Machine Id
Or1979

Rear Right Final Drive

Fluid

PETRO CANADA TRAXON E SYNTHETIC 75W-90 (10 LTR

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

75W-90 (10 LTR)			Apr2024		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0113382		
Sample Date		Client Info		01 Apr 2024		
Machine Age	hrs	Client Info		16204		
Oil Age	hrs	Client Info		16204		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINA	TION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METAI	LS	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	88		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		<1		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	4		
Lead	ppm	ASTM D5185(m)	>25	0		
Copper	ppm	ASTM D5185(m)	>50	<1		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	23		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	229	160		
Barium	ppm	ASTM D5185(m)	<1	<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	<1	2		
Calcium	ppm	ASTM D5185(m)		23		
Phosphorus	ppm	ASTM D5185(m)	1355	986		
Zinc	ppm	ASTM D5185(m)		8		
Sulfur	ppm	ASTM D5185(m)	22698	16702		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	28		
Sodium	ppm	ASTM D5185(m)		3		

ASTM D5185(m) >20

ppm


2

Potassium




OIL ANALYSIS REPORT

SAMBLE IMAGES

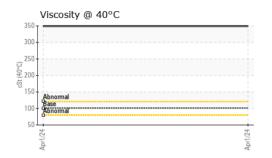

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	VLITE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	100.8	349		

SAMPLE IMAGES	method	ilmit/base	current	nistory i	nistory2
Color				no image	no image
Bottom				no image	no image
CDADUC					

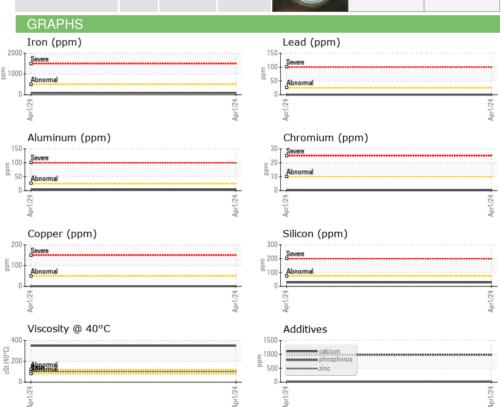



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: GFL0113382 Lab Number : 02626469 Unique Number : 5759601 Test Package : MOB 1

Received **Tested** Diagnosed

: 03 Apr 2024 : 03 Apr 2024

: 03 Apr 2024 - Wes Davis

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 720 - Lafleche - Landfill 17125 Lafleche Road, Moose Creek, ON CA K0C 1W0

Contact: Charles Bergeron cbergeron@gflenv.com T: (613)538-4853

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.