




# OIL ANALYSIS REPORT

Sample Rating Trend

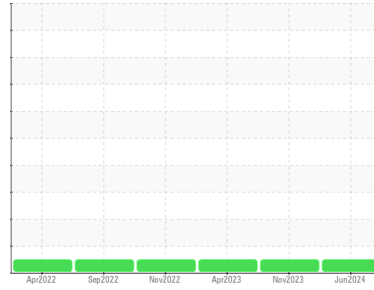

**NORMAL**



Machine Id  
**V411201B FWP B GEN LUBE OIL TANK**  
 Component  
**Tank Lube System**  
 Fluid  
**MOBIL DTE OIL MEDIUM (--- GAL)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.  
 NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

### Wear

All component wear rates are normal.

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>PC14005838</b>	PP13932690	PP13852824
Sample Date	Client Info			<b>20 Jun 2024</b>	25 Nov 2023	13 Apr 2023
Machine Age	hrs	Client Info		<b>0</b>	0	0
Oil Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed	Client Info			<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.05	<b>NEG</b>	NEG	NEG






WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Chromium	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	<1	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	0
Aluminum	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	0	0
Lead	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>20	<b>32</b>	32	30
Tin	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	<1	<1
Antimony	ppm	ASTM D5185(m)		<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	0
Barium	ppm	ASTM D5185(m)		<b>0</b>	<1	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)		<b>2</b>	3	2
Calcium	ppm	ASTM D5185(m)		<b>3</b>	4	2
Phosphorus	ppm	ASTM D5185(m)		<b>94</b>	95	103
Zinc	ppm	ASTM D5185(m)		<b>96</b>	105	100
Sulfur	ppm	ASTM D5185(m)		<b>1216</b>	1320	1216
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<b>3</b>	4	4
Sodium	ppm	ASTM D5185(m)		<b>1</b>	0	<1
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	0	0

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<b>323</b>	1096	246
Particles >6µm		ASTM D7647	>1300	<b>68</b>	317	54
Particles >14µm		ASTM D7647	>160	<b>10</b>	31	3
Particles >21µm		ASTM D7647	>40	<b>3</b>	6	1
Particles >38µm		ASTM D7647	>10	<b>1</b>	0	0
Particles >71µm		ASTM D7647	>3	<b>1</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>16/13/10</b>	17/15/12	15/13/9

# OIL ANALYSIS REPORT

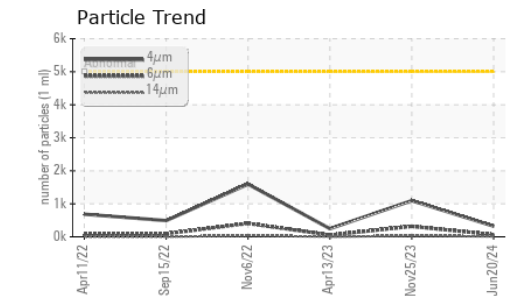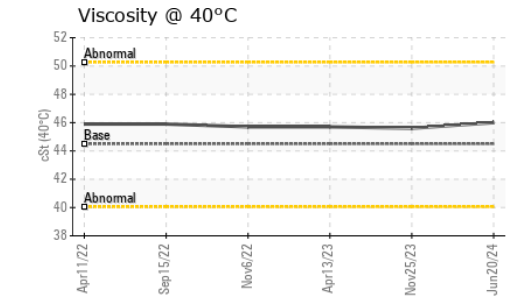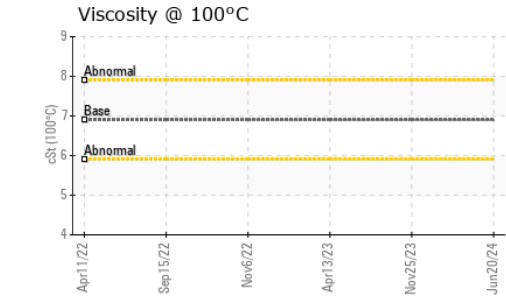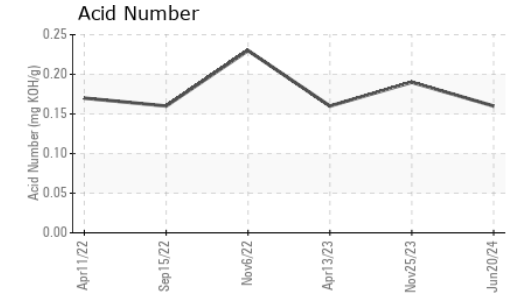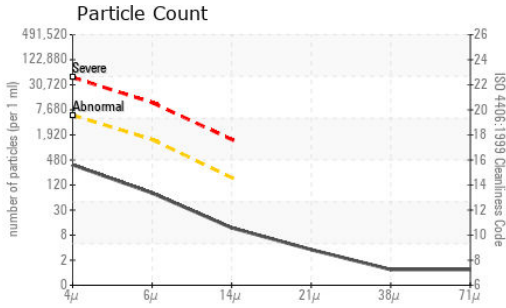


FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		<b>0.16</b>	0.19	0.16

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	<b>VLITE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Precipitate	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	<b>NEG</b>	NEG	NEG
Free Water	scalar	Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	44.5	<b>46.0</b>	45.6	45.7
Visc @ 100°C	cSt	ASTM D7279(m)	6.9	<b>6.9</b>	---	---
Viscosity Index (VI)	Scale	ASTM D2270*	98	<b>105</b>	---	---

## SAMPLE IMAGES

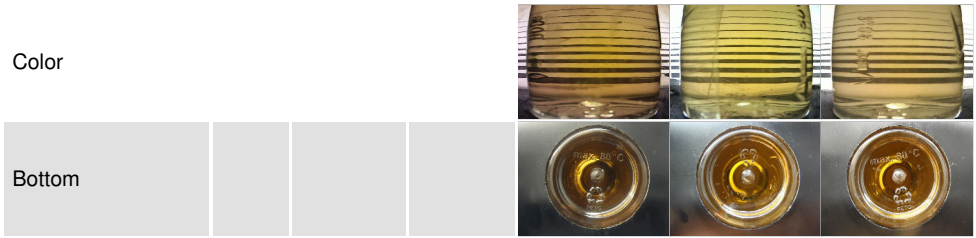

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : PC14005838  
**Lab Number** : **02647923**  
**Unique Number** : 5813475  
**Test Package** : MAR 2 ( Additional Tests: Bottom, KV100, TAN Man, VI )

**ExxonMobil Canada East Ltd.**  
 Hebron-Materials and Repair Coordin, Suite 1000, 100 New Gow  
 St. John`s, NL  
 CA A1C 6K3  
 Contact: Liam Maher  
 liam.m.maher@exxonmobil.com  
 T: (709)273-3729  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.