

PROBLEM SUMMARY

Sample Rating Trend




ISO



Machine Id
LEVELER
 Component
Hydraulic System
 Fluid
MDI AW 46 (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

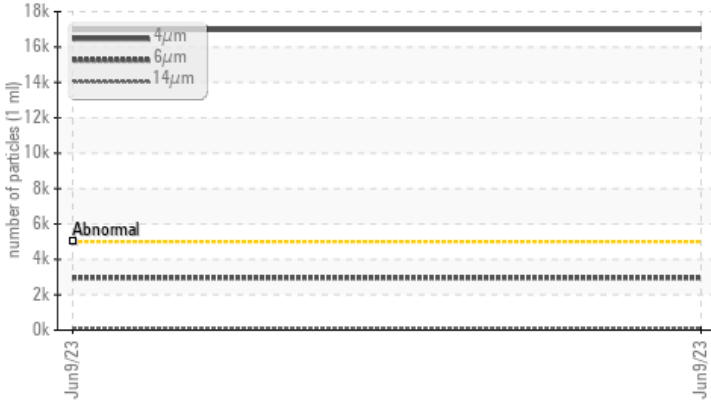

RECOMMENDATION

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	---	---
Particles >4µm	ASTM D7647	>5000	▲ 16976	---	---
Particles >6µm	ASTM D7647	>1300	▲ 2960	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 21/19/14	---	---

Customer Id: NATEAS
Sample No.: PCA0100281
Lab Number: 05872655
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Wes Davis +1 905-569-8600 x223
wesd@wearcheck.ca

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Resample	---	---	?	We recommend an early resample to monitor this condition.
Information Required	---	---	?	NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

HISTORICAL DIAGNOSIS

OIL ANALYSIS REPORT

Sample Rating Trend


ISO

 Machine Id
LEVELER
 Component
Hydraulic System
 Fluid
MDI AW 46 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	PCA0100281	---	---
Sample Date	Client Info	09 Jun 2023	---	---
Machine Age	hrs Client Info	0	---	---
Oil Age	hrs Client Info	0	---	---
Oil Changed	Client Info	N/A	---	---
Sample Status		ABNORMAL	---	---

WEAR METALS

method	limit/base	current	history1	history2
Iron ppm ASTM D5185m	>20	<1	---	---
Chromium ppm ASTM D5185m	>20	0	---	---
Nickel ppm ASTM D5185m	>20	0	---	---
Titanium ppm ASTM D5185m		0	---	---
Silver ppm ASTM D5185m		0	---	---
Aluminum ppm ASTM D5185m	>20	0	---	---
Lead ppm ASTM D5185m	>20	0	---	---
Copper ppm ASTM D5185m	>20	2	---	---
Tin ppm ASTM D5185m	>20	0	---	---
Vanadium ppm ASTM D5185m		0	---	---
Cadmium ppm ASTM D5185m		0	---	---

ADDITIVES

method	limit/base	current	history1	history2
Boron ppm ASTM D5185m		<1	---	---
Barium ppm ASTM D5185m		0	---	---
Molybdenum ppm ASTM D5185m		2	---	---
Manganese ppm ASTM D5185m		<1	---	---
Magnesium ppm ASTM D5185m		12	---	---
Calcium ppm ASTM D5185m		85	---	---
Phosphorus ppm ASTM D5185m		335	---	---
Zinc ppm ASTM D5185m		403	---	---
Sulfur ppm ASTM D5185m		3570	---	---

CONTAMINANTS

method	limit/base	current	history1	history2
Silicon ppm ASTM D5185m	>15	7	---	---
Sodium ppm ASTM D5185m		<1	---	---
Potassium ppm ASTM D5185m	>20	<1	---	---





FLUID CLEANLINESS

method	limit/base	current	history1	history2
Particles >4µm ASTM D7647	>5000	▲ 16976	---	---
Particles >6µm ASTM D7647	>1300	▲ 2960	---	---
Particles >14µm ASTM D7647	>160	120	---	---
Particles >21µm ASTM D7647	>40	26	---	---
Particles >38µm ASTM D7647	>10	1	---	---
Particles >71µm ASTM D7647	>3	0	---	---
Oil Cleanliness ISO 4406 (c)	>19/17/14	▲ 21/19/14	---	---

FLUID DEGRADATION

method	limit/base	current	history1	history2
Acid Number (AN) mg KOH/g ASTM D8045		0.27	---	---

OIL ANALYSIS REPORT

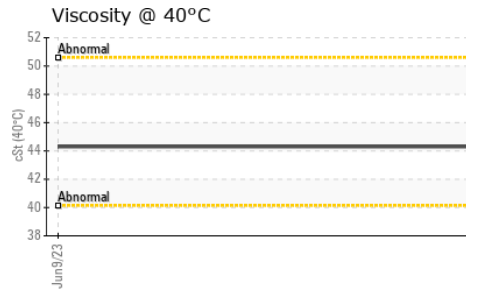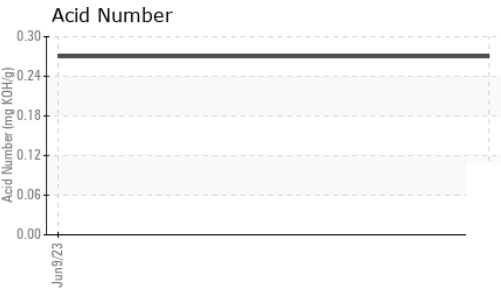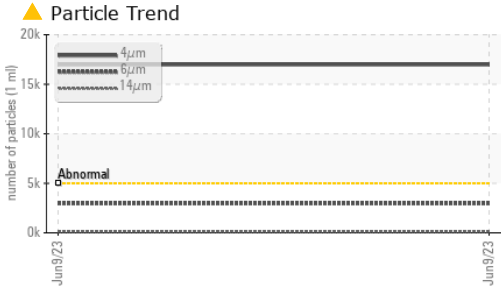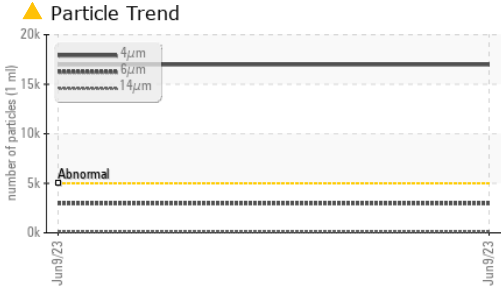





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	44.3	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image
Bottom				no image	no image

GRAPHS

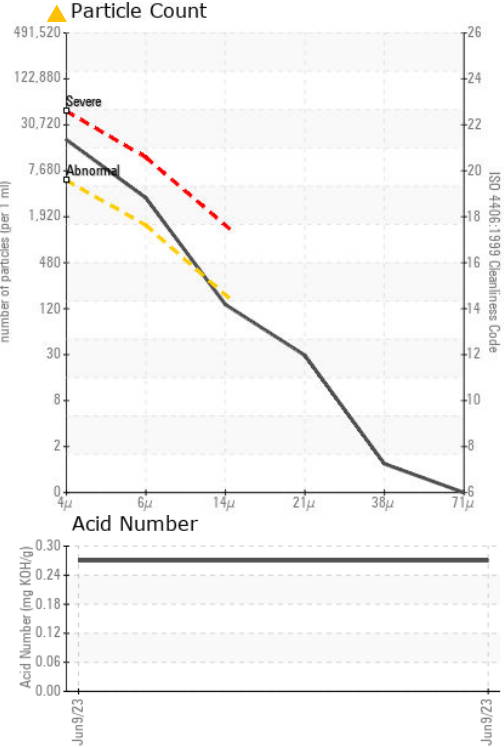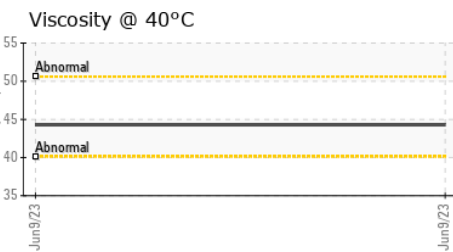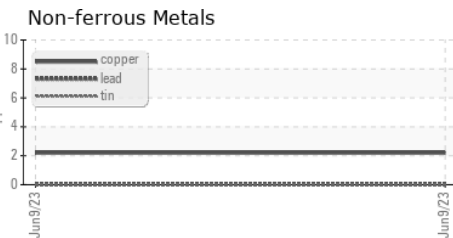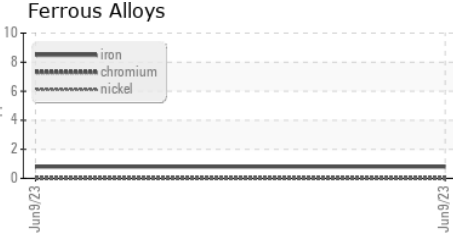

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0100281 **Received** : 13 Jun 2023
Lab Number : 05872655 **Diagnosed** : 14 Jun 2023
Unique Number : 10512439 **Diagnostician** : Wes Davis
Test Package : IND 2

NATIONAL MATERIAL PROCESSING
 4506 CLINE AVE
 EAST CHICAGO, IN
 US 46312
 Contact: RYAN CANO
 rcano@nmlp.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: