


OIL ANALYSIS REPORT



NORMAL

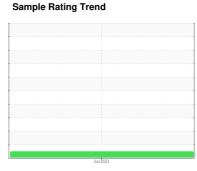

Machine Id **829085**

Component **Transmission**

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the fluid.

Fluid Condition

The condition of the fluid is acceptable for the time in service.

				Jun2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0085322		
Sample Date		Client Info		15 Jun 2023		
Machine Age	hrs	Client Info		5629		
Oil Age	hrs	Client Info		1220		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METAL	_S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	44		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>50	14		
Lead	ppm	ASTM D5185m	>50	18		
Copper	ppm	ASTM D5185m	>200	8		
Tin	ppm	ASTM D5185m	>10	2		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		91		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		89		
Phosphorus	ppm	ASTM D5185m		240		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		1545		
CONTAMINAN	NTS	method	limit/base	current	history1	history2
Silicon	ppm		>50	4		
Sodium	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	2		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2


Visc @ 40°C

cSt

ASTM D445





OIL ANALYSIS REPORT

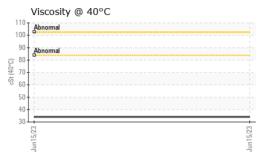


SAMPLE IMAGES	S method	limit/base	current	history1	history2
Color			no image	no image	no image
Bottom			no image	no image	no image

GRAPHS

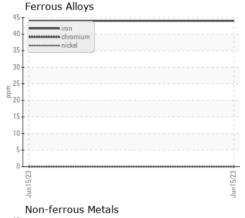

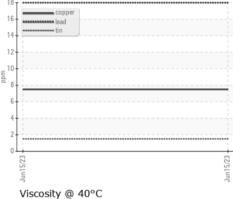



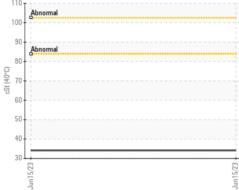



Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10525496

: GFL0085322 : 05880393 Test Package : FLEET

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 21 Jun 2023 Diagnosed : 24 Jun 2023

Diagnostician : Don Baldridge

GFL Environmental - 958 - Tri County HC Morton

1090 W. Jefferson St. Morton, IL US 61550

Contact: Bryan Link

blink@gflenv.com T:

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: