



# OIL ANALYSIS REPORT

Sample Rating Trend

**NORMAL**



Machine Id  
**920087**

Component  
**1 Transmission (Auto)**

Fluid  
**PETRO CANADA DuraDrive HD Synthetic 668 (--- GAL)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.

### Fluid Condition

The condition of the oil is acceptable for the time in service.

## SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	<b>GFL0083416</b>	---	---
Sample Date	Client Info	<b>15 Jun 2023</b>	---	---
Machine Age	mls Client Info	<b>152825</b>	---	---
Oil Age	mls Client Info	<b>152825</b>	---	---
Oil Changed	Client Info	<b>Changed</b>	---	---
Sample Status		<b>NORMAL</b>	---	---

## WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185m >160	<b>50</b>	---	---
Chromium	ppm ASTM D5185m >5	<b>&lt;1</b>	---	---
Nickel	ppm ASTM D5185m >5	<b>0</b>	---	---
Titanium	ppm ASTM D5185m	<b>0</b>	---	---
Silver	ppm ASTM D5185m >5	<b>0</b>	---	---
Aluminum	ppm ASTM D5185m >50	<b>14</b>	---	---
Lead	ppm ASTM D5185m >50	<b>3</b>	---	---
Copper	ppm ASTM D5185m >225	<b>9</b>	---	---
Tin	ppm ASTM D5185m >10	<b>1</b>	---	---
Vanadium	ppm ASTM D5185m	<b>0</b>	---	---
Cadmium	ppm ASTM D5185m	<b>0</b>	---	---

## ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185m	<b>80</b>	---	---
Barium	ppm ASTM D5185m	<b>0</b>	---	---
Molybdenum	ppm ASTM D5185m	<b>&lt;1</b>	---	---
Manganese	ppm ASTM D5185m	<b>&lt;1</b>	---	---
Magnesium	ppm ASTM D5185m	<b>&lt;1</b>	---	---
Calcium	ppm ASTM D5185m	<b>120</b>	---	---
Phosphorus	ppm ASTM D5185m	<b>223</b>	---	---
Zinc	ppm ASTM D5185m	<b>0</b>	---	---
Sulfur	ppm ASTM D5185m	<b>1938</b>	---	---

## CONTAMINANTS

method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185m >20	<b>3</b>	---	---
Sodium	ppm ASTM D5185m	<b>3</b>	---	---
Potassium	ppm ASTM D5185m >20	<b>3</b>	---	---

## VISUAL


method	limit/base	current	history1	history2
White Metal	scalar *Visual NONE	<b>NONE</b>	---	---
Yellow Metal	scalar *Visual NONE	<b>NONE</b>	---	---
Precipitate	scalar *Visual NONE	<b>NONE</b>	---	---
Silt	scalar *Visual NONE	<b>NONE</b>	---	---
Debris	scalar *Visual NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar *Visual NONE	<b>NONE</b>	---	---
Appearance	scalar *Visual NORML	<b>NORML</b>	---	---
Odor	scalar *Visual NORML	<b>NORML</b>	---	---
Emulsified Water	scalar *Visual >0.1	<b>NEG</b>	---	---
Free Water	scalar *Visual	<b>NEG</b>	---	---

## FLUID PROPERTIES

method	limit/base	current	history1	history2
Visc @ 40°C	cSt ASTM D445 34	<b>31.6</b>	---	---






# OIL ANALYSIS REPORT

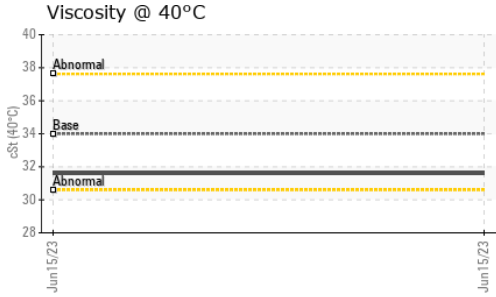

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			no image	no image	no image
Bottom			no image	no image	no image

## GRAPHS

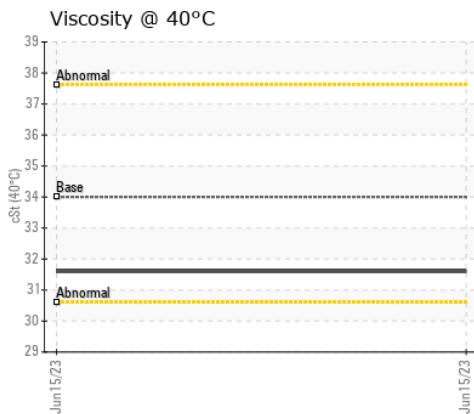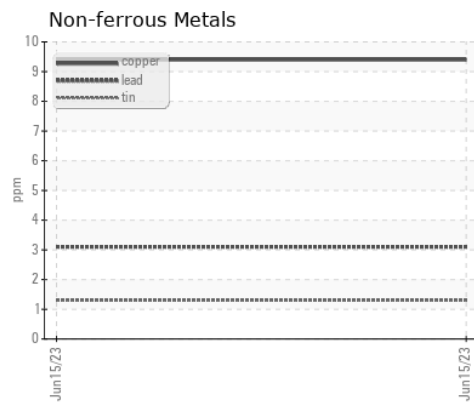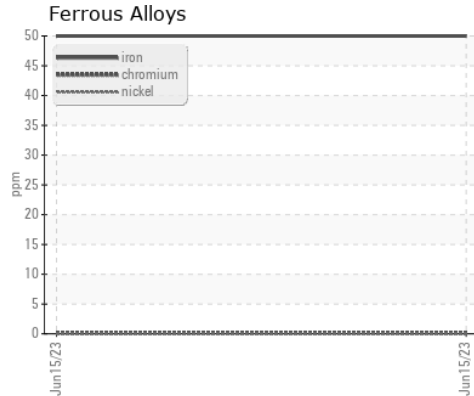

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : GFL0083416     **Received** : 23 Jun 2023  
**Lab Number** : 05882419     **Diagnosed** : 28 Jun 2023  
**Unique Number** : 10532902     **Diagnostician** : Don Baldrige  
**Test Package** : FLEET

**GFL Environmental - 865 - East Mount Hauling**  
 7213 East Mount Houston Road  
 Houston, TX  
 US 77050  
 Contact: TECHNICIAN ACCOUNT  
 wcgfldemo@gmail.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)