

OIL ANALYSIS REPORT

NORMAL



Area [98316607]

KR-GR-001587 - MARLEN (S/N STUFF C - 11513126)

Vacuum Pump

ISO 100 SYNTHETIC (20 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The condition of the oil is acceptable for the time in service.



Sample Number		Client Info		PCA0101932		
Sample Date		Client Info		06 Jul 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	4		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	2		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	5		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		5		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		626		
Zinc	ppm	ASTM D5185m		6		
Sulfur	ppm	ASTM D5185m		2127		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual		NEG		

FLUID PROPERTIES

Free Water

scalar *Visual

NEG




OIL ANALYSIS REPORT







GRAPHS

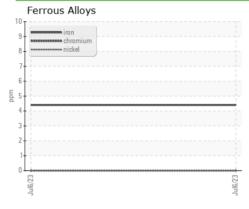

Non-ferrous Metals

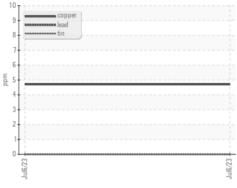

Viscosity @ 40°C 115

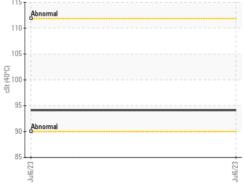



Certificate L2367

Laboratory Sample No.

Lab Number Unique Number : 10551243 Test Package : IND 1

: PCA0101932 : 05895433

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 11 Jul 2023 Diagnosed : 13 Jul 2023

Diagnostician : Don Baldridge

KIRKSVILLE, MO US 63501 Contact: WALLACE WARD

2504 INDUSTRIAL DR

KraftHeinz - Kirksville - Plant 8333 PCA

wallace.ward@kraftheinzcompany.com

T: (660)627-1031 F: (660)627-5887

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: KRAKIR [WUSCAR] 05895433 (Generated: 07/13/2023 14:11:13) Rev: 1

Contact/Location: WALLACE WARD - KRAKIR