


PROBLEM SUMMARY


Area
(55217Z) Walgreens
 Machine Id
[Walgreens] 136A63266
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 10W30 (11 GAL)

Sample Rating Trend

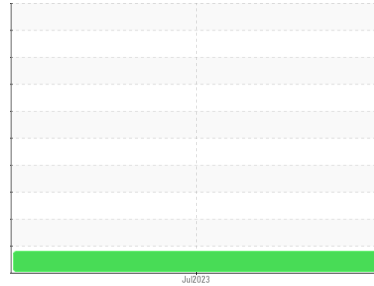


COMPONENT CONDITION SUMMARY


▲ Non-ferrous Metals

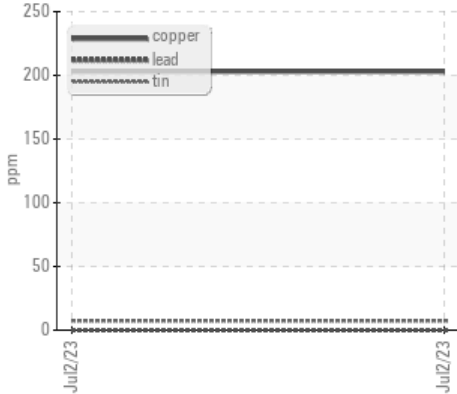

Glycol Contamination

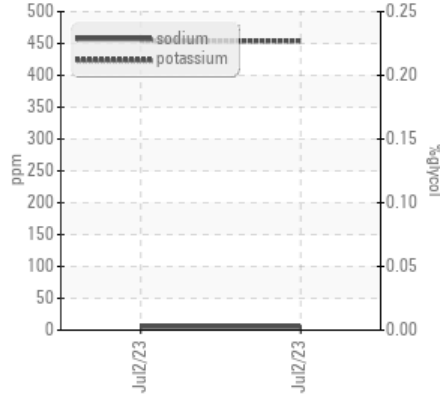

Aluminum (ppm)

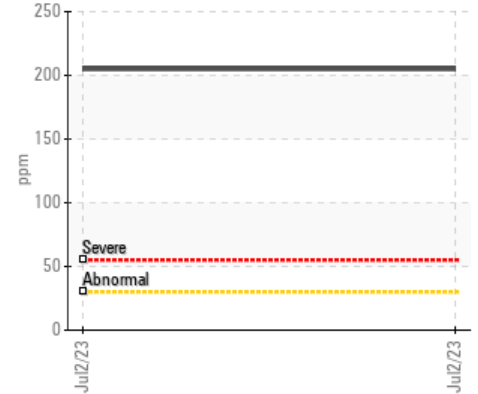

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status	ABNORMAL	---	---
Copper	ppm	ASTM D5185m	>150
	▲ 203	---	---

Customer Id: TSV1367
 Sample No.: PCA0094393
 Lab Number: 05896786
 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Fluid	---	---	?	Oil and filter change at the time of sampling has been noted.
Change Filter	---	---	?	Oil and filter change at the time of sampling has been noted.

HISTORICAL DIAGNOSIS

OIL ANALYSIS REPORT

Sample Rating Trend



WEAR



Area
(55217Z) Walgreens
Machine Id
[Walgreens] 136A63266
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 10W30 (11 GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

The copper level is abnormal. In the absence of other significant wear metals, suspect copper due to sources other than wear (i.e. cooling core). All other metal levels are typical for a new component breaking in.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		PCA0094393	---	---
Sample Date	Client Info		02 Jul 2023	---	---
Machine Age	mls	Client Info	42798	---	---
Oil Age	mls	Client Info	42798	---	---
Oil Changed	Client Info		Changed	---	---
Sample Status			ABNORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>5	<1.0	---	---
Glycol	WC Method		NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >80	68	---	---
Chromium	ppm	ASTM D5185m >5	6	---	---
Nickel	ppm	ASTM D5185m >2	2	---	---
Titanium	ppm	ASTM D5185m	0	---	---
Silver	ppm	ASTM D5185m >3	<1	---	---
Aluminum	ppm	ASTM D5185m >30	205	---	---
Lead	ppm	ASTM D5185m >30	0	---	---
Copper	ppm	ASTM D5185m >150	▲ 203	---	---
Tin	ppm	ASTM D5185m >5	7	---	---
Vanadium	ppm	ASTM D5185m	0	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 2	25	---	---
Barium	ppm	ASTM D5185m 0	0	---	---
Molybdenum	ppm	ASTM D5185m 50	44	---	---
Manganese	ppm	ASTM D5185m 0	5	---	---
Magnesium	ppm	ASTM D5185m 950	529	---	---
Calcium	ppm	ASTM D5185m 1050	1582	---	---
Phosphorus	ppm	ASTM D5185m 995	689	---	---
Zinc	ppm	ASTM D5185m 1180	886	---	---
Sulfur	ppm	ASTM D5185m 2600	2025	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >20	9	---	---
Sodium	ppm	ASTM D5185m	5	---	---
Potassium	ppm	ASTM D5185m >20	454	---	---


INFRA-RED

	method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844 >3	0.9	---	---
Nitration	Abs/cm	*ASTM D7624 >20	10.6	---	---
Sulfation	Abs/.1mm	*ASTM D7415 >30	24.4	---	---


FLUID DEGRADATION

	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414 >25	24.7	---	---
Base Number (BN)	mg KOH/g	ASTM D2896	7.4	---	---

OIL ANALYSIS REPORT







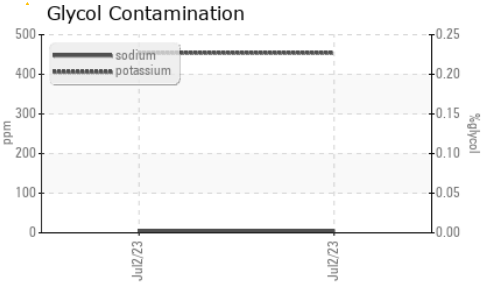


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---
Free Water	scalar	*Visual		NEG	---

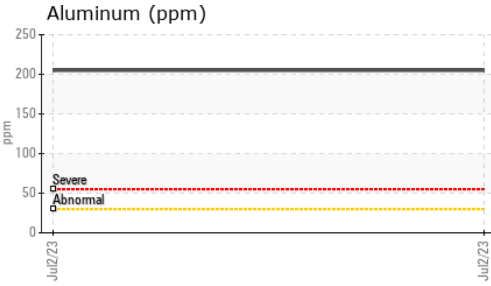

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	12.00	10.2	---

GRAPHS

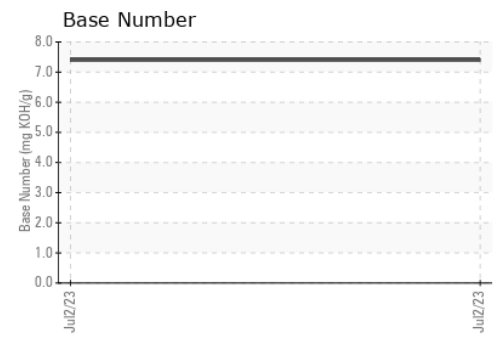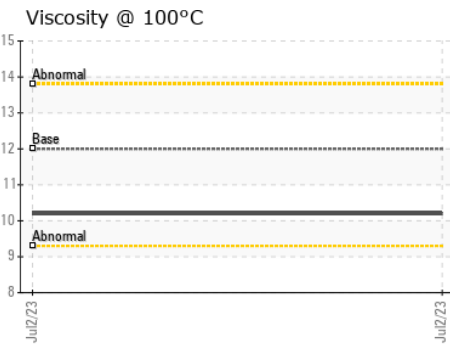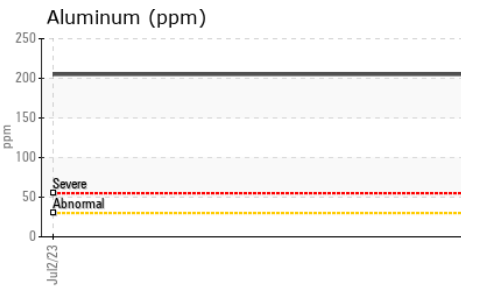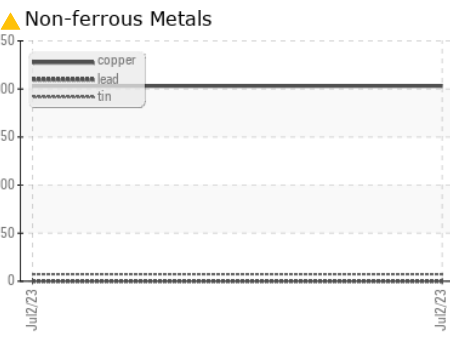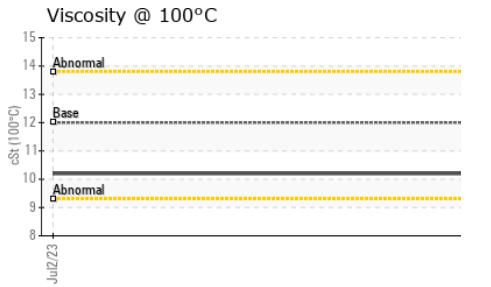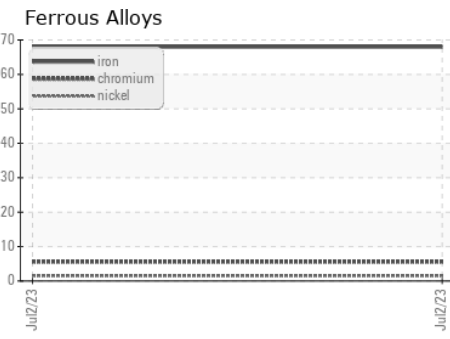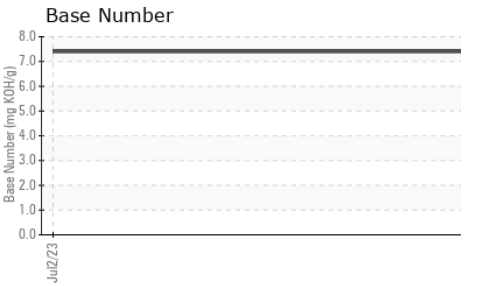

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0094393
Lab Number : 05896786
Unique Number : 10552596
Test Package : FLEET

Transervice - Shop 1367 - Berkeley-Jupiter
 15998 Walgreens Drive
 Jupiter, FL
 US 33478
 Contact: Manny Gonzalez
 egonzalez@transervice.com
 T: (561)776-0755
 F: (561)776-0799

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)