

OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL

Machine Id **2227012**

Component

Hydraulic System

PETRO CANADA HYDREX MV 32 (--- QTS)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The condition of the oil is acceptable for the time in service.

				Jul2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0088706		
Sample Date		Client Info		08 Jul 2023		
Machine Age	mls	Client Info		57250		
Oil Age	mls	Client Info		40000		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	4		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	<1		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	2		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		<1		
Barium	ppm	ASTM D5185m		2		
Molybdenum	ppm	ASTM D5185m		3		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		34		
Calcium	ppm	ASTM D5185m		121		
Phosphorus	ppm	ASTM D5185m		347		
Zinc	ppm	ASTM D5185m		485		
Sulfur	ppm	ASTM D5185m		1315		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	4		
Sodium	ppm	ASTM D5185m	>10	<1		
Potassium	ppm	ASTM D5185m	>20	<1		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.05	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2




OIL ANALYSIS REPORT

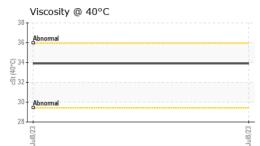


SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			no image	no image	no image
Bottom			no image	no image	no image


GRAPHS

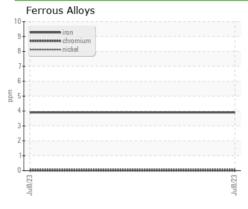

Non-ferrous Metals

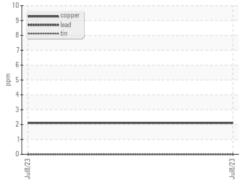



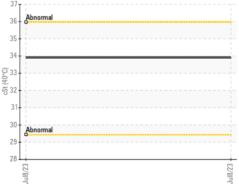





Certificate L2367

Laboratory

Sample No. Lab Number Unique Number : 10560427 Test Package : FLEET

: PCA0088706 : 05899071

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed Diagnostician : Wes Davis

: 14 Jul 2023 : 17 Jul 2023

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

PERDUE FARMS - SALISBURY

7036 ZION CHURCH ROAD SALISBURY, MD

US 21802

Contact: RICHARD O'NEAL richard.oneal@perdue.com

> T: (410)543-3628 F: (410)341-2164