


PROBLEM SUMMARY


PASTA [98259369]

Component **Gearbox**

GEAR OIL ISO 150 (--- GAL)

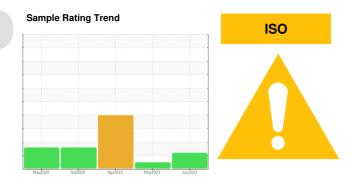

COMPONENT CONDITION SUMMARY

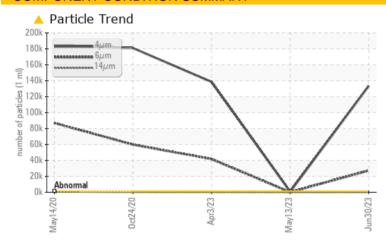

B PRESS VACUUM ROTOMISSION

RECOMMENDATION

The oil change at the time of sampling has been noted. We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

PROBLEMATIC TES	T RESULT	S			
Sample Status			ABNORMAL	NORMAL	SEVERE
Particles >4μm	ASTM D7647	>1300	<u> </u>	669	138539
Particles >6μm	ASTM D7647	>320	27323	132	41741
Oil Cleanliness	ISO 4406 (c)	>17/15/13	A 24/22/13	17/14/11	24/23/14

Customer Id: KRASPRMO Sample No.: PCA0099599 Lab Number: 05902258 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component if applicable.

HISTORICAL DIAGNOSIS

13 May 2023 Diag: Don Baldridge

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



03 Apr 2023 Diag: Doug Bogart

ISO



The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

24 Oct 2020 Diag: Jonathan Hester

150



The oil change at the time of sampling has been noted. We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.






OIL ANALYSIS REPORT

PASTA [98259369] **B PRESS VACUUM ROTOMISSION**

Component

Gearbox

GEAR OIL ISO 150 (--- GAL)

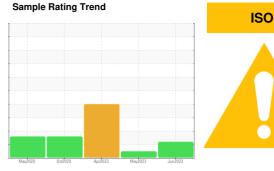

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

	LATION	and the set	Proch florida		foto second	In ! - 1 - 1 - 0
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0099599	PCA0096813	PCA0073975
Sample Date		Client Info		30 Jun 2023	13 May 2023	03 Apr 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Sample Status				ABNORMAL	NORMAL	SEVERE
WEAR METALS	6	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	6	<1	10
Chromium	ppm	ASTM D5185m	>15	0	<1	0
Nickel	ppm	ASTM D5185m	>15	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	<1	0
Aluminum	ppm	ASTM D5185m	>25	<1	<1	0
Lead	ppm	ASTM D5185m	>100	<1	<1	0
Copper	ppm	ASTM D5185m	>200	0	0	0
Tin	ppm	ASTM D5185m	>25	0	0	0
Antimony	ppm	ASTM D5185m	>5			
Vanadium	ppm	ASTM D5185m	-	0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
	ррпп			•		-
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	50	0	0	0
Barium	ppm	ASTM D5185m	15	0	0	0
Molybdenum	ppm	ASTM D5185m	15	0	<1	0
	ppm	ASTM D5185m	=0	0	<1	<1
Magnesium	ppm	ASTM D5185m	50	0	10	<1
Calcium	ppm	ASTM D5185m	50	0	0	<1
Phosphorus	ppm	ASTM D5185m	350	105	117	119
Zinc	ppm	ASTM D5185m	100	0	7	1
Sulfur	ppm	ASTM D5185m	12500	0	0	17
CONTAMINANT	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	1	2	<1
Sodium	ppm	ASTM D5185m		0	<1	0
Potassium	ppm	ASTM D5185m	>20	0	1	0
FLUID CLEANLI	INESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>1300	<u> </u>	669	138539
Particles >6µm		ASTM D7647	>320	<u>^</u> 27323	132	41741
Particles >14μm		ASTM D7647	>80	62	13	4 97
Particles >21µm		ASTM D7647	>20	7	4	10
Particles >38µm		ASTM D7647	>4	0	1	1
Particles >71µm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>17/15/13	<u>4</u> 24/22/13	17/14/11	2 4/23/14
FLUID DEGRAD	ATION	method	limit/base	current	history1	history2

Acid Number (AN)

mg KOH/g ASTM D8045 0.85

0.36

0.40

0.40



OIL ANALYSIS REPORT







Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: PCA0099599

: 05902258 : 10563614

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 19 Jul 2023

Diagnosed : 21 Jul 2023 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

KraftHeinz - Springfield - Plant 8311 PCA

2035 E BENNETT SPRINGFIELD, MO

US 65804

Contact: Service Manager

T: F: