


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

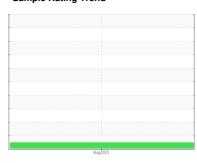

Machine Id **413059**

Component 1 Differential

GEAR OIL SAE 75W90 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. (Customer Sample Comment: 1st Axle/ Pusher)

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The condition of the oil is acceptable for the time in service.

				Aug2023		
SAMPLE INFOR	MATION	method				history2
Sample Number		Client Info		GFL0085499		
Sample Date		Client Info		02 Aug 2023		
Machine Age	mls	Client Info		45612		
Oil Age	mls	Client Info		45612		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METAL	.S	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>500	127		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
_ead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m		29		
Борро. Гin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	400	253		
Barium	ppm	ASTM D5185m	200	0		
Molybdenum	ppm	ASTM D5185m	12	0		
Manganese	ppm	ASTM D5185m		17		
Magnesium	ppm	ASTM D5185m	12	3		
Calcium	ppm	ASTM D5185m	150	7		
Phosphorus	ppm	ASTM D5185m	1650	1495		
Zinc	ppm	ASTM D5185m	125	6		
Sulfur	ppm	ASTM D5185m	22500	30605		
CONTAMINAN	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>75	30		
Sodium	ppm	ASTM D5185m		5		
Potassium	ppm	ASTM D5185m	>20	4		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	LIGHT		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>.2	NEG		
Free Water	scalar	*Visual	7.L	NEG		
FLUID PROPE		method	limit/base	current	history1	history2
T LOID I NOI L	TITLO	— metriou	- IIIIII Dase	carrent	— HISTOLY I	— HISTOLYZ




OIL ANALYSIS REPORT

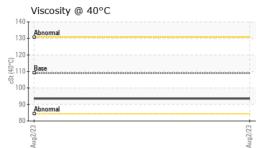


SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			no image	no image	no image
Bottom			no image	no image	no image

GRAPHS

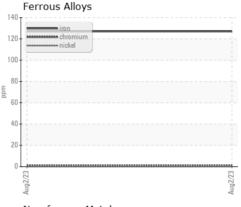

Non-ferrous Metals



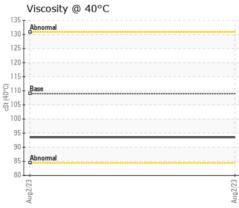





Laboratory Sample No. Lab Number Unique Number : 10590847

: GFL0085499 : 05918933 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 08 Aug 2023 : 09 Aug 2023 Diagnostician : Sean Felton

GFL Environmental - 983 - Sugar Land Hauling 16011 West Belfort Street

Sugar Land, TX US 77498

Contact: TECHNICIAN ACCOUNT

wcgfldemo@gmail.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: