


OIL ANALYSIS REPORT

832012

Component **Natural Gas Engine**

PETRO CANADA DURON GEO LD 15W40 (36 QTS)

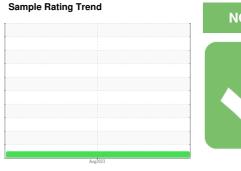



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Metal levels are typical for a components first oil change.

Contamination

There is no indication of any contamination in the


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

(36 QTS)				Aug 2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0101738		
Sample Date		Client Info		07 Aug 2023		
Machine Age	hrs	Client Info		1203		
Oil Age	hrs	Client Info		1203		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	31		
Chromium	ppm	ASTM D5185m	>4	1		
Nickel	ppm	ASTM D5185m	>2	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>9	2		
Lead	ppm	ASTM D5185m	>30	0		
Copper	ppm	ASTM D5185m	>35	12		
Tin	ppm	ASTM D5185m	>4	2		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	50	7		
Barium	ppm	ASTM D5185m	5	2		
Molybdenum	ppm	ASTM D5185m	50	63		
Manganese	ppm	ASTM D5185m	0	9		
Magnesium	ppm	ASTM D5185m	560	823		
Calcium	ppm	ASTM D5185m	1510	1537		
Phosphorus	ppm	ASTM D5185m	780	769		
Zinc	ppm	ASTM D5185m	870	1029		
Sulfur	ppm	ASTM D5185m	2040	2914		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>+100	20		
Sodium	ppm	ASTM D5185m		5		
Potassium	ppm	ASTM D5185m	>20	2		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844		0		
Nitration	Abs/cm	*ASTM D7624	>20	12.4		
Sulfation	Abs/.1mm	*ASTM D7415	>30	24.3		
FLUID DEGRA	NOITAC	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	21.5		
Base Number (BN)	mg KOH/g	ASTM D2896	10.2	4.1		




OIL ANALYSIS REPORT

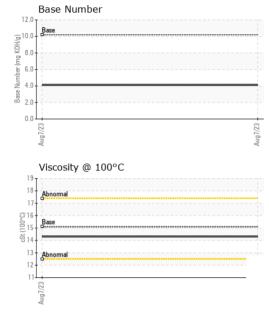


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		


FLUID FROF	LULIES	method			HISTOLAL	HISTOLYZ
Visc @ 100°C	cSt	ASTM D445	15.1	14.3		

GRAPHS

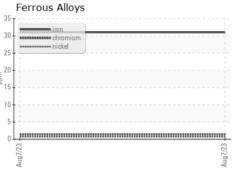

Non-ferrous Metals

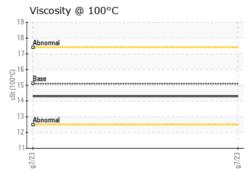

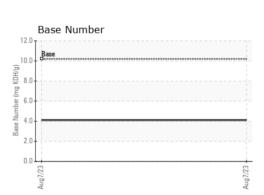





Laboratory Sample No. Lab Number Unique Number : 10591576

: PCA0101738 : 05919662

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 09 Aug 2023 : 09 Aug 2023 Diagnostician : Wes Davis

GFL Environmental - 002 - Vance-Granville

241 Vanco Mill Rd Henderson, NC US 27537

Contact: Cameron King cameron.king@gflenv.com

T: (252)438-5333 F: (252)431-1635

Test Package : FLEET Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: GFL002 [WUSCAR] 05919662 (Generated: 08/09/2023 17:39:20) Rev: 1