


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

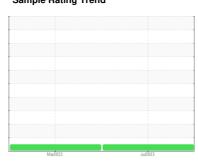

Machine Id **621336**

Component **Diesel Engine**

PETRO CANADA DURON SHP 10W30 (--- QTS)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear

Metal levels are typical for a new component breaking in.

Contamination

There is no indication of any contamination in the

Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

TS)			Mar2023	Jul2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0100802	PCA0093265	
Sample Date		Client Info		17 Jul 2023	29 Mar 2023	
Machine Age	mls	Client Info		18398	13868	
Oil Age	mls	Client Info		4535	13868	
Oil Changed		Client Info		Changed	Changed	
Sample Status				NORMAL	NORMAL	
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0	<1.0	
Glycol		WC Method		NEG	NEG	
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	9	8	
Chromium	ppm	ASTM D5185m	>20	<1	0	
Nickel	ppm	ASTM D5185m	>4	0	0	
Titanium	ppm	ASTM D5185m		6	28	
Silver	ppm	ASTM D5185m	>3	0	<1	
Aluminum	ppm	ASTM D5185m	>20	1	2	
_ead	ppm	ASTM D5185m	>40	<1	0	
Copper	ppm	ASTM D5185m	>330	20	47	
Γin	ppm	ASTM D5185m	>15	<1	<1	
Vanadium	ppm	ASTM D5185m		0	<1	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	11	63	
Barium	ppm	ASTM D5185m	0	1	0	
Molybdenum	ppm	ASTM D5185m	50	53	40	
Manganese	ppm	ASTM D5185m	0	<1	<1	
Magnesium	ppm	ASTM D5185m	950	816	660	
Calcium	ppm	ASTM D5185m	1050	1167	1351	
Phosphorus	ppm	ASTM D5185m	995	978	902	
Zinc	ppm	ASTM D5185m	1180	1144	1046	
Sulfur	ppm	ASTM D5185m	2600	3182	3726	
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	6	7	
Sodium	ppm	ASTM D5185m		<1	0	
Potassium	ppm	ASTM D5185m	>20	6	2	
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.1	0.1	
Vitration	Abs/cm	*ASTM D7624	>20	6.8	5.5	
		*AOTA D7445	- 30	18.0	18.1	
Sulfation	Abs/.1mm	*ASTM D7415	>50	10.0	10.1	
Sulfation FLUID DEGRAD			limit/base	current	history1	history2

Contact/Location: ROSTY VITER - MILPHINE



OIL ANALYSIS REPORT

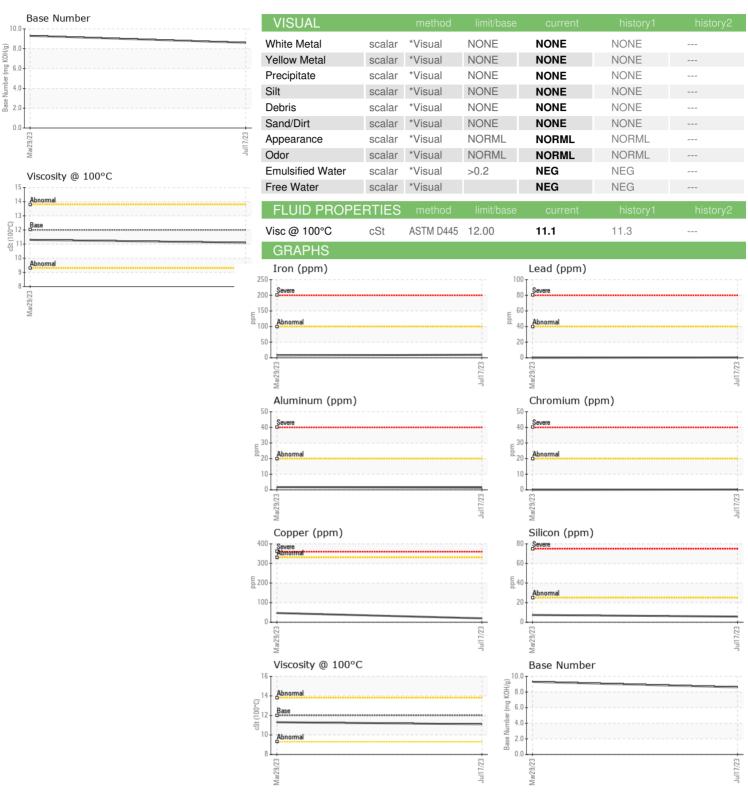





Laboratory Sample No. Lab Number **Unique Number**

: PCA0100802 : 05921240 : 10593154

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 10 Aug 2023 Diagnosed : 11 Aug 2023

Diagnostician : Wes Davis Test Package : MOB 1 (Additional Tests: TBN)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MILLER TRUCK LEASING #118

2196 BENNETT ROAD PHILADELPHIA, PA US 19116

Contact: ROSTY VITER rviter@millertransgroup.com

Contact/Location: ROSTY VITER - MILPHINE

T: (215)552-9832 F: (215)552-9892